

QuadraTherm® 640i/780i Series Insertion and In-Line Mass Flow Meters

Instruction Manual



Part Number: IM-640i/780i Rev.v9
May 2014



SIERRA®
EXPERIENCE OUR PASSION FOR FLOW!

GLOBAL SUPPORT LOCATIONS: WE ARE HERE TO HELP!

CORPORATE HEADQUARTERS

5 Harris Court, Building L Monterey, CA 93940
Phone (831) 373-0200 (800) 866-0200 Fax (831) 373-4402
www.sierrainstruments.com

EUROPE HEADQUARTERS

Bijlmansweid 2 1934RE Egmond aan den Hoef
The Netherlands
Phone +31 72 5071400 Fax +31 72 5071401

ASIA HEADQUARTERS

Second Floor Building 5, Senpu Industrial Park
25 Hangdu Road Hangtoun Town
Pu Dong New District, Shanghai, P.R. China
Postal Code 201316
Phone: + 8621 5879 8521 Fax: +8621 5879 8586

IMPORTANT CUSTOMER NOTICE- OXYGEN SERVICE

Sierra Instruments, Inc. is not liable for any damage or personal injury, whatsoever, resulting from the use of Sierra Instruments standard mass flow meters for oxygen gas. You are responsible for determining if this mass flow meter is appropriate for your oxygen application. You are responsible for cleaning the mass flow meter to the degree required for your oxygen flow application.

© COPYRIGHT SIERRA INSTRUMENTS 2014

No part of this publication may be copied or distributed, transmitted, transcribed, stored in a retrieval system, or translated into any human or computer language, in any form or by any means, electronic, mechanical, manual, or otherwise, or disclosed to third parties without the express written permission of Sierra Instruments. The information contained in this manual is subject to change without notice.

TRADEMARKS

QuadraTherm™, qTherm™ and iAnywhere™ are trademarks of Sierra Instruments, Inc. Other product and company names listed in this manual are trademarks or trade names of their respective manufacturers.

Table of Contents

Chapter 1: Introduction & Product Description	5
Technical Assistance	7
Principle of Operation	8
qTherm™ Electronics Features	9
Enclosure Options	10
Chapter 2: Installation & Wiring	11
Installation Overview	11
Installing the Flow Meter	13
Cold Tap Installation	13
Hot Tap Installation	14
Wiring Connections	17
Input Power Wiring	18
Alarm Output Wiring	21
Remote Sensor Wiring	24
Chapter 3: Operation & Programming	25
Start-up Routine	26
Level 1: Main Menu	26
Level 2: Sub-Menu (Password Protected)	28
Table 3-2: Level 2 Sub-Menu	29
Calibration (Sub-Menu)	29
Calibration (Sub-Menu): Gas Type –“qTherm Dial-A Gas”	30
Calibration (Sub-Menu): Flow Units	32
Calibration (Sub-Menu): Temperature Unit	33
Calibration (Sub-Menu): MenuTune	33
Calibration (Sub-Menu): Low Flow Cut Off	34
Calibration (Sub-Menu): Full Scale Flow	35
Process Pressure (Sub-Menu)	35
Process Pressure (Sub-Menu): Pressure Units	36
Process Pressure Sub-Menu: Process Pressure	36
Totalizer (Sub-Menu)	37
Totalizer Sub-Menu: Reset Pulse Count	37
Totalizer (Sub-Menu): Units Per Pulse	39
Totalizer (Sub-Menu): Totalizer On/Off	39
Output Adjust (Sub-Menu): Flow, Pressure and Temperature	42
Getting 4 to 20 mA for Temperature and Pressure	44
Reference Conditions (Sub-Menu): Standard and Normal	45
Chapter 4: Troubleshooting & Repair	49
Troubleshooting the Flow Meter	49
Returning Equipment to Factory	51
Appendix B: Smart Interface Installation	61
Appendix C: Flow Totalizer Feature	85

Warnings and Cautions



Warning! Agency approval for hazardous location installations varies between flow meter models. Consult the flow meter nameplate for specific flow meter approvals before any hazardous location installation.

Warning! Hot tapping must be performed by a trained professional. U.S. regulations often require a hot tap permit. The manufacturer of the hot tap equipment and/or the contractor performing the hot tap is responsible for providing proof of such a permit

Warning! All wiring procedures must be performed with the power off.

Warning! To avoid potential electric shock, follow National Electric Code safety practices or your local code when wiring this unit to a power source and to peripheral devices. Failure to do so could result in injury or death. All AC power connections must be in accordance with published CE directives.

Warning! Do not power the flow meter with the sensor remote (if applicable) wires disconnected. This could cause over-heating of the sensors and/or damage to the electronics.

Warning! Before attempting any flow meter repair, verify that the line is de-pressurized.

Warning! Always remove main power before disassembling any part of the mass flow meter.



Caution! Before making adjustments to the device, verify the flow meter is not actively monitoring or reporting to any master control system. Adjustments to the electronics will cause direct changes to flow control settings.

Caution! All flow meter connections, isolation valves and fittings for hot tapping must have the same or higher pressure rating as the main pipeline.

Caution! Changing the length of cables or interchanging sensors or sensor wiring will affect the accuracy of the flow meter. You cannot add or subtract wire length without returning the meter to the factory for re-calibration.

Caution! When using toxic or corrosive gases, purge the line with inert gas for a minimum of four hours at full gas flow before installing the meter.

Caution! The AC wire insulation temperature rating must meet or exceed 80°C (176°F).

Caution! Printed circuit boards are sensitive to electrostatic discharge. To avoid damaging the board, follow these precautions to minimize the risk of damage:

- before handling the assembly, discharge your body by touching a grounded, metal object
- handle all cards by their edges unless otherwise required
- when possible, use grounded electrostatic discharge wrist straps when handling sensitive components

Chapter 1: Introduction & Product Description

From Sierra's beginning over forty years ago, Founder Dr. John G. Olin was driven by the vision of supplying industrial customers with the world's most accurate thermal mass flow meter. And, he knew it was a "sensor" game.

The development of an industrialized metal-sheathed sensor in the early 80s was Sierra's first big step, but Dr. Olin is a driven innovator, and this was only the beginning for someone who saw "Thermal Mass Flow" as his life's work. Many successful innovations followed, but in 1999 Sierra experienced a major breakthrough with the introduction of their patented no-drift DrySense™ thermal mass velocity sensor. Sierra engineers now recognized they were on the cusp of realizing Dr. Olin's vision.

Realizing the Vision: Thermal technology, by its very nature, uses the physics of heat transfer and conservation of energy in a closed system to measure mass flow rate. This means that for a thermal mass flow meter to achieve the greatest accuracy, it must solve the First Law of Thermodynamics (Heat Energy In = Heat Energy Out) for each data point.

As you can imagine, solving the First Law in a flow instrument was no easy task. By Dr. Olin's own accounting, decades of "hard-nosed dedication to excellence" by himself and Sierra's engineering team, years of testing, and his stack of yellow note pads over five feet high, jammed with his handwritten equations and designs, finally yielded the secret in the form of two revolutionary technologies—QuadraTherm™ and qTherm™, now both patented worldwide.

The QuadraTherm Sensor: Traditional thermal sensors have two sensors—one temperature sensor and one velocity sensor, each in a separate probe. QuadraTherm (the term "Quad" meaning "four") introduces four sensors—three precision platinum temperature sensors and one patented DrySense mass velocity sensor. Performance improvements never before possible are gained as the QuadraTherm Technology isolates forced convection (the critical variable for measuring gas mass flow rate) by calculating and then eliminating unwanted heat-transfer components, like sensor stem conduction, one of the major causes of false flow readings.

qTherm, the Brains Behind it: qTherm is the true "Brain" of the instrument and a revolutionary, living, learning algorithm set made possible by today's hyper-fast microprocessors and QuadraTherm sensor inputs. qTherm manages changes in gas flow, temperature and pressure, as well as outside temperature, via a comprehensive heat-transfer model. The result of qTherm is a proprietary, fundamentally different gas mass flow rate calculation using all pertinent variables for the most precise, stable and accurate mass flow measurement possible.

Website & Downloads

QuadraTherm microsite: www.sierrainstruments.com/quadratherm

Download this manual: www.sierrainstruments.com/quadrathermIM

Features and Benefits

- Accuracy (air) +/- 0.5% of reading from 50% to 100% of full scale
+/-0.5% of reading plus 0.5% of full scale from 0% to 50% of full scale
- Patented vastly improved thermal sensor element for high accuracy
- Patented DrySense™ Technology for long term drift stability; lifetime warranty
- Instrument-optimized proprietary qTherm Gas Library for application independence
- Sensor design improvements to eliminate downdraft effects from probe
- Dial-A-Gas®: change gas and engineering units in the field, on the fly with the push of a button
- Dial-A-Pipe™: Use insertion version on different pipe sizes, set up on the fly with the push of a button
- Multivariable: simultaneous measurement of mass flow rate, process temperature, and pressure

Agency Approvals

QuadraTherm® has a full-global suite of agency approvals for safe operation in potentially hazardous environments:

- cFMus (USA and Canada)
- ATEX (European Union)
- IECEEx (International)
- CE Certified
- CRN Approval
- Manufactured under ISO-9001:2008

The 640i/780i is certified as flame-proof, protected from dust ignition sources, and meets all the design criteria for electrically-powered flow meters used in areas where combustible gases may be present. In short, now we are approved for safety in hazardous and potentially explosive plant environments and applications like facilities management, chemical processing, oil & gas, wastewater, and natural gas.

Using This Manual

This manual provides information needed to install and operate QuadraTherm 640i and 780i thermal mass flow meters. The four chapters and two appendices of this manual cover the following areas:

- Chapter 1: Introduction & Product Description
- Chapter 2 Installation & Wiring
- Chapter 3: Operation & Programming
- Chapter 4: Troubleshooting & Repair
- Appendix A: Product Specifications
- Appendix B: Smart Interface Program (SIP) software

Note and Safety Information

We use caution and warning statements throughout this book to draw your attention to important information.



Warning!

This statement appears with information that is important to protect people and equipment from damage. Pay very close attention to all warnings that apply to your application.



Caution!

This statement appears with information that is important for protecting your equipment and performance. Read and follow all cautions that apply to your application.

Receipt of System Components

When receiving a Sierra mass flow meter, carefully check the outside packing carton for damage incurred in shipment. If the carton is damaged, notify the local carrier and submit a report to the factory or distributor. Remove the packing slip and check that all ordered components are present. Make sure any spare parts or accessories are not discarded with the packing material. Do not return any equipment to the factory without first contacting Sierra Customer Service.

Technical Assistance

If you encounter a problem with your flow meter, review the configuration information for each step of the installation, operation, and setup procedures. Verify that your settings and adjustments are consistent with factory recommendations. Refer to Chapter 4: Troubleshooting, for specific information and recommendations.

If the problem persists after following the troubleshooting procedures outlined in Chapter 4, contact Sierra Instruments by fax or by E-mail (see inside front cover). For urgent phone support you may call (800) 866-0200 or (831) 373-0200 between 8:00 a.m. and 5:00 p.m. PST. In Europe, contact Sierra Instruments Europe at +31 72 5071400. In the Asia-Pacific region, contact Sierra Instruments Asia at + 8221 5879 8521. When contacting Technical Support, make sure to include this information:

- The flow range, serial number, and Sierra order number (all marked on the meter nameplate)
- The software version (visible at start up)
- The problem you are encountering and any corrective action taken
- Application information (gas, pressure, temperature and piping configuration)

Principle of Operation

Watch a principal of operation video at www.sierrainstruments.com/thermalprincipal

Sierra's unique QuadraTherm™ sensor probe is responsible for the unsurpassed accuracy, ruggedness, and reliability of Sierra industrial flow meters. The immersible sensor consists of four sensing elements—a velocity sensor, a temperature sensor, and two stem conduction sensors that measure heat lost to the outside.

When power is applied to the flow meter, the transducer electronics heats the velocity sensor to a constant temperature differential above the gas temperature and measures the cooling effect of the gas flow. The electrical power required to maintain a constant temperature differential is directly proportional to the gas mass flow rate. The two stem conduction sensors ensure that any heat lost is due to this cooling effect, and not due to conduction to the outside.

The velocity sensor is a reference-grade platinum resistance temperature detector (RTD). The platinum RTD wire is wound on a rugged ceramic mandrel for strength and stability. The temperature sensor is clad in 316 stainless steel. The velocity sensor is clad in a Pt/Ir Alloy.

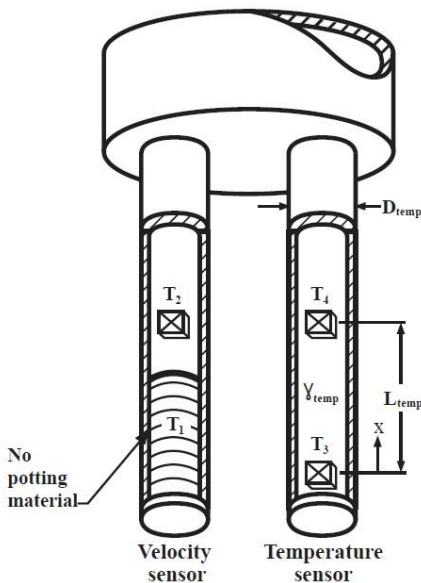


Figure 1-1:640i & 780i Series Sensor Assembly

qTherm™ Electronics Features

qTherm™ Dial-A-Gas™ Technology

Select gas to be measured

qTherm™ Dial-A-Pipe™ Technology

Set-up pipe dimensions

Units

Select units for mass flow, temperature, and pressure

User Full Scale Flow Rate

Field-configure from 50% to 100% of the factory full scale setting

Alarms

Program high & low or window alarm limits independently for mass flow, temperature, pressure and totalizer (select one)

MeterTune™ (Span Adjust)

Change the calibration correction factor to compensate for flow profile disturbances or specific application conditions. The MeterTune™ (span adjust) is a multiplication factor applied to the flow signal

Dual Output Signals

Two 4-20mA separate linear output signals proportional to flow and temperature. Optional 4-20mA proportional to pressure if pressure option selected.

Totalizer

Set up totalizer pulse output

Set Standard Conditions

Chose between, normal, standard and other

Set Password

Set user password

Set Low Flow Cut-off

Force flow to zero at a specified flow rate

View Tag Number

View assigned tag number

Set Language

Set language for display

View Communications Protocol Parameters

View communications settings: 38,400 Baud rate, no parity, 8 data bits, and 1 stop Bit

ValidCal™ Diagnostics

Review minimum, maximum flow, temperature and pressure and other diagnostics

Enclosure Options

Flow meter electronics are available mounted directly to the flow body, or remotely mounted up to 200 feet (60 meters) away. The electronics' housing may be used indoors or outdoors.

Display options include a programmable LCD displaying mass flow, temperature, pressure, totalized flow, Dial-A-Gas, Dial-A-Pipe, MeterTune, and user full scale along with alarm, reference conditions, serial numbers and tag number. Local operation and re-configuration is accomplished using the push buttons on the device. Electronics include non-volatile memory that stores all configuration information. The memory allows the flow meter to function immediately upon power up, or after an interruption in power.

Chapter 2: Installation & Wiring

Installation Overview

The 640i and 780i are easy to set up in the field. The flow meter should be inserted to the centerline of the pipe.

When selecting an installation site, make sure that:




Warning!

Agency approval for hazardous location installations varies between flow meter models. Consult the flow meter nameplate for specific flow meter approvals before any hazardous location installation.

1. Line pressure and temperature will not exceed the flow meter rating. If ambient temperature exceeds 50°C, remove flow meter to a cooler area.
2. The location meets the required minimum number of pipe diameters upstream and downstream of the sensor head (see Figure 2-1 on the next page)
3. Safe and convenient access with adequate clearance. Also, verify the meter is located where the gas is clean and dry.
4. Verify that the cable entry into the instrument meets the FM standard (if required).
5. For remote installations, verify the supplied cable length is sufficient to connect the flow meter sensor to the remote electronics. (Do not extend or shorten the supplied cable between the probe and the electronics.)
6. Also, before installation check your flow system for anomalies such as:
 - Leaks
 - Valves or restrictions in the flow path that could create disturbances in the flow profile that might cause unexpected flow rate indications
 - Heaters that might cause rapid excursions in the measured temperature

Unobstructed Flow Requirements

Select an installation site that will minimize possible distortion in the flow profile. Valves, elbows, control valves and other piping components may cause flow disturbances. Check your specific piping condition against the examples shown below. In order to achieve accurate and repeatable performance, install the flow meter using the recommended number of straight run pipe diameters upstream and downstream of the sensor.

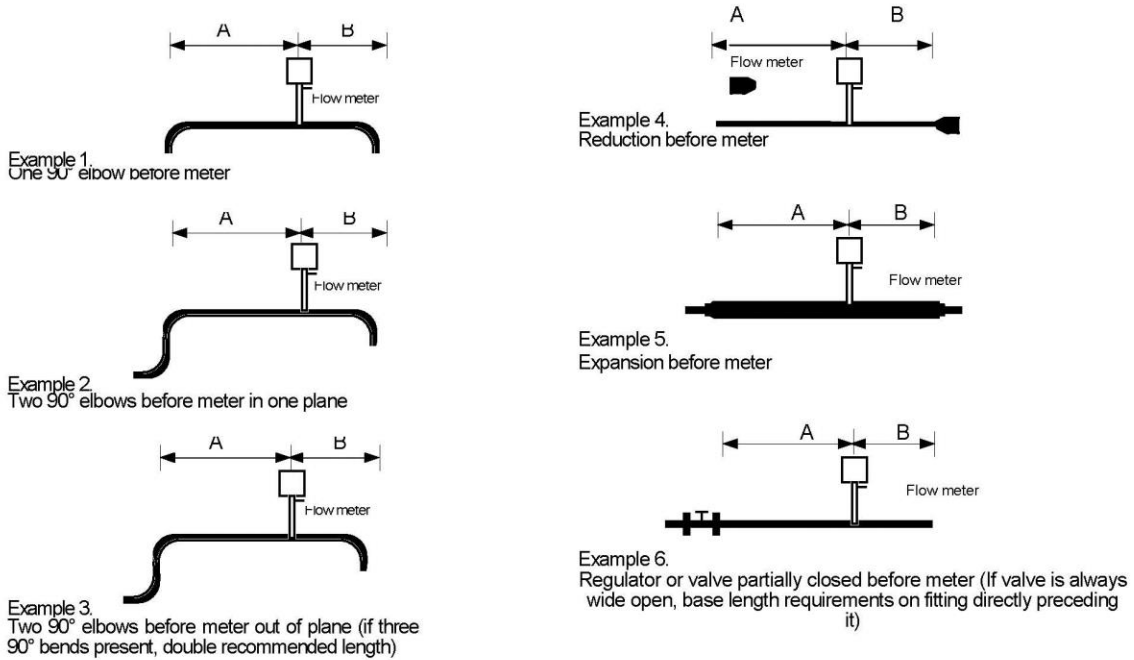

640i and 780i Straight Run Requirements			
Piping Condition Example	A-Upstream 640i Insertion ⁽¹⁾	A-Upstream 780i Inline with Flow Conditioning ⁽¹⁾	B-Downstream ⁽²⁾
1	15D	1D	5D
2	20D	3D	5D
3	40D	3D	10D
4	15D	3D	5D
5	30D	3D	10D
6	40D	5D	5D
(1) Number of diameters (D) of straight pipe required between upstream disturbance and the flow meter			
(2) Number of diameters (D) of straight pipe required downstream of the flow meter			

Figure 2-1: Recommended Pipe Length Requirements for Installation

Installing the Flow Meter


When positioning the flow meter, refer to the flow direction indicator attached to the probe. For proper operation, install the meter with the flow direction indicator pointing downstream in the direction of flow. Installing the meter opposite this direction will result in inaccurate flow measurement.

Cold Tap Installation




Caution!

When using toxic or corrosive gases, purge the line with inert gas for a minimum of four hours at full gas flow before installing the flow meter.

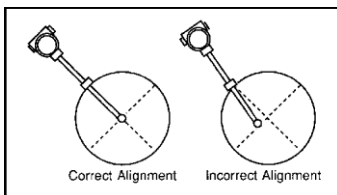

NOTE: Probe may enter the pipe from any direction as long as the tips are in the center.

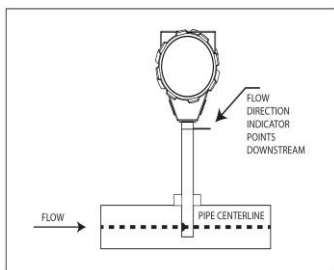

1. Confirm that the installation site meets the minimum upstream and downstream pipe diameter requirements shown in Figure 2-1.
2. **Turn off the flow of process gas. Verify that the line is not pressurized.**
3. Use a cutting torch or sharp cutting tool to tap into the pipe. The pipe opening must be at least 0.78 inches in diameter. (Do not attempt to insert the sensor probe through a smaller hole.)
4. Remove all burrs from the tap. Rough edges may cause flow profile distortions that could affect flow meter accuracy. Also, obstructions could damage the sensor assembly when inserting into the pipe.
5. Mount the compression or flange fitting on the pipe. Make sure this connection is within $\pm 5^\circ$ perpendicular to the pipe centerline as shown at left.
6. When installed, cap the fitting. Run a static pressure check on the connection. If pressure loss or leaks are detected, repair the connection and re-test.
7. Insert the sensor probe through the compression or flange fitting into the pipe. The correct insertion depth places the centerline of the sensor access hole in the probe at the pipe's centerline.
8. Align the sensor head using the flow direction indicator. Adjust the indicator parallel to the pipe pointing downstream in the direction of flow.
9. Tighten the fitting to lock the flow meter in position. (When a compression fitting is tightened, the position is permanent unless using Teflon ferrules.)

**Warning!**

Hot tapping must be performed by a trained professional. U.S. regulations often require a hot tap permit. The manufacturer of the hot tap equipment and/or the contractor performing the hot tap is responsible for providing proof of such a

**Caution!**

All flow meter connections, isolation valves and fittings for hot tapping must have the same or higher pressure rating as the main pipeline.

Hot Tap Installation

When positioning the flow meter, refer to the flow direction indicator attached to the probe. For proper operation, install the meter with the flow direction indicator pointing downstream in the direction of flow. Installing the meter opposite this direction will result in inaccurate flow measurement. Low pressure hot taps cannot exceed 150 psia (10 bara) maximum. High pressure hot taps cannot exceed 1000 psia (70 bara) maximum. Make sure the pipe pressure does not exceed these limits before beginning this procedure.

1. Confirm that the installation site meets the minimum upstream and downstream pipe diameter requirements shown in Figure 2-1.
2. Calculate the flow meter insertion depth as shown in Figure 2-2 for a low pressure tap or Figure 2-3 for a high pressure tap.
3. Weld the process connection on the pipe. Make sure the process connection is within $\pm 5^\circ$ perpendicular to the pipe centerline (see previous page). The pipe opening must be at least 0.88 inches (22 mm) in diameter.
4. Bolt an isolation valve on the process connection. The valve's full open bore must be at least 0.88 inches (22 mm) in diameter.
5. Hot tap the pipe.
6. Close the isolation valve. Run a static pressure. If pressure loss or leaks are detected, repair the connection and re-test.
7. Insert the sensor probe through the isolation valve into the pipe with the flow direction indicator parallel to the pipe pointing downstream in the direction of flow. The correct insertion depth places the sensor at the pipe's centerline. Do not force into the pipe.
8. Tighten the fittings to lock the flow meter in position.

Calculating Insertion Depth for a Low Pressure Tap

Variables

L = Nominal probe length

D = Duct O.D.

C = Duct I.D.

T = Height of “Threadolet” or customer provided “Weldolet”

Formula

$$L \geq 12 + D/2 + T$$

L must be equal or greater than 12 inches plus the height of the “Threadolet” plus half the duct O.D. (*All dimensions in inches.*)

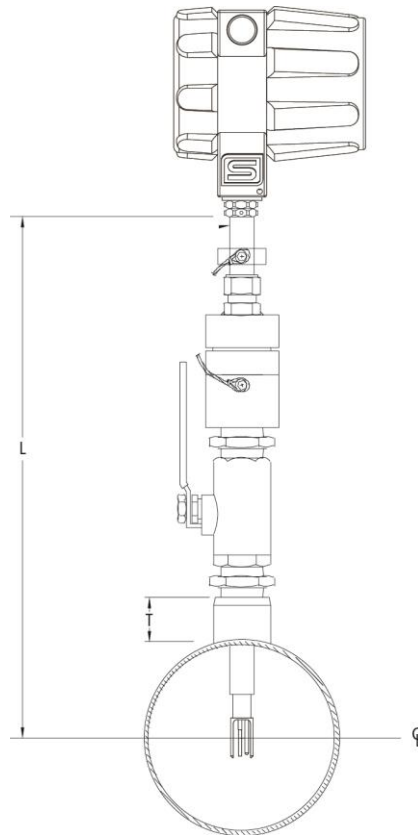


Figure 2-2: Low Pressure Tap Insertion Depth

Calculating Insertion Depth for a High Pressure Tap

Variables

S = Distance from face of mounting flange to outside of duct

D = Duct O.D.

P = Minimum probe length

T = Minimum probe travel

R = Allowable probe travel

IN = Inserted position (marker location)

RE = Retracted position (marker location)

Formulas

- 1) $P = D/2 + S + 6.75$ (minimum probe length—use next longer whole number length probe)
 - 2) $T = D/2 + 0.54$
 - 3) $R = 28.2 - [\text{actual probe length} - S - (D/2)]$ (must be greater than or equal to T)
 - 4) $IN = (\text{actual probe length} + 2) - (5.5 + S + D/2)$
 - 5) $RE = IN + T$
- (All dimensions in inches.)

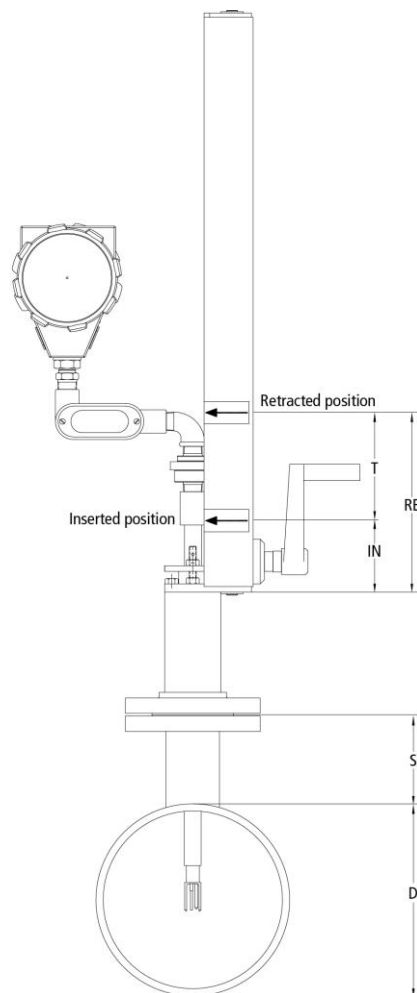


Figure 2-3. High Pressure Tap Insertion Depth

Wiring Connections



Warning!

To avoid potential electric shock, follow National Electric Code safety practices or your local code when wiring this unit to a power source and to peripheral devices. Failure to do so could result in injury or death. All AC power connections must be in accordance with published CE directives.

Use the terminal blocks located inside the cap of the flow meter enclosure for all wiring connections. Make sure to observe all CE compliance requirements for AC wiring connections given on the next page.

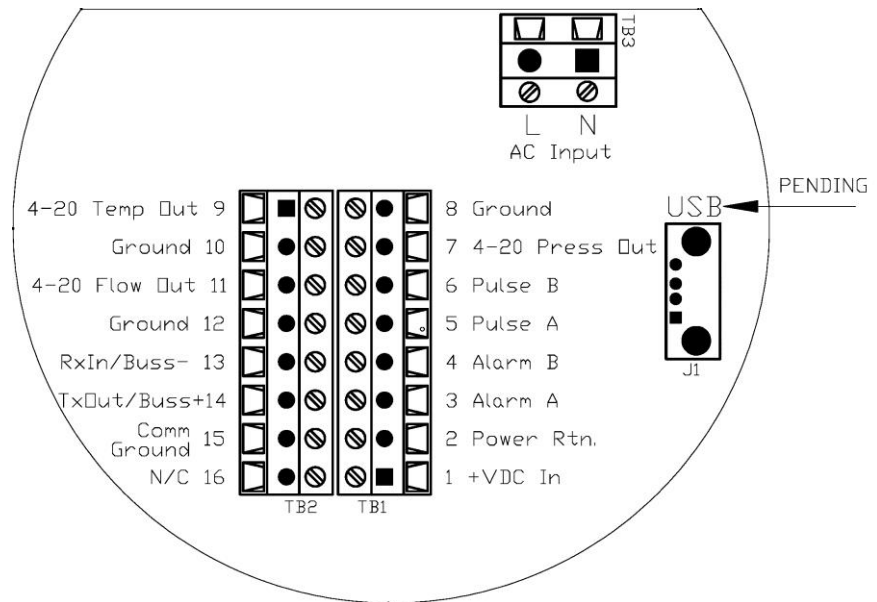


FIGURE 2-4
WIRING ACCESS

Figure 2-4. Wiring Access

Input Power Wiring



Warning!

All wiring procedures must be performed with the power Off.



Caution!

The AC wire insulation temperature rating must meet or exceed 80 °C (176°F).

AC Power Wiring

The AC power wire size must be 26 to 16 AWG with the wire stripped 1/4 inch (6 mm). Connect 100 to 240 VAC (0.4 Amps RMS at 230 VAC) to the Neutral and Line terminals on the terminal block. Connect the ground wire to the safety ground lug. Torque all connections to 4.43 to 5.31 in-lbs (0.5 to 0.6 Nm).

The Hazardous-Area enclosure has two separate conduit entries to maintain separation between AC input power and output signal wiring. To eliminate the possibility of noise interference, use a separate cable entry for the AC power and signal lines.

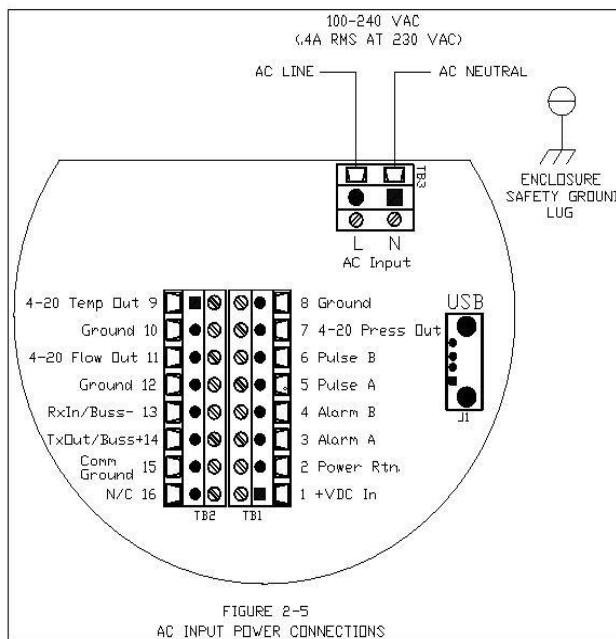


Figure 2-5: AC Input Power Connections



DC Power Wiring

The DC power wire size must be 26 to 16 AWG with the wire stripped 1/4 inch (6 mm). Connect 24 VDC $\pm 10\%$ (1.04A load, maximum) to the terminals marked on the terminal block. Connect the Earth ground wire to the safety ground log. Torque all connections to 4.43 to 5.31 in-lbs (0.5 to 0.6 Nm).

If conduit seals are used, they must be installed within 18 inches of the enclosure.

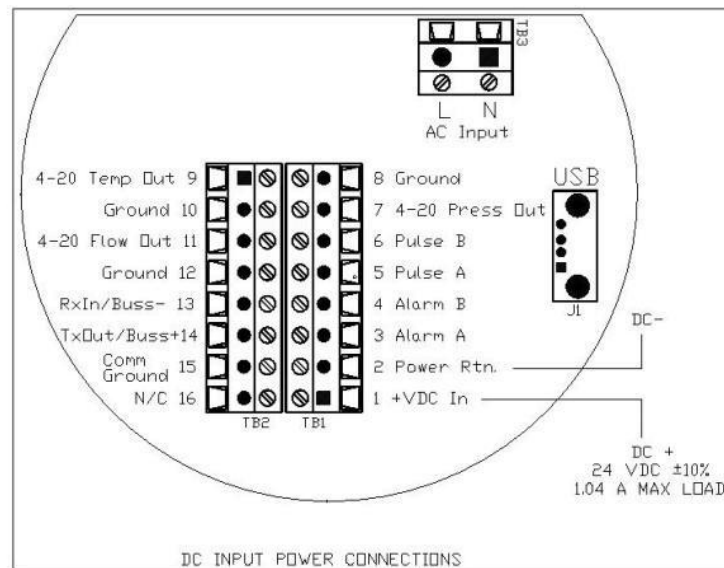


Figure 2-6: DC Input Power Connections



Warning!

Do not externally power the 4-20mA output loop. It is a self-powered loop.

Output Signal Wiring

Output signal cable should be completely screened with a 100% shield. You must use metal cable glands that provide cable screen clamping. The cable screen should be connected to the gland and shielded at both ends over 360 degrees. The shield should be terminated to an earth ground. For all installations not using metal conduit two ferrite beads should be added, one on each end of the I/O cable. This is to maintain CE related EMI/RFI protection. Good quality (Highest impedance at 100MHz) Broadband ferrites should be used, a solid cylindrical ferrite (recommended) usually has better performance than a clamp on ferrite. The ferrites should fit as tight as possible to the OD of your cable.

All QuadraTherm 640i/780i Series flow meters are equipped with calibrated 4-20 mA output signals for both T and P, with an optional 4-20 MA output for pressure.

4-20 mA Output Wiring

The 4-20 mA current loop output is non-isolated. Max load 500 ohms

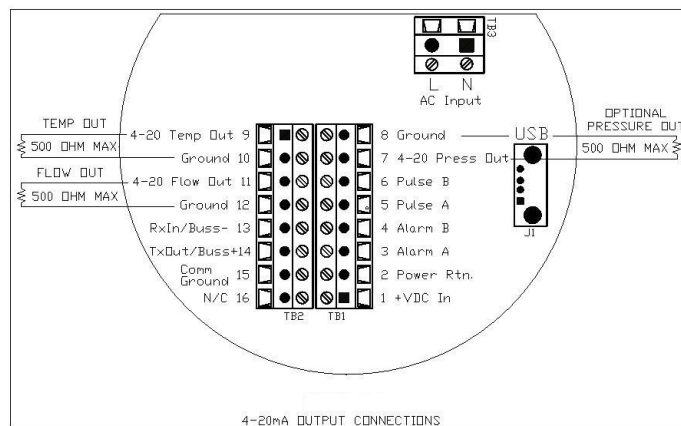


Figure 2-7: 4-20mA Output Connections

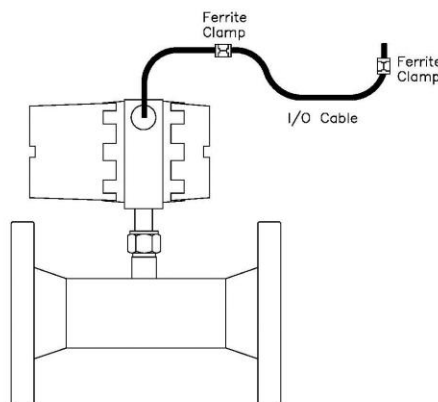


Figure: 2-8 Ferrite Installation (Ferrite not required for conduit)

Alarm Output Wiring

One alarm output contact is included on the flow meter terminal block. The alarm output is driven by an optical relay that is normally-open single-pole.

The relay is isolated and requires a separate power supply (isolated) the voltage of the alarm output is the same as the voltage supplied to the circuit.

To use an external power supply for an isolated alarm output, connect as shown in Figure 2-8. You may set low, high or window alarms for temperature, pressure, totalizer or mass flow.

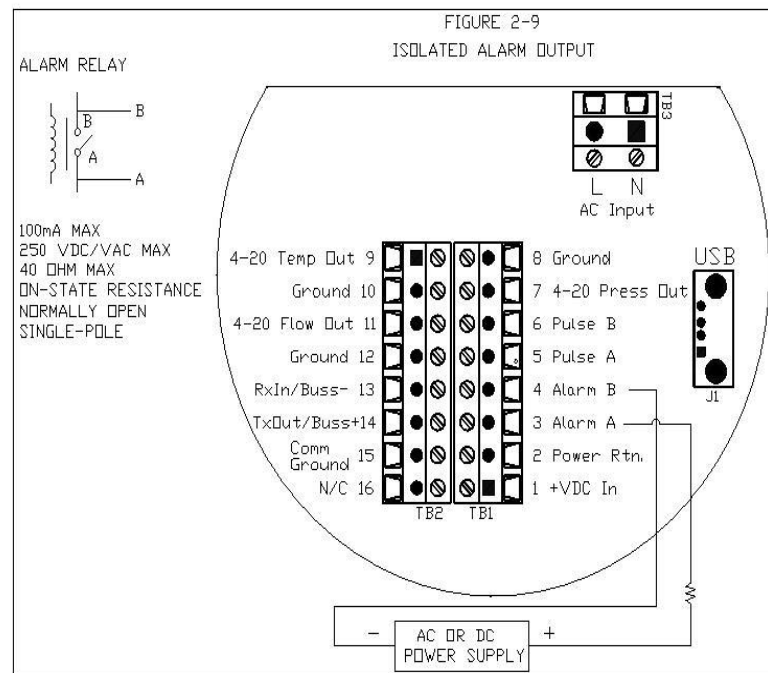


Figure 2-9: AC or DC Power Supply

RS-232 Wiring

RS-232 provides serial communication. Wire per figure 2-10.

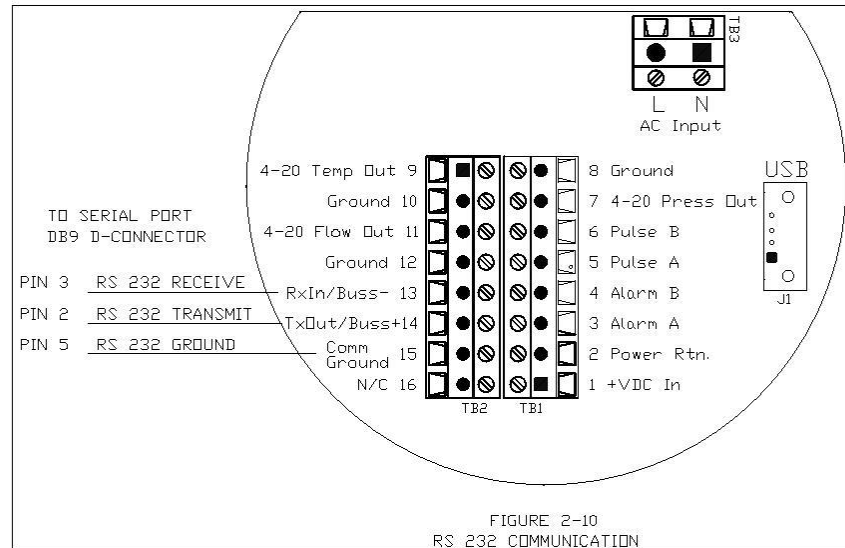


Figure 2-10: RS-232 Communication

Pulse Output

QuadraTherm provides an adjustable pulse output with a maximum of 1 Hz. Wire per figure 2-11 below.

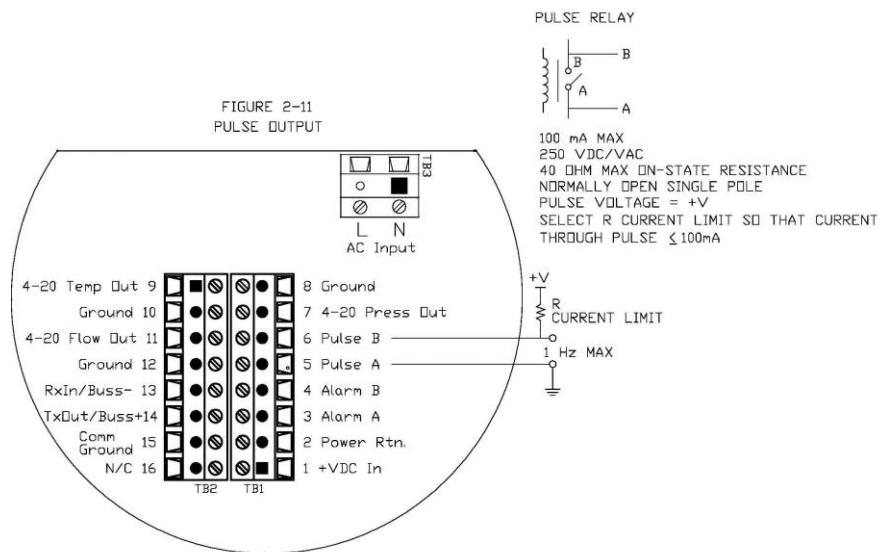


Figure 2-11: Pulse Output

USB Output

If supplied, plug your USB adapter into J1, per figure 2-12 (USB pending).

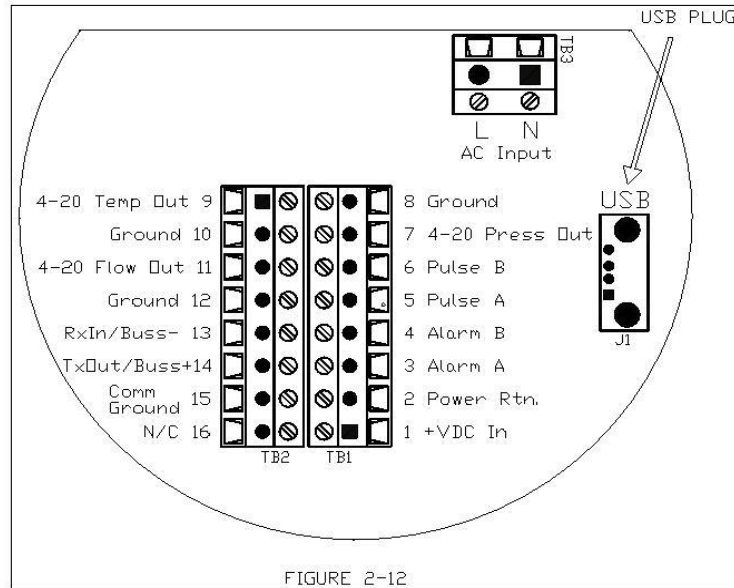


FIGURE 2-12

Figure 2-12: USB Output (pending)

Remote Sensor Wiring

When connecting the sensor probe to a remotely mounted flow meter enclosure, use only factory supplied cables. When connecting more than one meter, do not intermix the sensor probes and electronics. The electronics, sensor probes and interconnecting cables supplied by Sierra Instruments are calibrated as a complete precision mass flow circuit.

To make wiring connections from a sensor probe junction box to a remotely mounted enclosure, see Figure 2-13.

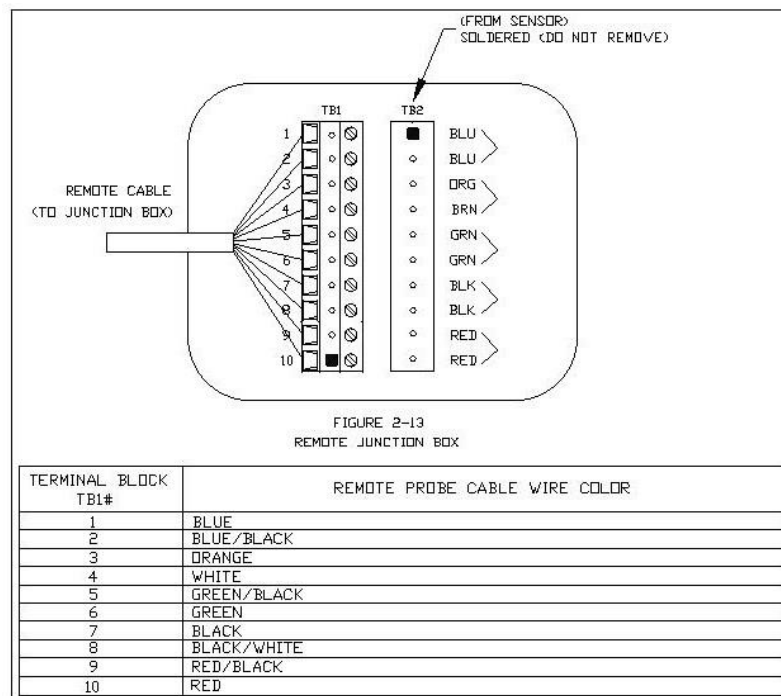


Figure 2-13: Remote Junction Box

Chapter 3: Operation & Programming

General Navigation

In general terms, the menu system consists of a main menu, the set-up menu, a sub-menu to program each item in the set-up menu, and a series of data entry or pull-down screens with to enter set-up data for each parameter.

Menus may be adjusted using the six buttons on the front of the unit: up ▲, down ▼, left ◀, right ▶, enter ↵ and escape/cancel ⊗, or by using the Smart Interface Program (SIP) software provided free with the instrument.

Pressing the left ◀ button will move the menu selection to the left, or the data entry field to the left if updating a menu value.

Pressing the right ▶ button will move the menu selection to the right, or the data entry field to the right if updating a menu value.

Pressing the up ▲ button will move the menu selection up, or increment the data entry field if you're updating a menu value.

For example, if you're updating a value, and that value is currently set to "0", pressing the up ▲ key will increase the value to the next logical value, in our example it would be "1", then "2", "3" and so on to "9" then back to "0"

Pressing the down ▼ button will move the menu selection down, or decrement the data entry field if you're updating a menu value.

For example, if you're updating a value, and that value is currently set to "9", pressing the down ▼ key will decrease the value to the next logical value, in our example it would be "8", then "7", "6" and so on to "0" then back to "9"

Pressing the enter ↵ key accepts the current value.

Pressing the escape/cancel ⊗ key returns to the last previous menu, and if you're currently editing a value, will cancel any changes you've made.

Note: The screen data "flashes" to show that you are actively editing. Pressing the enter key permanently writes the data to the meters memory.

Start-up Routine

Then the meter is first powered up, it will cycle through set-up data. See an example below of the type of screens you will see.

1. Product Name and Firmware Version. Left is main PCA / right is display PCA

640i/780i
V1.0.X

2. Serial Number

Serial
1234XXXX

3. Full Scale

Full Scale
100.00 SCFM

4. Gas

Dial-A-Gas
Carbon Dioxide

5. Tag Number

Tag
1234XXXX

NOTE: All of these values are also displayed on the provided SIP (Smart Interface Program) software.

Level 1: Main Menu

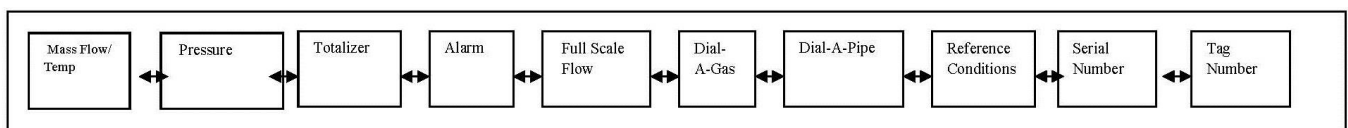


Table 3-1: Main Menu Level 1

Once set-up data is displayed, the meter will display the flow variables. The instrument will Auto Scroll through each flow variable. You can turn OFF the Auto Scroll feature by hitting the ▼ down arrow.

Auto Scroll
Off

Turn Auto Scroll back ON again by hitting the ▲ up arrow. Auto Scroll will default back to on if power is cycled.

Auto Scroll
On

The following flow variable screens will Auto Scroll. The data shown below is for example only:

1. Flow and Temperature

0.11 SCFM
97.66 F

2. Pressure (N/A if option was not ordered)

Pressure
0.00/psia

3. Totalizer (only displayed if turned ON)

Total Units SCF
0.00

You can now cycle through more main menu screens. By entering >, you will see the additional screens. You can also go back using < at any time or exit to the main screen by pressing (X).

4. Alarm

Active Alarm
Flow – L (On)

5. Full Scale Flow

Full Scale Flow
100.00 SCFM

6. qTherm Dial-A-Gas (Gas Type)

Dial-A-Gas
Carbon Dioxide

7. qTherm Dial-A-Pipe

Dial-A-Pipe
ID

8. Reference Conditions

Ref: Standard
14.695949 / 70.0

9. Serial

Serial
1234XXXX

10. Tag

Tag
1234XXXX

And finally complete the cycle back to the flow and temperature screen.

Level 2: Sub-Menu (Password Protected)

At this point, you can access various other menus .To enter the next level press the enter key. You will be requested to enter a password. Default is 0000 and can be reset in a later screen or using SIP:

Password
0000

Use the up ▲ and down ▼ buttons to cycle through numbers and left ◀ and right ▶ buttons to move to the next digit. Once the correct password has been entered, hit enter ↵ and you will enter the Level 2 Sub-Menu shown in Table 3-2.


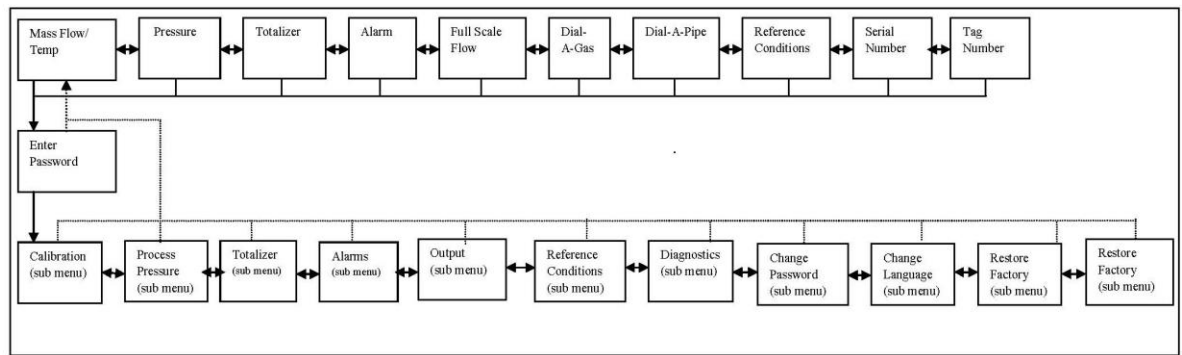


Table 3-2: Level 2 Sub-Menu

Calibration (Sub-Menu)

Navigate to the Calibration Sub Menu, use Table 3-3 below for guidance if necessary.

 The calibration menu allows you to set up the meter to match the application.



To start, move down to the next level by pressing the enter key (↵). From this level, you can set up Dial-A-Gas and Dial-A-Pipe, as well as flow and temperature units (pressure is optional and has its own set-up menu to be covered later).

In addition you can adjust the MeterTune (span adjust), full scale flow, low flow cut-off and view the date the meter was last calibrated. Note that you can also use the Quick Keys or the function selector of the Smart Interface Program (SIP) provided free with the meter.


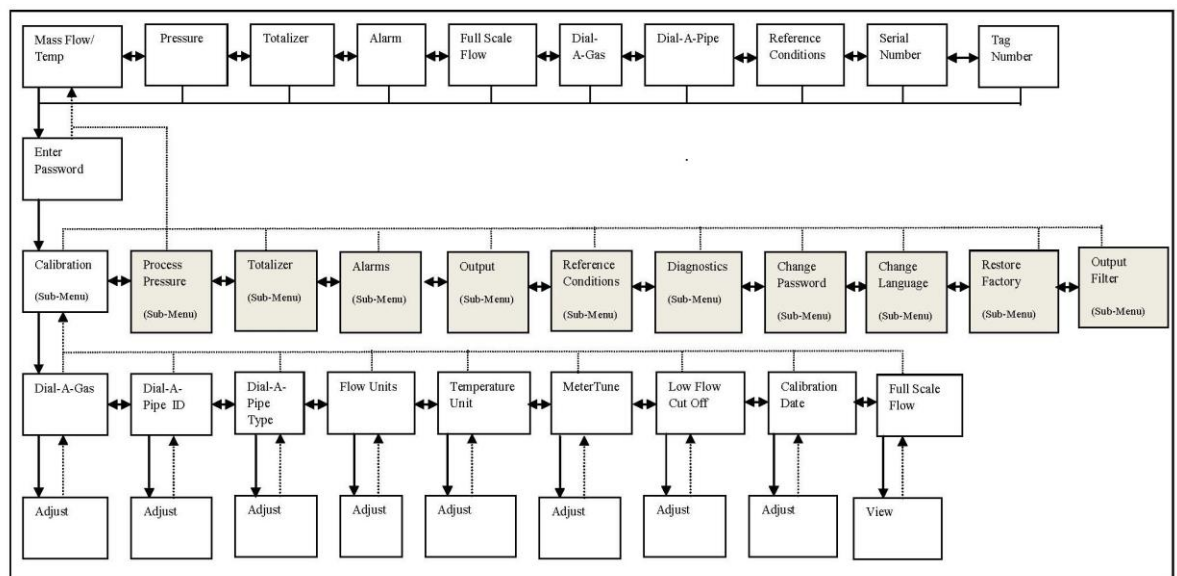


Table 3-3: Calibration Sub-Menu


Calibration (Sub-Menu): Gas Type –“qTherm Dial-A Gas”

Use this menu to change and select the gas to be measured. This is called our Dial-A-Gas feature and is a powerful and unique feature of the 640i/780i.

 The display will show gas type and list the currently selected gas.




Navigate to the “Dial-A-Gas” screen. Use Table 3-3: Calibration Sub-Menu for guidance if necessary.

 

Once on the “Dial-A-Gas” screen, press enter key  once again until the current selected gas begins to flash. It may take a few seconds to begin to flash.

Use the up and down keys to scroll through the available qTherm Dial-A-Gas menu. The meter can be pre-configured with four gases from Sierra’s qTherm Gas Library. There are eighteen gases and gas mixes available from the Sierra qTherm Gas Library. Sierra will continually update the library as more gases and mixtures become available. New or updated gases can be downloaded from the library using the SIP program.

Default gases:

Air
Carbon Dioxide
Methane
Nitrogen

Once you have selected the desired gas, press enter key  to make the change permanent. The selection will stop flashing.

You can press the exit  several times to climb back up to the main menu level or press  to proceed to the next Calibration Sub-Menu called Dial-A-Pipe ID. We discuss this next.

Calibration (Sub-Menu): Dial-A-Pipe ID, Dial-A-Pipe ID, Dial-A-Type

This instrument can be moved to different pipe sizes and types as needed and perform precision flow measurement. This capability is called Dial-A-Pipe and is a powerful and unique feature of the QuadraTherm 640i immersible thermal mass flow meter.

The internal pipe diameter (ID) and pipe type are very important factors when considering flow profile. The 640i uses internal diameter (ID) and the pipe type to mathematically model the flow profile and enable Dial-A-Pipe.

Adjustment can also be done using the SIP (Smart Interface Program) Software. It is recommended to use the SIP to perform Dial-A-Pipe since the process is more automated.

The Dial-A-Pipe process requires 2 steps:


1) Setting Pipe Inner Diameter (ID)

2) Setting Pipe Type

Step 1(Dial-A-Pipe): Navigate to the “Dial-A-Pipe ID” screen. Use Table 3-3: Calibration Sub-Menu for guidance if necessary.

The display will show pipe inner diameter in the units selected. In the example below the inside diameter of the pipe is 6.065000 inches.

Dial-A-Pipe ID
6.065000 / In

Press enter  to cause the first digit (the 6 in 6.065000 in our example) to begin flashing. Use the up and down arrows to select the value 0 to 9. Once done, use the right key to move on to the selected significant digit. Once the I.D. value is selected, use the up and down keys to select the desired units.

IMPORTANT: It is vital to use the correct I.D. and units of the pipe where the instrument is located. If the schedule of the pipe is known, the I.D. can be looked up from pipe tables. If the pipe outer diameter and wall thickness is known, the I.D. can be calculated. If you do not have a round pipe, you must enter the equivalent round I.D. There are various methods of calculating this. Here’s an easy calculation to give you the hydraulic diameter (H_D):

Hydraulic Diameter = H_D

$$H_D = \frac{4A}{P}$$

A= Cross sectional area of duct
P = Wetted perimeter of duct

I.D. Units:

in: inches

m: meters



mm: millimeters

ft: feet

Step 2 (Dial-A-Pipe Type): Pipe roughness does matter. The friction losses of the gas moving through the pipe are a major factor in the instruments calculation of the flow profile. Navigate to the “Pipe Type” screen. Use Table 3-3: Calibration Sub-Menu for guidance if necessary.

Use this menu screen to complete entering Dial-A-Pipe data. The display will show pipe roughness and the “type” of pipe. See example below.

Dial-A-Pipe
ss-smooth

Press enter  and the type of pipe will begin flashing. Go to the next level down with the  button and select the proper pipe type.

Choices Available:

ss-smooth

ss-normal

ss-rough

cs-smooth

cs-normal
cs-rough
c-fiber
cast-iron
concrete
PVC
Glass
ss-UHP

where:

ss = stainless steel

cs = carbon steel

c-fiber = carbon fiber


UHP = ultra-high purity (5 – 10 Ra finish)

Again, use the ▲ up and ▼ down keys to select. Choice will flash until the enter key ↵ is pressed. Once the selection is made, the instrument Dial-A-Pipe feature is complete.

You can press the exit ⊗ several times to climb back up to the main menu level or press ► to proceed to the next Calibration Sub-Menu called Flow Units.

Calibration (Sub-Menu): Flow Units

Navigate to the “Flow Units” screen. Use Table 3-3: Calibration Sub-Menu for guidance if necessary. Use this menu to enter the units for mass velocity or flow. The display will show the previously selected flow units. For example:

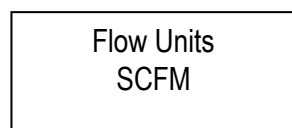

Press enter ↵ and the units will begin flashing. Go to the next level with the ▼ button and select the proper pipe type. Again, use the ▲ up and ▼ down keys to select. The current choice will flash until the enter key ↵ is pressed.

Available Choices:


- **SCFS, SCFM, SCFH, SCFD, SCFY:** Standard Cubic Feet per Second, Minute, Day, Hour or Year. Standard conditions are set in the Reference Conditions menu.
- **NCFS, NCFM, NCFH, NCFD, NCFY:** Normal Cubic Feet per Second, Minute, Day, Hour or Year. Normal conditions are set in the Reference Conditions menu.
- **SM3/sec; min; hr; day; yr:** Standard cubic meters per unit time. Standard conditions are set in the Reference Conditions menu.
- **NM3/ sec; min; hr; day; yr:** Normal cubic meters per unit time. Normal conditions are set in the Reference Conditions menu.
- **SLPS,SLPM, SLPH, SLPD, SLPY:** standard Liters per unit time. Standard conditions are set in the Reference Conditions menu.
- **NLPS,NLPM, NLPH, NLPD, NLPY:** normal Liters per unit time. Normal conditions are set in the Reference Conditions menu.
- **Lbs/sec; min; hr; day; year:** Pounds per unit time.
- **Kg/sec; min; hour; day; year:** Kilograms per unit time.
- **SFPS, SFPM, SFPH, SFPD, SFPY:** Standard Feet per Second, Minute, Day, Hour or Year. Note this is a point VELOCITY.

- **SMPS, SMPM, SMPH, SMPD, SMPY:** Standard Meters per Second, Minute, Day, Hour or Year. Note this is a point VELOCITY.

You can press the exit ⊗ several times to climb back up to the main menu level or press ► to proceed to the next Calibration Sub-Menu called Temperature Units.

Calibration (Sub-Menu): Temperature Unit

Use this menu to enter the units for temperature. Use Table 3-3: Calibration Sub-Menu for guidance if necessary. The display will show the currently selected temperature unit.

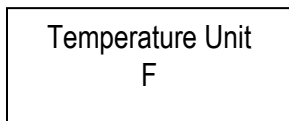

Press enter ↵ and the units will begin flashing. Use the up ▲ and down ▼ keys to select. The units will flash until the enter key is pressed again.

Choices Available:


- F (Fahrenheit)
- C (Celsius)
- K (Kelvin)
- R (Rankine)

Once the temperature units have been selected press enter (↵) to save. You can press the exit ⊗ several times to climb back up to the main menu level or press ► to proceed to the next Calibration Sub-Menu called Span Value.

Calibration (Sub-Menu): MenuTune

The MenuTune multiplies the meter output by a fixed value, from 0.5000000 to 2.0000000. Displayed MeterTune is for the currently selected gas. This is useful if the meter displays a known offset from another device or expectation (calculated flow rate for example), and you want to make the meters “match”.

For instance, assume your process needs a less accurate rotameter that reads 100 SCFM, and the more accurate 640i or 780i that reads 95 SCFM to align. Enter a span factor of $100/95 = 1.052632$. The meter will then multiply by this factor so that the meter output equals the rotameter output of 100 SCFM. Default is of course 1.000000.

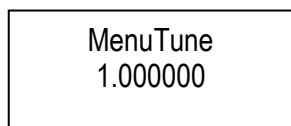

Press enter (↵) and the units will begin flashing. As in previous examples, use the ▲▼◀▶ buttons to enter the desired value, and the enter key (↵) to save the value.

You can press the exit ⊗ several times to climb back up to the main menu level or press ► to proceed to the next Calibration Sub-Menu called Low Flow Cut Off.

Calibration (Sub-Menu): Low Flow Cut Off

The Low Flow Cut Off value forces both the digital display and the analog output values to zero/4 mA at a percentage of full scale from 0 to 10% of the full scale value. This is useful because pipes can show flow when all valves are shut.

The QuadraTherm 640i and 780i are extremely sensitive flow instruments that can pick up natural convection flows, where thermal gradients cause gas movement inside the piping system. Phenomenon's like natural convection will lead to totalization errors.

Displayed value is for the currently selected gas.

Low Flow Cut-Off 0.000000

Enter the desired low flow cut off as a percentage of the full scale flow. The full scale flow is calibrated at the factory and is found in the main menu. You can press the exit ⊗ several times to climb back up to the main menu. For example, if the full scale flow as found in the main menu is:

Full Scale Flow 100.00 SCFM

And the meter consistently shows a flow of 2 to 3 SCFM even with all valves closed (and you are sure there are no leaks), an example is to set the low flow cut off just above to:

Low Flow Cut-Off 5.000000

This is +/- 5% of the full scale of 100 SCFM. The analog output and the digital display be 0.000000 for any flow below 5.000000 SCFM. The default value for low flow cut off is 0.000000.

Once the low flow cut off has been entered, use the enter key (↵) to save the value. You can press the exit ⊗ several times to climb back up to the main menu level or press ► to proceed to the next Calibration Sub-Menu called Calibration Date.

Calibration (Sub-Menu): Calibration Date

The Calibration Date is a read-only field that shows when the meter was last factory-calibrated in MM/DD/YYYY format.

Calibration Date 08/13/2012

Sierra recommends recalibration as required by your metrology policy or when the meter validation routine found in the Smart Interface Program software detects a problem. See Meter Validation in XXXXXX).

You can press the exit ⊗ several times to climb back up to the main menu level or press ► to proceed to the next Calibration Sub-Menu called Full Scale.

Calibration (Sub-Menu): Full Scale Flow

The full scale value is the flow value that corresponds to 20mA on the Flow 4-20mA analog output. This value can be adjusted between 50-100% of the original factory calibration full scale value found on the data tag. Note that accuracy is still based on the original factory calibration full scale value.

Full Scale Flow
100.00 SCFM

Press enter (↵) and the units will begin flashing. As in previous examples, use the ▲▼►◄ buttons to enter the desired value, and the enter key (↵) to save the value. This concludes our review of the Calibration Sub-Menu. Press the exit ⊗ climb back up to the main menu.

Process Pressure (Sub-Menu)

Navigate to the Process Pressure Sub Menu, use Table 3-4 below for guidance if necessary.

The QuadraTherm 640i and 780i is a *multivariable* thermal mass flow meter. It always measures mass velocity (from which the mass flow rate is derived) and temperature (VT) and has the optional ability to measure process pressure along with VT, this is called (VTP). The Process Pressure Sub-Menu allows you to input the desired pressure units.

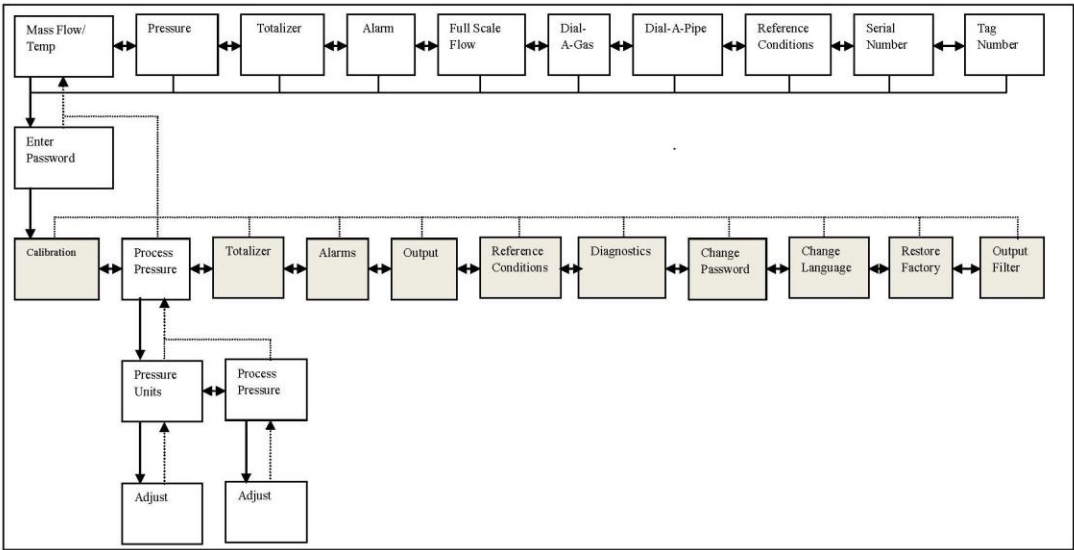


Table 3-4: Process Pressure Sub-Menu

Process Pressure (Sub-Menu): Pressure Units

Use this menu to enter the units for pressure.

Use the enter key (↵) to drill down to Pressure Units selection. Press enter (↵) and the units will begin flashing. Use the ▲▼ buttons to enter the desired information, and the enter key (↵) to save the value.

Pressure Units Psia

Available units are:

- Psia
- Psia
- Bar A
- Bar G
- KPa A
- KPa G
- Kg/CM2 A
- Kg/CM2 G
- In H2O A
- In H2O G
- MM H2O A
- MM H2O G

Once the pressure units have been selected press the enter key (↵) to save. You can press the exit ⊗ several times to climb back up to the main menu level or press ► to proceed to the next Sub-Menu called Process Pressure Temperature Units.

Process Pressure Sub-Menu: Process Pressure

Use this menu to enter the process pressure.

Process Pressure 14.700154

This process pressure is used by the instruments qTherm mathematical model to improve gas properties calculations. Gas properties have a very slight dependence on pressure, so if process pressure changes appreciably over time this value should be updated to reflect process conditions (about 0.01% per psi).

The units of the pressure in this menu are the same as what was set in the previous menu. In the example above, the units are 14.700154 Psia since this is what was set in the pressure units sub-menu.

This concludes our review of the Process Pressure Sub-Menu. Press the exit ⊗ climb back up to the main menu.

Totalizer (Sub-Menu)

The Totalizer Sub Menu controls all aspects of the totalizer function. Totalizers are used to monitor accumulated flow, often for billing and cost allocation purposes. The totalizer sub-menu is used to turn the totalizer ON or OFF, to reset, and to tell the meter when to send out a totalizer pulse and what that pulse should look like.

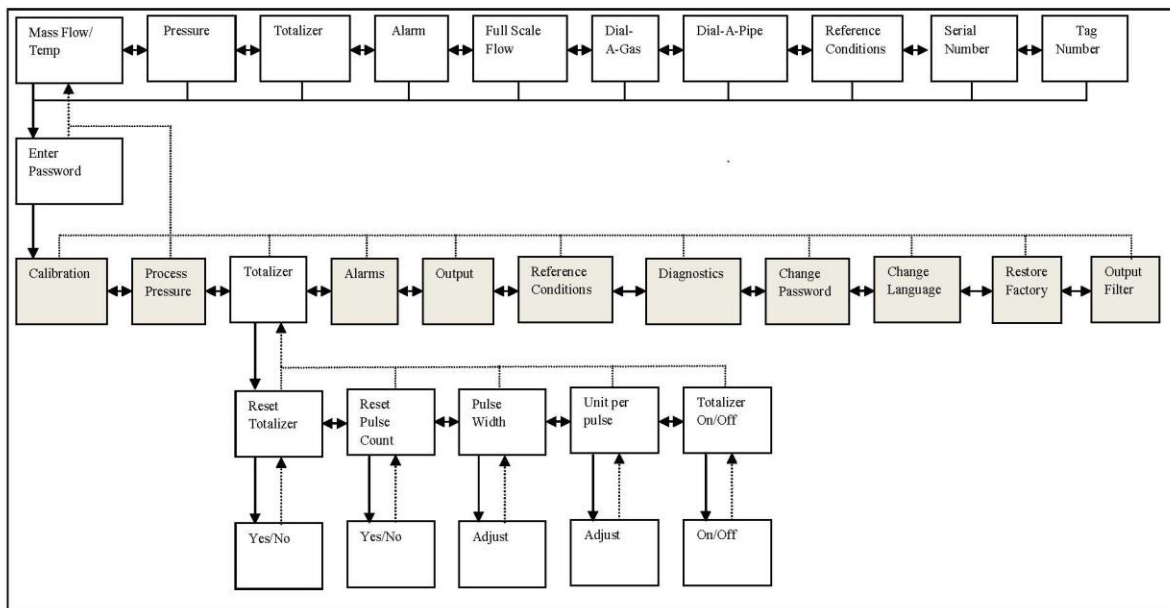


Table 3-5: Totalizer Sub-Menu

Totalizer (Sub-Menu): Reset Totalizer

Navigate to the Reset Totalizer screen, use Table 3-5 above for guidance if necessary.

Use this menu to reset the totalizer to zero. Press enter (↵) and you will see a flashing “YES”. Pressing enter (↵) again to reset the totalizer to zero and bring you back to the Totalizer (Sub-Menu).

Reset Totalizer
Yes

In addition, from the screen above you can press the down ▼ button to a flashing “NO”. Pressing enter ↵ will return back to the Totalizer (Sub-Menu).

Totalizer Sub-Menu: Reset Pulse Count

If you need to actually set up the totalizer (rather than just reset it to zero), navigate to the Reset Pulse Count screen, use Table 3-5 above for guidance if necessary.

Use this menu to reset the pulse counter. The pulse count is the count of pulses that went to the pulse relay since the last reset. This count will match your external counter if they were both reset at the same time and can be used to verify an external counter. Pulse count X units per pulse = totalizer count within +/- 1 units per pulse value.

The screen example below, there were 349 pulses since the last reset.

Reset Pulse Cnt.
349

To reset this to zero, press enter (↵) and a “YES” will appear and flash.

Reset Pulse Cnt.
YES

Press enter (↵) again and the pulse counter will be reset. In addition, from the screen above you can press the down ▼ button to a flashing “NO”. Pressing enter (↵) will return back to the Reset Pulse Count screen. If you answered YES, the count will read zero “0”.

Reset Pulse Cnt.
0

Totalizer (Sub-Menu): Pulse Width

Use this menu to set the width of the pulse in milliseconds. Navigate to the Pulse Width screen, use Table 3-5 above for guidance if necessary.

The pulse output is an isolated relay contact, so one pulse of for example 50ms closes the normally open relay for 50ms. Some counters work straight off of the relay contacts closing and some pull up the relay so when it closes it is a negative 50ms pulse. The 640i and 780i can use just the contacts or an approximately 10K pull-up resistor.

Choices Available:

- On (for testing; closes the normally open relay; default is 50 msec)
- Off (for testing, opens the relay; default is 50 msec)
- 50 ms
- 100 ms
- 250 ms

Pulse Width
50 ms

In the screen example above, the pulse width will close the isolated normally open contacts for 50ms, the frequency of the pulse varies with flow rate and units per pulse value (see below) but cannot exceed 1Hz maximum.

Press enter (↵) and the units will begin flashing. Press the up ▲ button or down ▼ button to choose the desired pulse. Next, press the enter key (↵) to save. You can press the exit ⊗ several times to climb back up to the main menu level or press ► to proceed to the next Sub-Menu called Units Per Pulse.

Totalizer (Sub-Menu): Units Per Pulse

Use this menu to select the units per pulse. Navigate to the Units Per Pulse screen, use Table 3-5 above for guidance if necessary. **Note the maximum frequency at which the totalizer can count is 1 pulse per second, or 1 Hz.** This puts a limit on the units per pulse and makes resolution dependent on flow rate.

For example: Assume the maximum flow rate is 100 SCFM and you want the totalizer to pulse every 5 SCF. Since the flow is 100 SCFM, it will take 5/100 minutes, or 3 seconds to totalize 5 SCF. That is acceptable since the totalizer takes longer than 1 second to accumulate SCF.

Assume that now you want more resolution, so you would like the totalizer to pulse every 1 SCF. Since the flow is 100 SCFM, it will take 1/100 minutes, or 0.6 seconds to totalize 1 SCF. Since the instrument's totalizer is 1 Hz. It can't pulse any faster than a maximum rate of once per second (1 Hz).

In this example, the best units per pulse would be 1.7 SCF; that is just over the 1 HZ maximum sampling rate.

$$\frac{1 \text{ SCF}}{.6 \text{ seconds}} \times \frac{\text{second}}{\text{pulse}} = 1.7 \frac{\text{SCF}}{\text{pulse}}$$

Units per pulse 1.700000

Press enter (↵) and the units will begin flashing. As in previous examples, use the ▲▼▶◀ buttons to enter the desired value, and the enter key (↵) to save the value.

Press ▶ to proceed to the Totalizer On/Off screen or press the exit ⊗ several times to climb back up to the main menu level.

NOTE: The units of the totalizer are the same as entered in the units menu (minus the time since this is an accumulation and not a rate).

Totalizer (Sub-Menu): Totalizer On/Off

Use this menu to turn the totalizer On or Off. Use Table 3-5 for guidance if necessary. Press enter (↵) and the variable will begin flashing. As in previous examples, use the ▲▼ buttons to select On or Off, and press enter (↵) to save the value.

Totalizer ON

Note: The Totalizer can only be used when mass units are being used. For example, Lbs/Hr or Kg/Hr.

Totalizer set up is now complete. This concludes our review of the Totalizer (Sub-Menu). Press exit ⊗ to climb back up to the main menu.

Alarm (Sub-Menu)

The alarm sub menu controls all aspects of the 640i and 780i Alarm feature. The instrument can be set to alarm on **one** of the following variables: Flow, Pressure, Temperature or Totalizer. The instrument alarm can be set on **one** of the following conditions: Low, High or Window. The Window alarm becomes active when the parameter reads higher OR lower than the set point (when it is outside of its “operating window”).


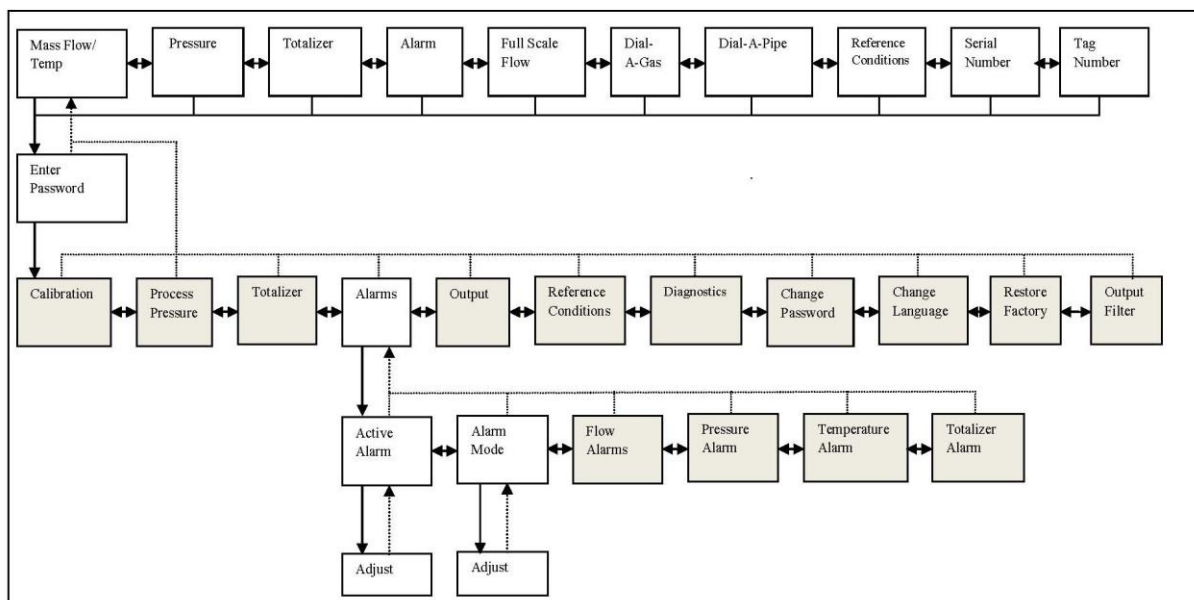


Table 3-6: Alarm Sub Menu

Alarm (Sub-Menu): Active Alarm

 Navigate to the Active Alarm screen, use Table 3-6 above for guidance if necessary. Press enter ↵ and the variable will begin flashing. In the screen example below, the active alarm is “Flow”.



Use the ▲▼ buttons to select On or Off, and press enter (↵) to save the value.

Alarm Choices Available:

 
- Flow
- Pressure
- Temperature
- Totalizer
- Off
- On (use only to test the alarm relay)

NOTE: Only *one* alarm can be active at any one time. The alarm relay is a normally open isolated contact. The alarm is tripped when the relay closes.

You can press the exit ⊗ several times to climb back up to the main menu level or press ► to proceed to the next Sub-Menu called Alarm Mode.

Alarm (Sub-Menu): Alarm Mode

Navigate to the Alarm Mode screen, use Table 3-6 above for guidance if necessary. Press enter ↵ and the variable will begin flashing. In the screen example below, the active alarm condition is “Low”.



Use the ▲▼ buttons to select On or Off, and press enter (↵) to save the value.

Available Choices:

- High
- Low
- Window
- Off
- On

Alarms (Sub-Menu)

The Alarms (Sub Menu) allows you to set the Low and High alarm values for Flow, Pressure, Temperature, and Totalizer.

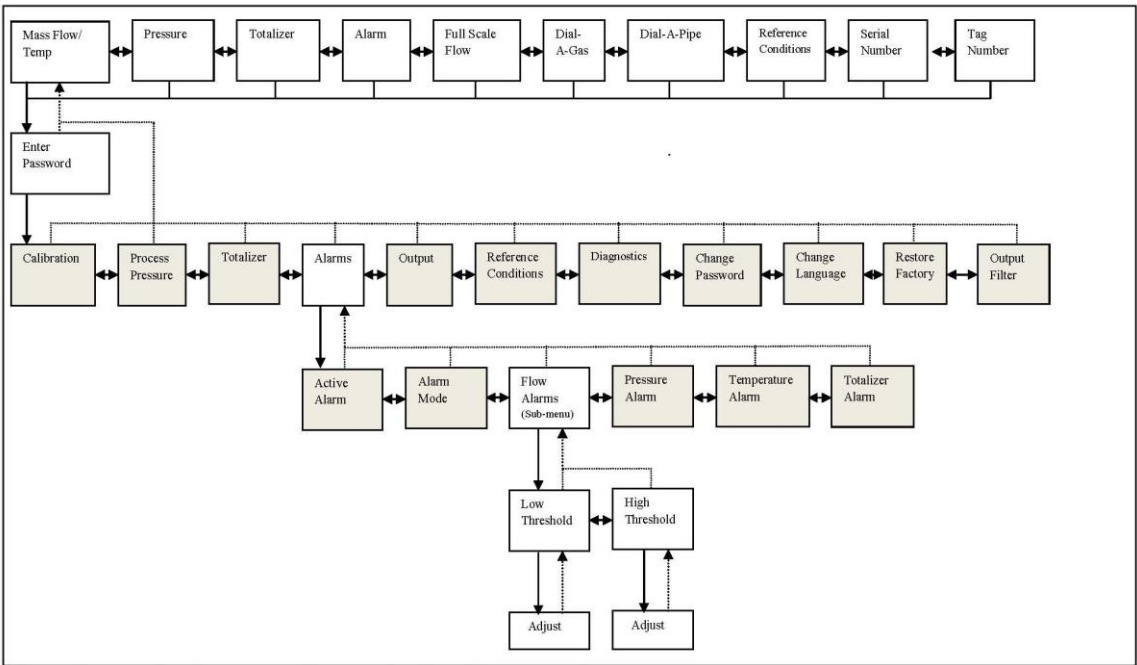


Table 3-6.1: Flow Alarms (Sub Menu)

We will set a low flow alarm to demonstrate the Alarms function. Navigate to the Flow Alarms (Sub Menu) screen, use Table 3-6.1 above for guidance if necessary. Assume that you already set the Active Alarm to “Flow” and the alarm condition is set to go off on a “Low” flow. The Flow Alarms (Sub Menu) allows you to set the actual alarm setpoint along with hysteresis.

Press enter (↵) and the units will begin flashing. As in previous examples, use the ▲▼▶◀ buttons to enter the desired numeric value, and the enter key (↵) to save the value.

In the example screen below, 10 SCFM has been entered. The units were already set in the units menu.

Low (SCFM)
000010.000000

If you wanted to now set a High alarm, press the right key ▶ and the High alarm setup screen will appear.

Note: If you wanted to set the active alarm on pressure, temperature or totalizer (instead of flow), press the right key ▶ to reach the appropriate sub-menu and use the ▲▼▶◀ buttons to enter the desired numeric value, and the enter key (↵) to save the value

This concludes our review of the Calibration Sub-Menu. Press the exit ⊗ climb back up to the main menu.

Output Adjust (Sub-Menu): Flow, Pressure and Temperature

The QuadraTherm® 640i and 780i comes standard with linear 4 to 20 mA analog outputs for flow and temperature. If the pressure option is selected, a third linear 4 to 20 mA analog output is provided for pressure.

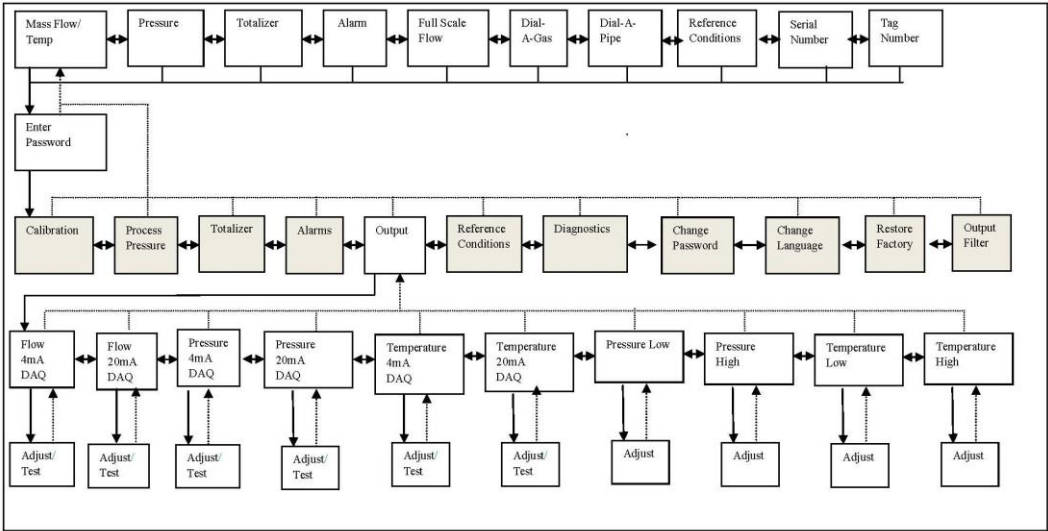


Table 3-7: Output (Sub Menu)

Use the output adjust menu to view, test, or adjust the 4 and 20 mA raw digital DAC counts value for these parameters as well as to view or adjust the pressure and temperature values that

correspond to 4 and 20mA. Zero flow always corresponds to 4mA and full scale flow always corresponds to 20mA.

All values in the output menu have been calibrated and set at the factory. You only need to enter these screens if you wish to view, adjust, or test any of the values.

Setting Up: 4-20 mA Outputs

We will set Flow 4-20 mA to demonstrate this function. The same routines apply for setting up Pressure 4-20 mA and Temperature 4-20 mA.

Flow 4 mA : View, Test, Adjust

Navigate to the Flow 4 mA screen in the Output (Sub Menu), use Table 3-7 above for guidance if necessary. From this menu, press enter to get to the flow 4 mA setup screen.

Flow 4 mA
11373

This numeric value is the DAC value that produces 4 mA on the analog flow output. In the example screen DAC is 11373. Press enter (↵) and the units will begin flashing. Increasing this value will raise the 4 mA output and decreasing this value will lower the 4 mA output. Use the ▲▼▶◀ buttons to enter the desired numeric value, and the enter key (↵) to save the value.

You can then use the down ▼ button to force/test flow 4 mA output and hit the up ▲ button to stop the force/test. It will flash testing until you stop the test. You can repeat this process, if desired, until you achieve the desired result.

Flow 4 mA
11373 - Testing

Flow 20 mA : View, Test, Adjust

Navigate to the Flow 20 mA screen in the Output (Sub Menu), use Table 3-7 above for guidance if necessary. From the Flow 4 mA screen, pressing the right ▶ button will send you to the view, test, or adjust screen for 20 mA value.

This value is the DAC value that produces 20 mA on the analog flow output. In the example screen DAC is 56643. Press enter (↵) and the units will begin flashing. Increasing this value will raise the 20 mA output and decreasing this value will lower the 20 mA output. Use the ▲▼▶◀ buttons to enter the desired numeric value, and the enter key ↵ to save the value.

Flow 20 mA
56643






 
You can then use the down ▼ button to force/test flow 20 mA output and hit the up ▲ button to stop the force/test. It will flash testing until you stop the test. You can repeat this process, if

desired, until you achieve the desired result.

Flow 20 mA
56643 - Testing

NOTE: The engineering units are as set in the Calibration (Sub Menu). Go to that section for more detailed information.

 
 
In the example above, assume full scale flow is 100 SCFM. As a result, a 20 mA output equals 100 SCFM and 4 mA output equals 0.00000 SCFM. These values are fixed for flow. The output is linear between these two points, in this example, if we had a flow of 50 SCFM, the output would be 12 mA.

Once you have completed viewing, testing, and adjusting the flow, pressure, and temperature 4-20 mA DAC values press the right key  to reach the appropriate sub-menu and use the     buttons to enter the desired numeric value, and the enter key  to save the value



Getting 4 to 20 mA for Temperature and Pressure

If you wanted to set the 4 to 20 mA active alarm on pressure and temperature (instead of flow).


Pressure Low
0.00

The pressure units above are the current pressure units you ordered or that you have changed in the process pressure sub-menu. In the example above if your pressure units are psia then 0.00 psia would correspond to the pressure 4mA output. Press enter key  and use the left right up and down keys to modify this value if desired and then press the enter key  to accept. Press the right key to continue to the pressure high value that corresponds to the 20mA output.

  Pressure High
30.00

In the example above, if your pressure units are psia then 30.00 psia would correspond to the pressure 20mA output. Press enter key  and use the left right up and down keys to modify this value if desired and then press the enter key  to accept. If you change this value be sure not to enter a Pressure High value greater than the full scale of the pressure option you ordered or you would be over the range of the transducer. If you change these pressure low/high values the pressure accuracy is still based on the original +/-1% of full scale of the Pressure transducer option ordered. Press the right key to continue to the temperature low value that corresponds to the 4mA output.

 Temperature Low
32.00

The temperature units above are the current temperature units you ordered or that you have changed in the calibration sub-menu. In the example above, if your temperature units are °F then 32.00 °F would correspond to the temperature 4mA output. Press enter key  and use

the left right up and down keys to modify this value if desired and then press the enter key (↵) to accept. Press the right key to continue to the temperature high value that corresponds to the 20mA output.

Temperature High
212.00

In the example above, if your temperature units are °F then 212.00 °F would correspond to the temperature 20mA output. Press enter key (↵) and use the left right up and down keys to modify this value if desired and then press the enter key (↵) to accept. If you change these temperature low/high values the temperature accuracy is still based on the original +/-1°C specification.

In the above examples, from 32.00° F to 212.00° F or from 0 to 30 psia would correspond to the 4 and 20mA analog outputs for temperature and pressure. These values are dependent upon your process. Finally, exit back to the set-up menu and right to reference conditions.

Reference Conditions (Sub-Menu): Standard and Normal

Use this menu to establish the reference conditions as specified in the units menu. Navigate to the Reference Conditions (Sub Menu), use Table 3-8 below for guidance if necessary.

Ref. Con.
(Sub Menu)

Press enter (↵) once and then use the ◀▶ buttons to select “Standard” or “Normal” .

Standard Temp.
70.000000 / F

↔

Standard Press.
14.695949 / Psia

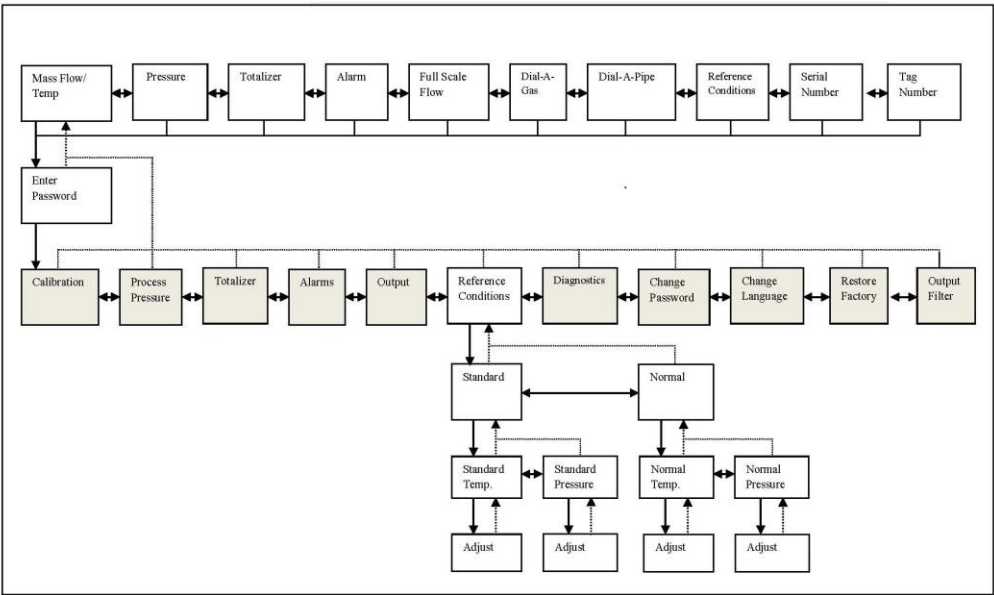



Table 3-8: Reference Conditions (Sub Menu)

For example, SCFM (Standard Cubic Feet per Minute) is commonly used in the United States. The S = Standard in SCFM and is referenced to 70°F (21.1°C) and 14.696 Psia (or 1 atmosphere).

In Europe, Nm3/hr (Normal Cubic Meters per Hour) is commonly used. The N = Normal and is generally referenced to 0°C and 101.32 KPa A(or 1 atmosphere).

Once a “Standard” or “Normal” selection has been made press enter (↵) again to go to the adjust screen.

From here you can adjust instrument reference conditions . To adjust, press (↵) again and the units will begin flashing. As in previous examples, use the ▲▼▶◀ buttons to enter the desired value, and press enter (↵) to save the value.

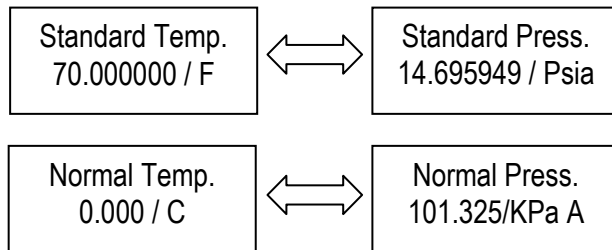

Once you are done press the enter key (↵) to save. You can press the exit ⊗ several times to climb back up to the main menu level or press ▶ to proceed to the next Sub-Menu called Diagnostics.

Diagnostics (Sub-Menu)

In the Diagnostics Sub-Menu, you can read the maximum and minimum: flow, pressure & temperature.

Navigate to the Diagnostics (Sub Menu), use Table 3-9 below for guidance if necessary.

Use the left ◀ and right ▶ buttons to view these values. These are the maximum and minimum values that the flow meter has measured. Press the exit ⊗ button several times to climb back up to the main menu level or press ▶ to proceed to the next Sub-Menu called Change Password (Sub Menu).

NOTE: Extensive diagnostics are available via the Smart Interface Program (SIP) software.

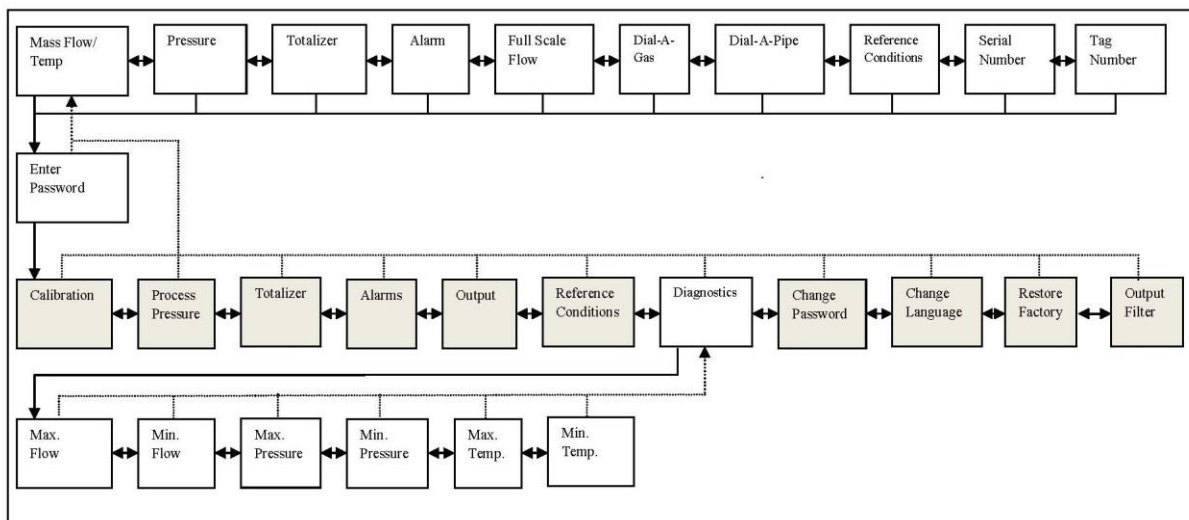


Table 3-9: Diagnostics (Sub Menu)

Change Password (Sub-Menu)

Use this menu to set or change a password. Navigate to the Change Password (Sub Menu), use Table 3-9 above for guidance if necessary.

A password is required to access the set-up sub menu's. Press enter (↵) and the four digit password units will begin flashing. As in previous examples, use the ▲▼◀▶ buttons to enter the desired value, and press enter (↵) to save the value.

Change Password
1234

The default password is 0000. If you have lost your password and can't gain needed access to the setup screens, you can contact our service department for a password that would allow you to access the setup screens and setup a new password.

You can press the exit ⊗ several times to climb back up to the main menu level or press ► to proceed to the next Sub-Menu called Change Language.

Change Language (Sub-Menu)

Navigate to the Change Language (Sub Menu), use Table 3-9 above for guidance if necessary.

Use this menu to change the displayed language. Use SIP program to download latest languages to your device.

You can press the exit ⊗ several times to climb back up to the main menu level or press ► to proceed to the next Sub-Menu called Restore Factory.

Change Language
US-English

Restore Factory (Sub-Menu):

Use this menu to restore all parameters to the original factory conditions. This will undo any changes you have made.

Navigate to the Restore Factory (Sub-Menu), use Table 3-9 above for guidance if necessary.



Press enter (↵) and the YES will begin flashing. As in previous examples, use the ▲▼ buttons to enter YES or NO, and press the enter key (↵) to save.

Caution!

Before attempting any flow meter repair, verify that the line is not pressurized.



Caution!

Always remove main power before disassembling any part of the mass flow meter.

Restore Factory
YES

You can press the exit ⊗ several times to climb back up to the main menu level or press ► to proceed to the next Sub-Menu called Output Filter.

Output Filter (Sub-Menu):

Use this menu to view or change your current Output Filter value. Navigate to the Output Filter (Sub-Menu), use Table 3-9 above for guidance if necessary.

This value is a smoothing or averaging function of the indicated flow rate. This value can be from 1 to 200. Increasing this value will smooth-out the indicated flow rate more and slow down the time response slightly.

Decreasing this value will make the indicated flow noisier, but will also speed up the response time slightly.

Press enter (↵) and the units will begin flashing. As in previous examples, use the ▲▼▶◀ buttons to enter the desired value, and the enter key (↵) to save the value.

Output Filter
020

Hit the exit key to return to the main top menu.

Chapter 4: Troubleshooting & Repair

Troubleshooting the Flow Meter

Begin hardware troubleshooting by verifying the following facilities issues are correct. These areas impact system operation and must be corrected prior to performing any flow meter inspections.

1. Verify the incoming power to the flow meter is present and of the correct voltage and polarity.
2. Check the flow meter wiring for correct connections as described in Chapter 2.
3. Verify the flow meter is installed with the correct number of upstream and downstream pipe diameters as shown on page 2-2.
4. Verify the flow direction indicator is correctly aligned pointing downstream of flow.
5. Make sure there are no leaks in the line being measured.

After verifying the factors above, follow the troubleshooting procedures outlined on the next page. If you need to return the flow meter to the factory, see page 4-3 for return shipping instructions.

<i>Problem</i>	<i>Possible Cause</i>	<i>Solution</i>
Velocity measurement is erratic or fluctuating	Very erratic or non-uniform flow	Follow installation requirements shown in Chapter 2
	Flow meter installed with less than required minimum pipe diameters upstream and downstream of the sensor	Follow installation requirements shown in Chapter 2
	Insertion sensor probe not mounted securely	Sensor probe must be mounted securely without vibration
	Sensor component broken	Return to factory for replacement
	Malfunction in system electronics	Return to factory for evaluation
	Ground loop	Check wiring, see Chapter 2
	Moisture present in gas flow	Install a water trap or filter upstream of the flow sensor
Velocity measurement seems too high or low	Sensor assembly not aligned correctly to flow	Correct alignment with the flow indicator pointing downstream in the direction of flow
	Sensor probe not inserted to the proper depth	Verify sensing point is located on the centerline of the pipe
No response to flow from sensor assembly	No power	Turn on power to the flow meter
	Low flow cutoff too high	Correct low flow cutoff programming using the Smart Interface software.
	Flow rate below meter's minimum flow rating	Contact factory for instructions
	Flow has exceeded the maximum range of the flow meter	Set the user full scale to equal the factory full scale Reduce flow below the maximum range shown on the meter's nameplate or contact the factory for re-calibration advice
	Flow profile distortions	Try to find another location for the meter
	Extremely turbulent flow	Do not place the meter near a ventilator, static mixer or valve
	Sensor failure	Return to factory for evaluation
	Printed circuit assembly defective	Return to factory for evaluation

Returning Equipment to Factory

Factory Calibration—All Models

Sierra Instruments maintains a fully-equipped calibration laboratory. All measuring and test equipment used in the calibration of Sierra transducers are traceable to NIST Standards. Sierra is ISO-9001 registered and conforms to the requirements of ANSI/NCSL-Z540 and ISO/IEC Guide 25.

Instructions for Returning Your Instrument for Service

The following information will help you return your instrument to Sierra Instruments' Factory Service Center and will ensure that your order is processed promptly. Prices may vary depending on the flow range, type of gas and operating pressure of your unit. To request detailed pricing, contact your local Sierra Instruments distributor or contact one of our offices directly.

Please follow these easy steps to return your instrument for factory service:

1. To obtain a Return Materials Authorization (RMA) number from the Sierra Instruments to <http://www.sierrainstruments.com/rma/new.php> to create a Sierra Account.
2. Once you have created an account, click on the *Submit New RMA* tab and fill in the RMA form and follow the instructions. You will receive an email confirmation once you have submitted your RMA.
3. Print a copy of the RMA (that now includes RMA #) and send a copy of the RMA form along with your meter back to the factory.

If you require service beyond calibration, but do not know which service(s) will be required, describe the symptoms as accurately as possible on the RMA form.

Pack your instrument carefully. Use the original packaging and foam or bubble wrap (packing peanuts NOT recommended) and include a copy of the RMA form (complete with Sierra supplied RMA number) with the unit(s).

Ship the unit(s) to the following address:

**Sierra Instruments, Inc.
Attention: Factory Service Center
5 Harris Court, Building L
Monterey, CA 93940 USA
RE: RMA# (your number)**

Appendix A: Product Specifications

PERFORMANCE SPECIFICATIONS

Gas Measured

All inert gases and all non-condensing clean gases
Flammable gases: methane, propane, hydrogen, digester gas, natural gas
Corrosive gases compatible with 316L stainless steel
qTherm Gas Library: most common gases and mixtures; air is standard;
qTherm Dial-A-Gas option for choice of three additional gases

Mass Velocity Range for Air

0 to 60,000 sfpm (0 to 305 smps) at 21.1°C (70°F), 1 atm

Multivariable Outputs

Mass flow rate (standard)
Temperature (standard)
Pressure (optional)
Totalized flow: totalized value is stored in non-volatile memory

Mass Flow Accuracy

780i Inline version accuracy (highest accuracy):*
+/- 0.5% of reading above 50% of the full scale flow
+/- 0.5% of reading plus 0.5% of full scale below 50% of full scale flow

640i Insertion version accuracy:*

+/- 0.75% of reading above 50% of the full scale flow
+/- 0.75% of reading plus 0.5% of full scale below 50% of full scale flow

See Table 1: qTherm Dial-A-Gas Selection Chart on next page for accuracy.
Gas pressure accuracy +/- 1.0% full scale
Totalize each gas independently with the flow totalizer

* Accuracy statements verified by an independent NIST and NVLAP accredited metrology laboratory.

Gas Temperature Accuracy

+/- 1°C (1.8°F)

Gas Pressure Ranges

30 psia (2.1 bara), 100 psia (6.9 bara), 300 psia (20.7 bara),
500 psia (34.5 bara), VTP only.

Repeatability

Mass flow rate: +/- 0.15% of full scale
Gas temperature: +/- 0.5°C (0.9°F)
Gas pressure: +/- 0.5% of full scale

Response Time

Three seconds to achieve 63% (one time constant) of final value

Mass Flow Rate Turndown

100:1

ANALOG AND DIGITAL OUTPUTS

Output Signals

4-20 mA flow, 4-20 mA temperature, 4-20 mA pressure (optional)
Alarm output (contact SPST/opto relays)
User definable pulse output for totalized flow

Optional Communications Modules

Modbus, Foundation Fieldbus (non-agency approval)
DeviceNet, Profibus DP, HART (pending)

SOFTWARE

Smart Interface Program (SIP) Software

Use Dial-A-Gas and Dial-A-Pipe for easy field setup
Use Meter Tune to optimize performance
Use ValidCal to validate all meter functions
Use flow totalizer to totalize all four Dial-A-Gases independently

POWER REQUIREMENTS

Input Power

100 to 240 VAC (0.4 Amps RMS at 230 VAC)
24 VDC +/- 10%, 1 Amp

OPERATING SPECIFICATIONS

780i Inline Version Gas Pressure Requirements

NPT: 500 psia (34.5 bara) maximum

Flange process connections defined by the ASME B 16.5a – 1998 spec. group rating of 316L stainless steel ANSI class 150 or 300 class flanges (special)

316L stainless steel 150 class flanges:

230 psia at -20°F to 100°F; 195 psia at 200°F;
145 psia at 300°F; 160 psia at 400°F; and 145 psia at 500°F
Equivalent DN PN16 flanges are available (see page 10 for sizes)

316L stainless steel 300 class flanges (special):

600 psia at -20°F to 100°F; 505 psia at 200°F; 455 psia at 300°F;
415 psia at 400°F; and 380 psia at 500°F

640i Insertion Version Gas Pressure Requirements

Compression fittings: 500 psia (34.5 bara)
1-inch 150 class flange (-40°F to 250°F) 185 psia (12.8 bara)
Low pressure hot tap: 150 psia (10.3 bara)
High pressure hot tap: 230 psia (15.9 bara)

Gas Temperature Requirements (all versions)


 

-40°F (-40°C) to 392°F (200°C)
High temperature (HT) option to 750°F (400°C) available in 640S model only

Ambient Temperature (NAA and cFMus versions)

-40°F (-40°C) to 140°F (60°C)
ATEX/IECEx Versions -4°F (-20°C) to 140°F (60°C)

PHYSICAL SPECIFICATIONS

User Interface

Local keypad with a six-button interface
Exit  Enter  Four-way directional arrows 
RS-232 with PC software for communication and programming

Digital Display

UltraBright, backlit, LCD digital display, 2 x 16, 2 x 32 scrolling

780i Inline Version Process Connections

See page 9 and 10 for NPT, ANSI class 150 flange and PN16 DN sizes.

640i Insertion Version Process Connections

See page 6 through 8 for insertion sizes.
ANSI 1-inch - ANSI class 150 flange (optional)
Low pressure hot tap rated to 150 psia (10.3 bara)
High pressure hot tap and retractor 230 psia (15.9 bara)

Wetted Materials

316 SS and 316L SS flow body and Pt/Ir (velocity sensor)
Viton® VTP Pressure Option
Neoprene®, Kal-Rez® optional

Leak Integrity

1 x 10⁻⁴ scs of helium

Approval Agencies

cFMus—Explosion proof for Class I, Div I, Groups B,C,D
CE—European Conformity
ATEX/IECEx

Enclosure

NEMA 4 (IP66), hazardous-area explosion proof, flow pointer, meter information tag. NEMA 4X (E2 option only).

TABLE 1: qTherm Dial-A-Gas Selection Chart				
Gas	780i Accuracy		640i Accuracy	
	Actual Gas ⁽¹⁾	qTherm Dial-A-Gas ⁽²⁾	Actual Gas ⁽¹⁾	qTherm Dial-A-Gas ⁽²⁾
Air ⁽³⁾	±0.5%	N/A	±0.75%	N/A
Argon	±0.5%	±3.0%	±0.75%	±3.0%
Carbon Dioxide	±0.5%	±3.0%	±0.75%	±3.0%
Chlorine	N/A	±3.0%	N/A	±3.0%
Digester Gas (60% CH ₄ , 40% CO ₂)	±0.5%	±3.0%	±0.75%	±3.0%
Helium	±0.5%	±3.0%	±0.75%	±3.0%
Hydrogen	±0.5%	±3.0%	±0.75%	±3.0%
Methane	±0.5%	±3.0%	±0.75%	±3.0%
Nitrogen	±0.5%	±3.0%	±0.75%	±3.0%
Oxygen	N/A	±3.0%	N/A	±3.0%
Propane	±0.5%	±3.0%	±0.75%	±3.0%
Other ⁽⁴⁾ —Consult Factory	Special Calibration Request (SCR)	Special Calibration Request (SCR)	Special Calibration Request (SCR)	Special Calibration Request (SCR)

Notes: (1) % of reading at >50% of full scale flow; add 0.5% of full scale below 50% of full scale flow

(2) % of full scale

(3) Air is standard on the instrument and cannot be removed


(4) The qTherm Gas Library is a proprietary gas property index that is continually updated and improved

TABLE 2: 640i/780i Straight Run Requirements			
Piping Condition	Upstream 640i Insertion	Upstream 780i Inline with Flow Conditioning ⁽¹⁾	Downstream ⁽²⁾
Single 90° Elbow or T-Piece	15D	1D	0D
Reduction (4:1)	20D	3D	0D
Expansion (4:1)	40D	3D	0D
After Control Valve	15D	3D	0D
Two 90° Elbows (in same plane)	30D	3D	0D
Two 90° Elbows (different planes)	40D	5D	0D

Notes: (1) Number of diameters (D) of straight pipe required between upstream disturbance and the flow meter

(2) Number of diameters (D) of straight pipe required downstream of the flow meter

780i INLINE PRESSURE DROP

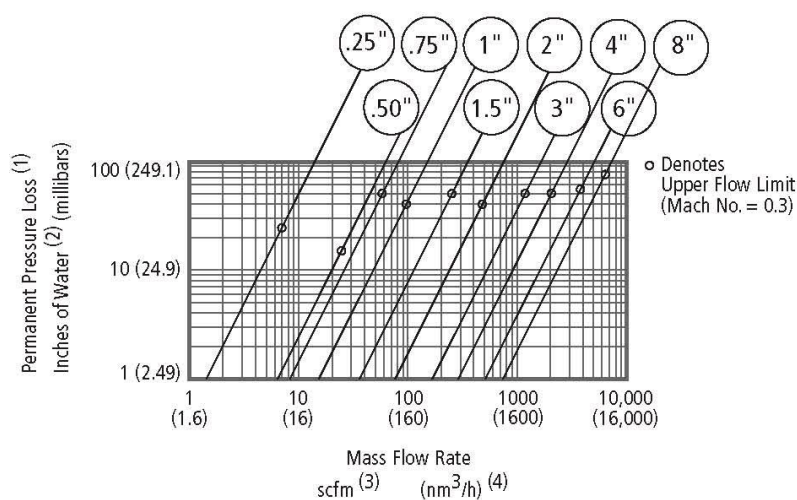

Notes: (1) For air and nitrogen at 20°C temperature and 1 atmosphere pressure


(2) 1 inch of water at 60°F = 0.0361 psi

(3) At base conditions of 21.1°C temperature and 1 atmosphere pressure


(4) At base conditions of 0°C temperature and 1 atmosphere pressure

640i INSERTION DIMENSIONAL DRAWINGS

P2-DD—Side View

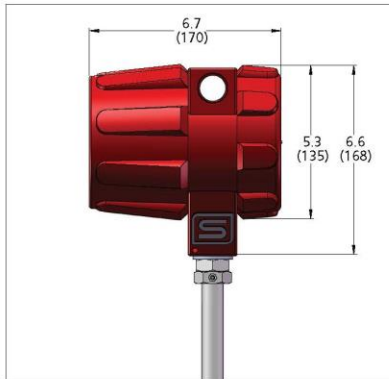


P3-DD—Side View

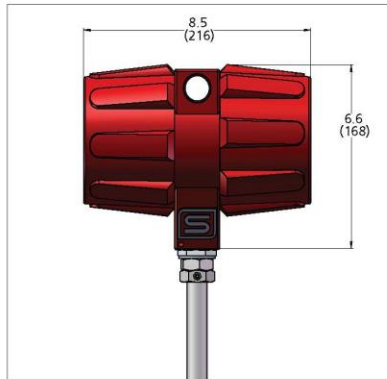


All Versions—Front View




P2-DD Compression Fitting—Side View

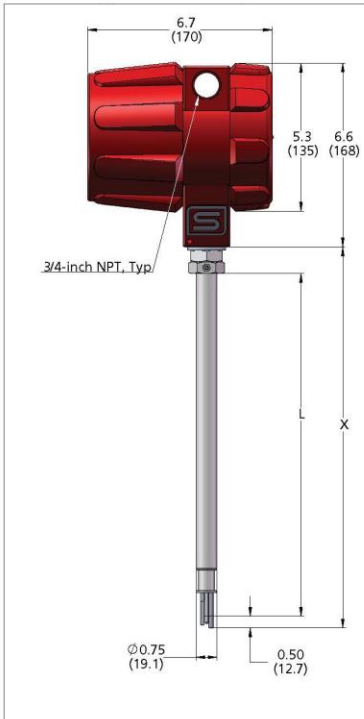

P2-DD Flange Fitting—Side View

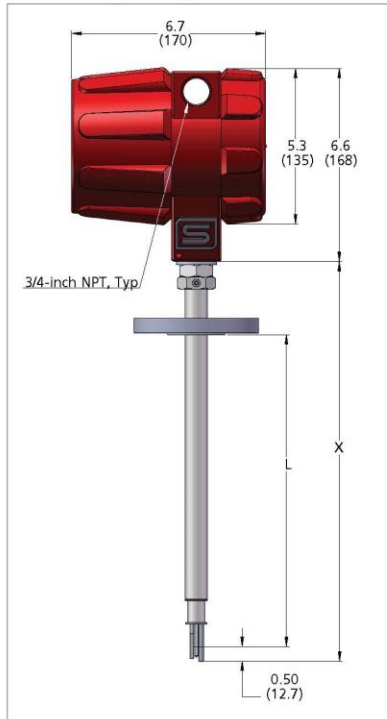

FM Approved Probes (> 13")

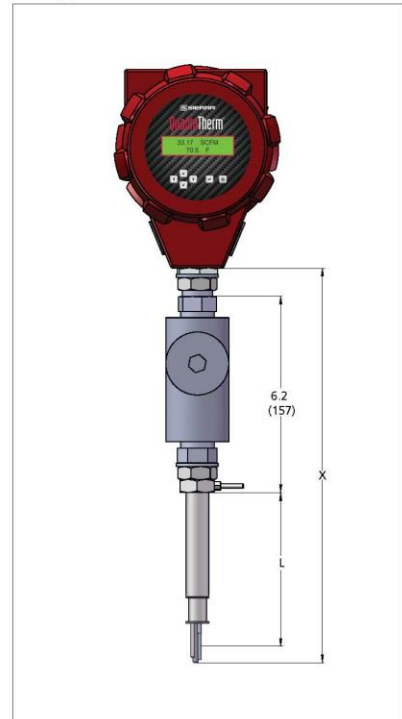

Note: All dimensions in inches with (mm) in brackets; certified drawings available upon request


Length Chart 640i Compressions Fittings		
Code	L	X
L06	6.0 (152)	7.5 (191)
L09	9.0 (229)	10.5 (267)
L13	12.0 (305)	13.5 (343)
L18	18.0 (457)	19.5 (495)
L24	21.5 (546)	23.0 (584)
L36	35.5 (902)	37.0 (940)
L48	47.5 (1207)	49.0 (1245)

Length Chart 640i Flange Mounting		
Code	L	X
L06	4.4 (112)	7.5 (191)
L09	7.4 (188)	10.5 (267)
L13	10.4 (264)	13.5 (343)
L18	16.4 (417)	19.5 (495)
L24	19.9 (505)	23.0 (584)
L36	33.9 (861)	37.0 (940)
L48	45.9 (1166)	49.0 (1245)


Length Chart 640i FM Version		
Code	L	X
L06	6.0 (152)	7.5 (191)
L09	9.0 (229)	10.5 (267)
L13	12.0 (305)	13.5 (343)
L18	18.0 (457)	25.7 (653)
L24	21.5 (546)	29.2 (742)
L36	35.5 (902)	43.2 (1097)
L48	47.5 (1207)	55.2 (1402)

640i INSERTION DIMENSIONAL DRAWINGS


Remote Electronics—Side View

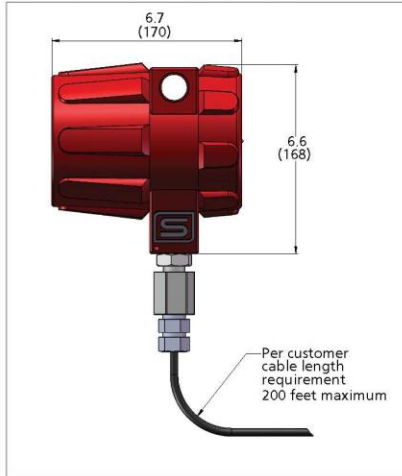


Remote Probe—Front View

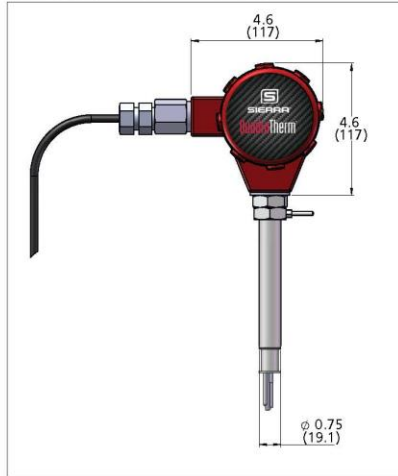


Remote Probe—Side View

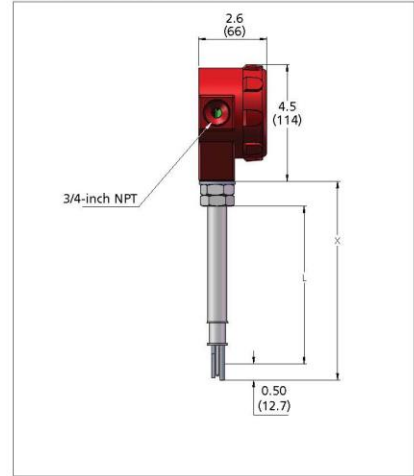


P3-DD Remote Bracket—Side View

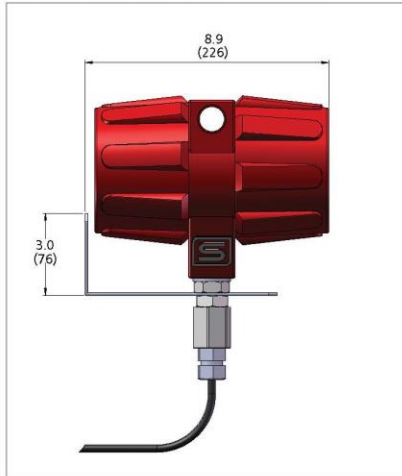

P2-DD Remote Bracket—Side View

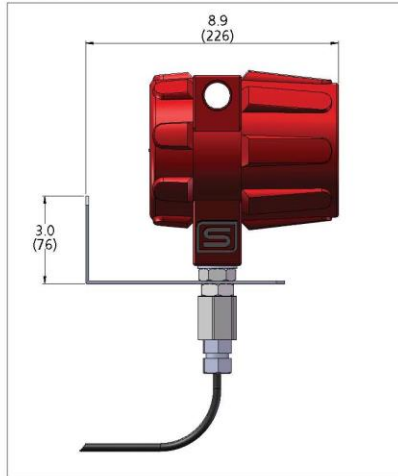


Remote Bracket—Front View

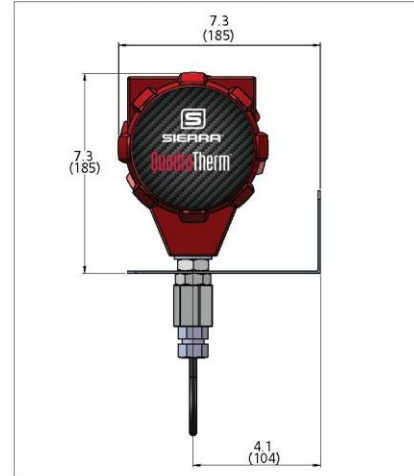

Note: All dimensions in inches with (mm) in brackets; certified drawings available upon request


Mounting Holes for Remote Bracket

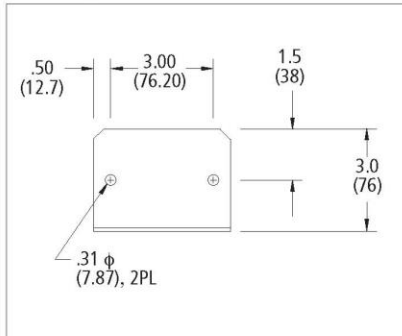

Length Chart 640i Remote Mount Junction Box		
Code	L	X
L06	6.0 (152)	7.5 (191)
L09	9.0 (229)	10.5 (267)
L13	12.0 (305)	13.5 (343)
L18	18.0 (457)	19.5 (495)
L24	21.5 (546)	23.0 (584)
L36	35.5 (902)	37.0 (940)
L48	47.5 (1207)	49.0 (1245)

Note: All dimensions in inches with (mm) in brackets; certified drawings available upon request

640i INSERTION LOW PRESSURE HOT TAP to 150 psia (10 bara)

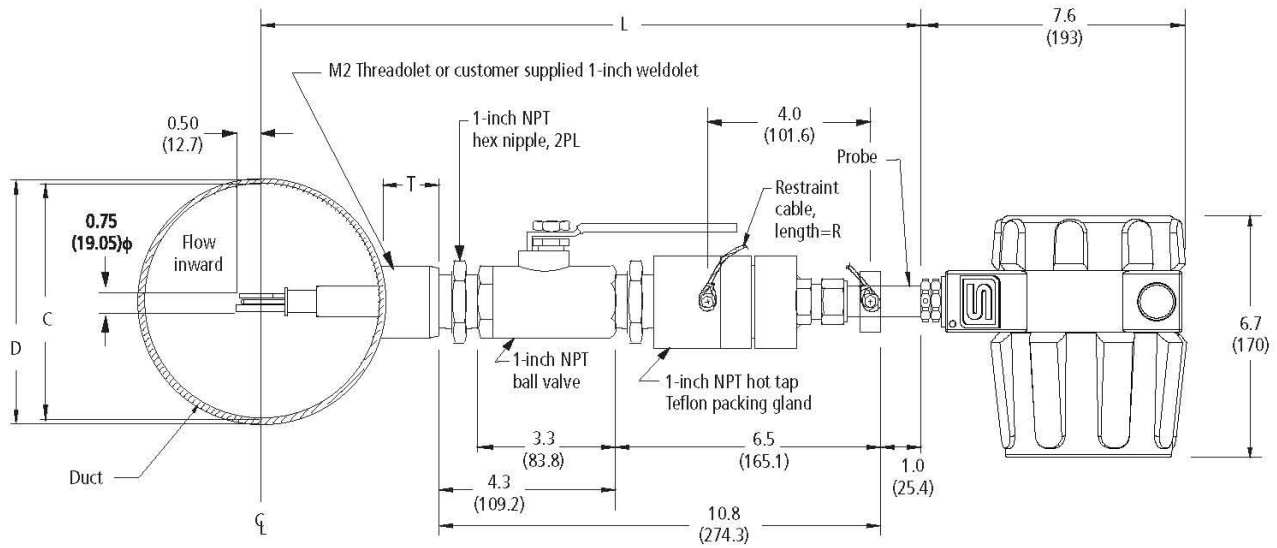


Variables

L = Nominal Probe Length
D = Duct O.D.
C = Duct I.D.
T = Height of "Threadolet" or Customer Provided Weldolet
R = Restraint Cable Length

Formula


$L > 12.3 + T + D/2$
So L must be equal or greater than 12.3-inches plus the height of the "Threadolet" plus half the duct O.D.
 $R = D/2 + T + 7.3$

640i HIGH PRESSURE HOT TAP to 230 psia (15.3 bara)

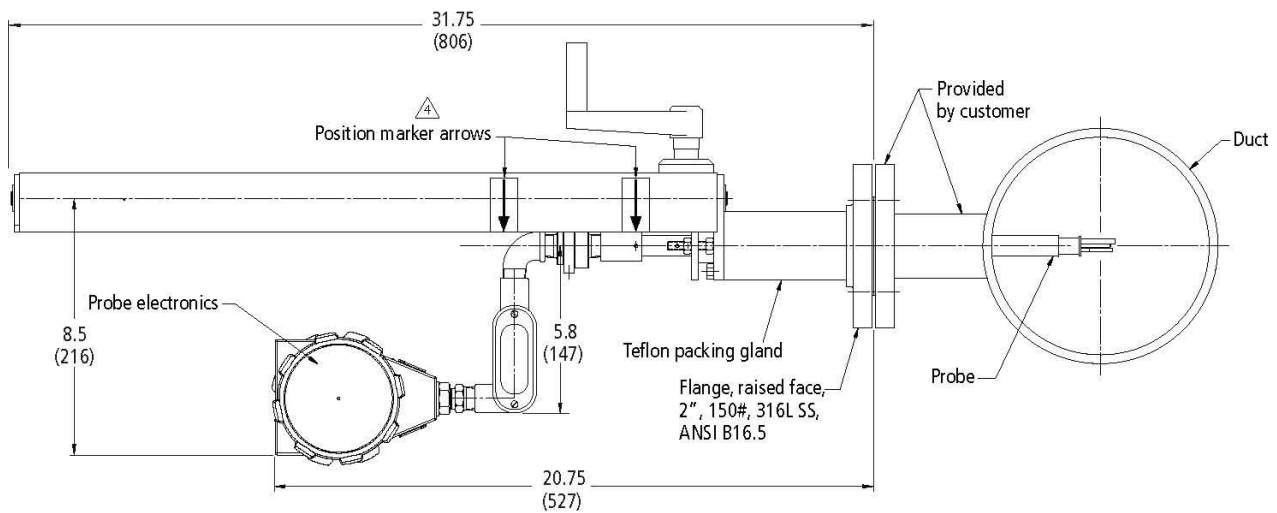


Note: All dimensions in inches with (mm) in brackets; certified drawings available upon request


1/2" and 1 1/2" NPT—Side View

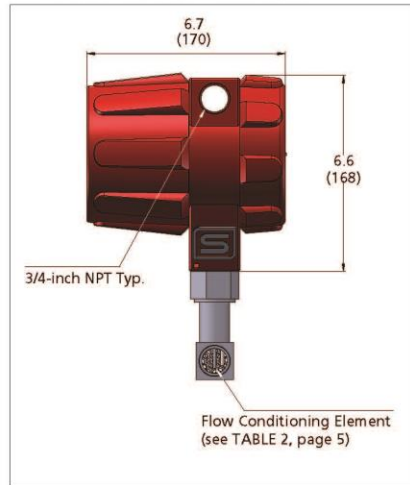


1/2" and 1 1/2" NPT—Front View

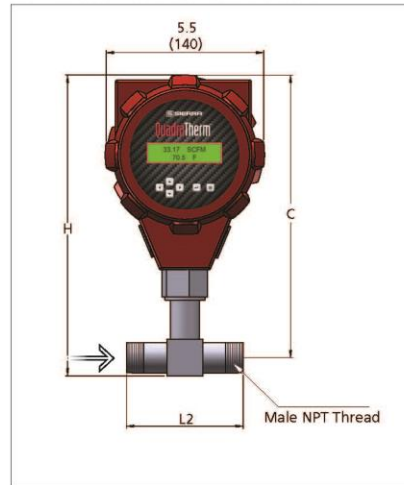


Sizes for NPT			
Size	H	C	L2
1/2-inch	10.5 (267)	9.9 (251)	7.5 (191)
3/4-inch	10.8 (274)	9.9 (251)	7.9 (201)
1-inch	11.2 (284)	9.9 (251)	8.3 (211)
1 1/2-inch	11.5 (292)	9.9 (251)	9.5 (241)

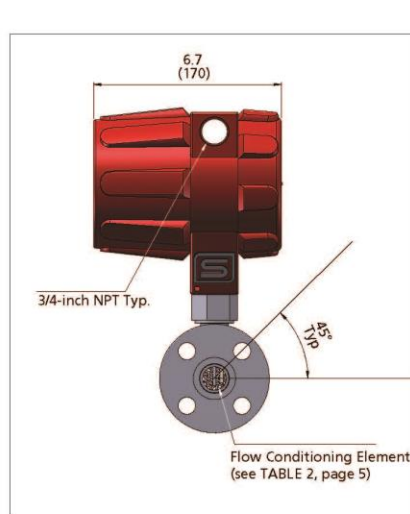


1/2" and 1 1/2" 150 Class Flange—Front View

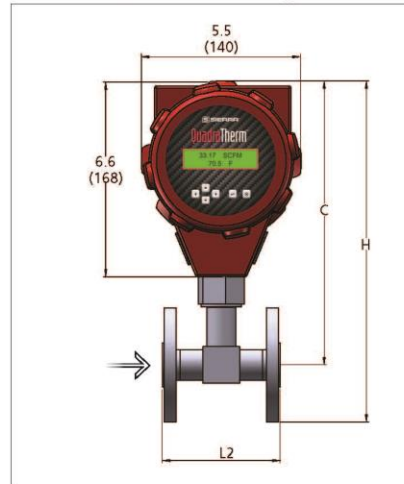


Sizes For ANSI Class 150 Flange			
Size	H	C	L2
1/2-inch	11.6 (295)	9.9 (251)	7.5 (191)
3/4-inch	11.8 (300)	9.9 (251)	7.9 (201)
1-inch	12.0 (304)	9.9 (251)	8.3 (211)
1 1/2-inch	12.2 (310)	9.9 (251)	9.5 (241)

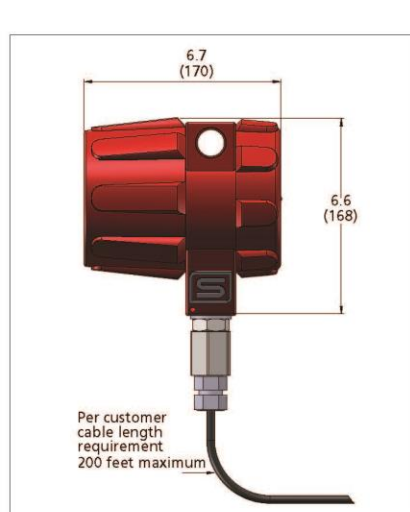

NPT Remote—Front View

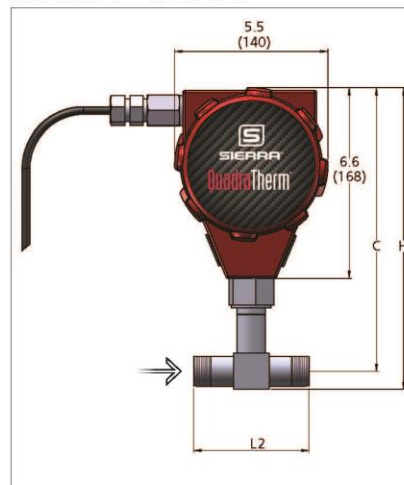


150 Class Flange Remote—Front View

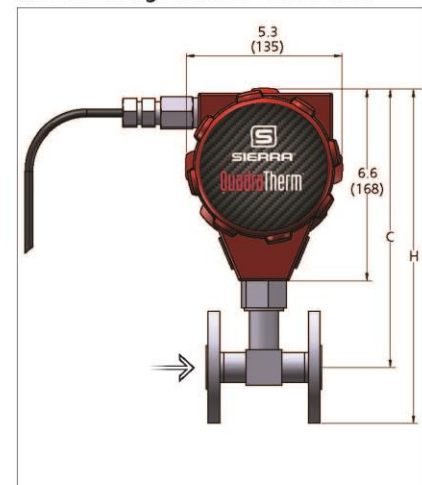


Note: All dimensions in inches with (mm) in brackets; certified drawings available upon request

2" Through 8" 150 Class Flange—Side View

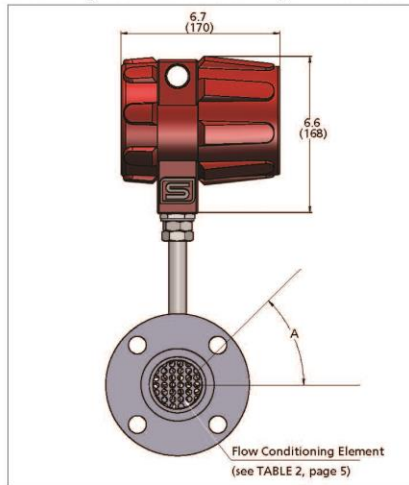


2" Through 8" 150 Class Flange—Front View

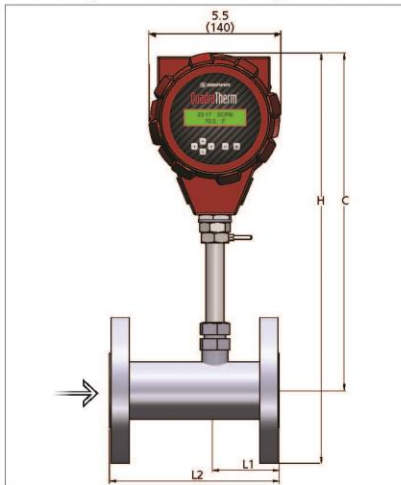


Sizes for ANSI Class 150 Flanges					
Size	H	C	L1	L2	A
2-inch	17.0 (432)	14.0 (356)	2.6 (66)	7.0 (178)	45
3-inch	17.7 (450)	14.0 (356)	2.6 (66)	10.0 (254)	45
4-inch	18.5 (470)	14.0 (356)	3.6 (91)	12.0 (305)	22.5
6-inch	19.5 (495)	14.0 (356)	5.6 (142)	18.0 (547)	22.5
8-inch	20.7 (526)	14.0 (356)	7.6 (193)	29.0 (737)	22.5

2" Through 8" NPT—Side View

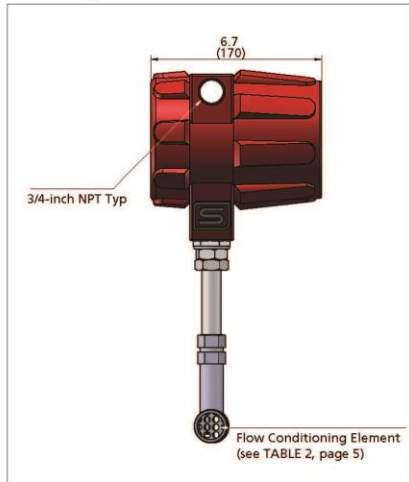


2" Through 8" NPT—Front View

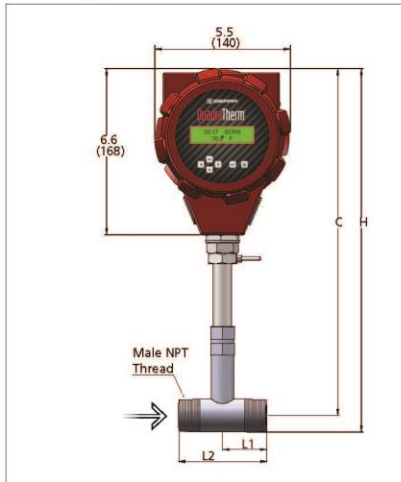


Sizes for 1-inch Through 8-inch NPT				
Size	H	C	L1	L2
2-inch	15.1 (384)	14.0 (356)	3.50 (89)	7.50 (191)
3-inch	15.7 (399)	14.0 (356)	4.00 (102)	10.00 (254)
4-inch	16.2 (411)	14.0 (356)	4.00 (102)	12.00 (305)
6-inch	17.3 (439)	14.0 (356)	6.00 (152)	18.00 (457)
8-inch	18.3 (465)	14.0 (356)	8.00 (203)	24.00 (610)

NPT Remote—Front View

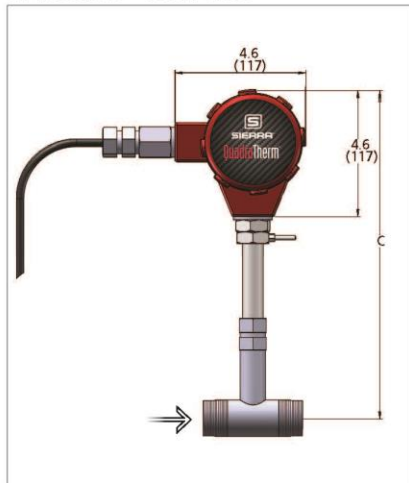

Flange Remote—Front View

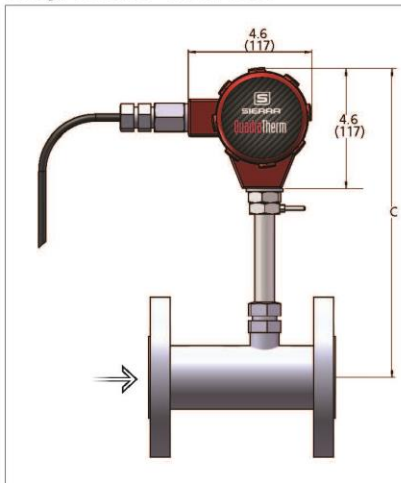

Sizes for PN16 DN Flanges				
Size	H	C	L1	L2
DN50	17.2 (437)	14.0 (356)	3.34 (85)	7.10 (180)
DN80	17.9 (455)	14.0 (356)	4.14 (105)	10.20 (259)
DN100	18.3 (465)	14.0 (356)	4.57 (116)	12.60 (320)
DN150	19.6 (498)	14.0 (356)	6.77 (172)	18.90 (480)
DN200	20.7 (526)	14.0 (356)	8.47 (215)	24.40 (620)

ORDERING THE 640i INSERTION

640i - - - - - - - - - - - - -

Dial-A-Gas Selection

Feature 1 2 3 4 5 6 7 8 9 *10 11 12 13

Instructions: To order a 640i, please fill in each feature number block by selecting the codes from the corresponding features below.

*Feature 10 is air (always included)

Feature 1: Multivariable	
VT	Thermal Insertion Mass Flow Meter; all 316L stainless steel construction; linear 4-20 mA output signals for Mass Flow Rate and Temperature; temperature range -40°F to 392°F (-40°C to 200°C); pressure to 500 psia (34.5 bara); standard accuracy (air) +/- 0.75% of reading above 50% of full scale flow and +/- 0.75% of reading plus 0.5% of full scale below 50% of full scale flow; 24 VDC +/- 10.0% or 100-240 VAC input power; configurable alarm and pulse outputs; CE, cFMus, ATEX, and IECEx approved
VTP	Add a pressure output to the 640i VT version; three analog 4-20 mA linear outputs for Mass Flow Velocity; includes pressure sensor to 500 psia (34.5 bara)

Feature 2: Approvals	
1	NAA. Non-agency approved.
2	cFMus. Maximum probe length is 48 inches (1.22 m).
3	ATEX / IECEx. Maximum probe length is 48 inches (1.22 m).

Feature 3: Probe Length	
L06	6 inch (15 cm)
L09	8.5-inch (22 cm)
L13	12-inch (30 cm)
L18	17.5-inch (44 cm)
L24	21.5-inch (55 cm)
L36	36-inch (91 cm)
L48	48 inch (122 cm)
L(x)	Special length not listed above or over 48 inches (122 cm). Specify length in parentheses; maximum probe length 72 inches (1.83 m). Maximum for FM 48 inches (1.22 m). This price applies to sizes below 48 inches (1.22 m) not listed above.
M9	High pressure hot-tap retractor kit, includes probe assembly, retractor assembly with hand crank, packing gland probe seal with a 2-inch ANSI class 150 process connection; not available with FM
L() M5 adder	Probe with 1-inch ANSI class 150 flange; specify length in parenthesis

Feature 4: Mounting Formation Accessories	
M0	Customer to supply own mounting hardware
M1	Compression fitting, 3/4-inch (2 cm) with 1-inch (2.5 cm) male NPT
M1-M2()	Compression fitting plus Threadolet, 3/4-inch probe feed through by 1-inch NPT. Threads into 1-inch Female NPT, which is welded to the pipe. Specify pipe O.D. in Parenthesis.
M3	Flat duct bracket, 3/4-inch (2 cm) tube compression fitting
M4()	Curved duct bracket, 3/4-inch (2 cm) tube compression fitting; specify duct O.D. in parentheses
M8()	Low pressure hot tap, includes ball valve and packing gland; maximum 150 psig (10.3 barg); specify duct O.D. in parentheses
M15()	Quick removal hot-tap, includes ball valve and compression fitting; rated for 40 psig (2.8 barg)

Feature 5: Electronics Enclosure	
E2	Hazardous-area location enclosure NEMA 4X (IP66) mounted directly on probe
E4()	Remote hazardous-area location enclosure, includes NEMA 4 (IP66) junction box mounted on probe and mounting bracket for remote electronics enclosure; maximum 200 feet (61 m) housing mounted up to 200 feet (61 m) from flow body; specify cable length in parenthesis. Note: VTP E4 not FM approved.

Feature 6: Input Power	
P2	24 VDC +/- 10.0%
P3	100-240 VAC

Feature 7: Output	
V4	Two linear 4-20mA outputs for T and mass flow rate
V6 (VTP only)	Three linear 4-20mA outputs for mass flow velocity, temperature and pressure (only available with Feature 1: (Multivariable 640i VTP)

Feature 8: Display	
DD	UltraBright, local LCD digital display indicates mass flow rate, T, P and totalized mass in engineering units
NR	No readout

Feature 9: Pressure	
MP1	30 psia (2.1 bara), VTP only
MP2	100 psia (6.9 bara), VTP only
MP3	300 psia (20.7 bara), VTP only
MP4	500 psia (34.5 bara), VTP only

Note: Put N/A in feature block 9 for VT or E4 meters.

Maximum operating pressure must not exceed the full scale of the pressure transducer if the VTP option is ordered or damage may occur.

Feature 10 Through 13: qTherm Dial-A-Gas		
Choose three gases in addition to air:		
Gas	Actual Gas Code	Dial-A-Gas Code
Air (standard)	0	0
Argon	1A	1
Carbon Dioxide	2A	2
Chlorine	N/A	3
Digester Gas (60% CH₄, 40% CO₂)	4A	4
Helium	6A	6
Hydrogen	7A	7
Methane	8A	8
Nitrogen	10A	10
Oxygen	N/A	11
Propane	12A	12
Other—Consult Factory	99	99

Note: See Table 1 qTherm Dial-A-Gas Selection Chart on page 5 to choose your three gases in addition to air and calibration accuracy.

11

ORDERING THE 780i INLINE

780i - - - - - - - - - - - -

Feature 1 2 3 4 5 6 7 8 *9 10 11 12

Instructions: To order a 780i, please fill in each feature number block by selecting the codes from the corresponding features below.

*Feature 9 is air (always included)

Feature 1: Multivariable	
VT	Inline Thermal Mass Flow Meter with Flow Conditioning; all 316L stainless steel construction; linear 4-20 mA output signals for Mass Flow Rate and Temperature; temperature range -40°F to 392°F (-40°C to 200°C) and pressure to 500 psia (34.5 bara); standard accuracy +/- 0.5% of reading above 50% of full scale flow and +/- 0.5% of reading plus 0.5% of full scale below 50% of full scale flow; configurable alarm and pulse outputs; CE, cFMus, ATEX, and IECEx approved
VTP	Add a pressure output to the 780i VT version; three analog 4-20 mA linear outputs for Mass Flow Rate; includes pressure sensor to 500 psia (34.5 bara)

Feature 2: Approvals	
1	NAA. Non-agency approved.
2	cFMus. Maximum probe length is 48 inches (1.22 m).
3	ATEX / IECEx. Maximum probe length is 48 inches (1.22 m).

Feature 3: Inline Flow Bodies with Flow Conditioning	
N2	1/2-inch (1 cm) NPT male 316 SS
N3	3/4-inch (2 cm) NPT male 316 SS
N4	1-inch (2.5 cm) NPT male 316 SS
N5	1.5-inch (4 cm) NPT male 316 SS
N6	2-inch (5 cm) NPT male 316 SS
N7	3-inch (8 cm) NPT male 316 SS
N8	4-inch (10 cm) NPT male 316 SS
N9	6-inch (15 cm) NPT male 316 SS
N10	8-inch (20 cm) NPT male 316 SS
F2	1/2-inch ANSI class 150 flange 316 SS
F3	3/4-inch ANSI class 150 flange 316 SS
F4	1-inch ANSI class 150 flange 316 SS
F5	1.5-inch ANSI class 150 flange 316 SS
F6	2-inch ANSI class 150 flange 316 SS
F7	3-inch ANSI class 150 flange 316 SS
F8	4-inch ANSI class 150 flange 316 SS
F9	6-inch ANSI class 150 flange 316 SS
F10	8-inch ANSI class 150 flange 316 SS
FD6	DN50, PN16, flange
FD7	DN80, PN16, flange
FD8	DN100, PN16, flange
FD9	DN150, PN16, flange
FD10	DN200, PN16, flange
GD4	DN25, PN40, DIN flange
GD5	DN40, PN40, DIN flange
GD6	DN50, PN40, DIN flange
GD7	DN80, PN40, DIN flange
GD8	DN100, PN40, DIN flange
GD9	DN150, PN40, DIN flange
GD10	DN200, PN40, DIN flange

Feature 4: Electronics Enclosure	
E2	Hazardous-area location enclosure NEMA 4X (IP66) mounted directly on probe
E4()	Remote hazardous-area location enclosure includes NEMA 4 (IP66) junction box mounted on probe and mounting bracket for remote electronics enclosure; specify cable length in parenthesis; maximum 200 feet (61m) housing mounted up to 200 feet (61m) from flow body. Note: VTP E4 not FM approved.

Feature 5: Input Power	
P2	24 VDC +/- 10.0%
P3	100-240 VAC

Feature 6: Output	
V4	Two linear 4-20mA outputs for T and mass flow rate
V6 (VTP only)	Three linear 4-20mA outputs for T, P, mass flow rate

Feature 7: Display	
DD	UltraBright, local LCD display indicates mass flow rate, T, P and totalized mass in engineering units
NR	No readout

Feature 8: Pressure	
MP1	30 psia (2.1 bara), VTP only
MP2	100 psia (6.9 bara), VTP only
MP3	300 psia (20.7 bara), VTP only
MP4	500 psia (34.5 bara), VTP only

Note: Put N/A in feature block 9 for VT or E4 meters.

Maximum operating pressure must not exceed the full scale of the pressure transducer if the VTP option is ordered or damage may occur.

Feature 9 Through 12: qTherm Dial-A-Gas		
Choose three gases in addition to air:		
Gas	Actual Gas Code	Dial-A-Gas Code
Air (standard)	0	0
Argon	1A	1
Carbon Dioxide	2A	2
Chlorine	N/A	3
Digester Gas (60% CH₄, 40% CO₂)	4A	4
Helium	6A	6
Hydrogen	7A	7
Methane	8A	8
Nitrogen	10A	10
Oxygen	N/A	11
Propane	12A	12
Other—Consult Factory	99	99


Note: See Table 1 qTherm Dial-A-Gas Selection Chart on page 5 to choose your three gases in addition to air and calibration accuracy.

Appendix B: Smart Interface Installation



Install the RS-232 Cable

Install the provided RS-232 pigtail to the terminal board (TB) as shown below, then install power to the meter.

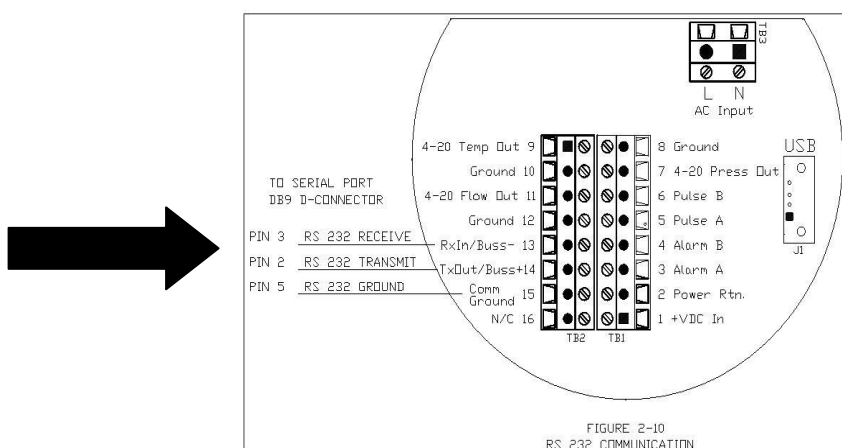

Installing the Program

System Requirements:

Operation System: Windows

QuadraTherm 640i & 780i Sierra Interface Program (SIP):

Click on the file (640i & 780i Sierra Interface Program). This file is self-extracting.

Follow instructions for installing the files.

Process takes about 1-10 minutes total depending on speed of your computer.

QuadraTherm 640i & 780i Sierra Interface Program Windows Compatible

Instructions: Click on Setup let it install the 640i & 780i Smart Interface Program. If you have any questions about downloading the files please contact Freynold Usi at:

f_usi@sierrainstruments.com.


Program Start-up

The smart interface program allows the user to configure the unit and view all unit parameters.

NOTE: The current version of the program. You may obtain the latest version from www.sierrainstruments.com.

Make sure your meter is powered up and the meter is connected via the serial or USB port to the computer running this SIP program. Click on the 640i and 780i SIP Icon to start the program.

Note select Port. To begin, use the pull down menu to select the appropriate com port. Once the port is selected, the meter data is read into the SIP program. Note how all data fields become populated. This may take several seconds. You will see a progress bar in the lower right as the meter data is collected. Be aware that all the data fields are read only. Entering and writing this data is done via the Function Selector or quick keys. The quick keys and will be discussed in those sections.

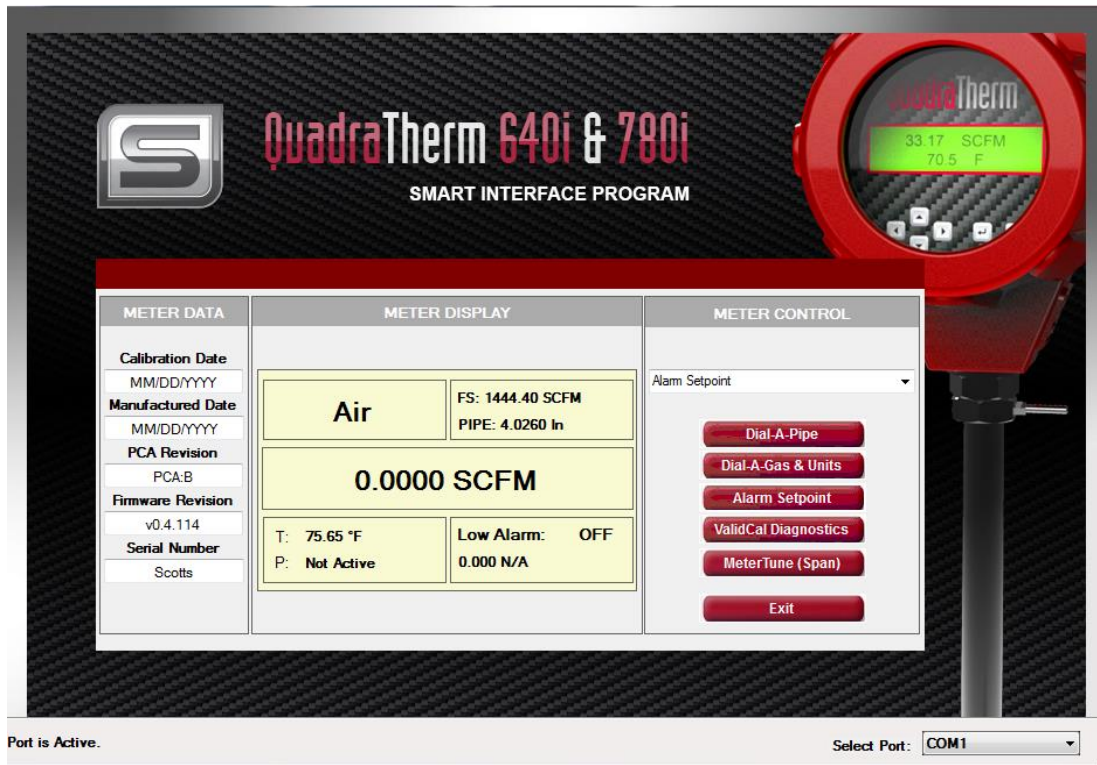

Meter Data

The meter data shows the basic identifying data of the meter hardware, firmware and manufacture date. The calibration date represents the last time the meter was factory calibrated.

METER DATA	
Calibration Date	MM/DD/YYYY
Manufactured Date	MM/DD/YYYY
PCA Revision	PCA:B
Firmware Revision	v0.4.85
Serial Number	12345

Latest PCA and Firmware revisions are posted at www.sierrainstruments.com. The qTherm™ math model is continuously evolving, with new gases added to the library periodically, so check the firmware revision periodically in order to take advantage of these refinements. Factory recalibration is at the discretion of the end user. With Dial-A-Pipe and Dial-A-Gas technology the 640i/780i can be reconfigured to fit into a large variety of applications.

Meter Display

The meter display shows the primary variables (mass flow, temperature, pressure and totalized flow, as well as what gas and pipe have been selected. Both Dial-A-Gas and Dial-A-Pipe are field-configurable, offering unparalleled flexibility. Alarm status is also shown.


METER DISPLAY	
Air	FS: 1444.40 SCFM PIPE: 4.0260 In
0.0000 SCFM 839.44 SCF	
T: 85.68 °F P: Not Active	Low Alarm: ON 10.0000 SCFM

In this example:

- The gas being measured is air
- The calibrated full scale (FS) is 1440.40 SCFM
- The inside diameter of the pipe is 4.0260 Inches
- The meter is currently reading 0.0000 SCFM (there is no flow in the pipe)
- The meter has totalized 839.440 SCFM (there WAS flow in the pipe at some point)
- The temperature is 85.68 °F
- The meter was purchased without the pressure option, so pressure is not active
- The low alarm is set to energize at 10.0000 SCFM
- Since flow is 0.0000 SCFM, the alarm is ON indicating flow is below the 10.000 SCFM set point

Meter Control

A series of quick keys, represented by the red keys, are provided to allow for rapid configuration of application conditions and alarm set-up

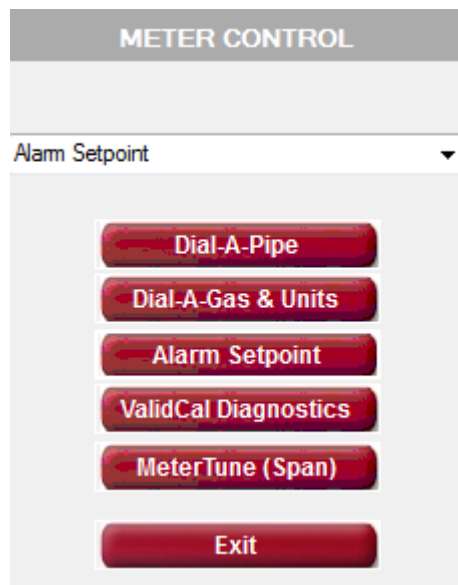

More detailed configuration can also be done using the function selector (in the above example currently showing alarm setpoint)

Quick Keys: Dial-A-Pipe



The Dial-A-Pipe feature makes field configuration very convenient. You must know the type of pipe and either the pipe schedule or the inside diameter.

If inside diameter is known, select the units from the diameter units menu and type in the number in the Inside diameter field.

If the pipe schedule is known, select it from the pipe schedule pull down menu. The inside diameter will then be auto-populated with the correct value (in the units as selected in the Diameter Units drop-down menu). Currently only ANSI schedule 40 is supported but future updates will address other schedules and types.

Finally, use the pipe type pull down menu and select the type.

In the example below we have selected 4-inch ANSI Schedule 40. The program knows this has an inside diameter of 4.0260 inches. We have selected ss-smooth (stainless steel-smooth inside wall) as the closest match to our application.

A screenshot of the Dial-A-Pipe configuration window. At the top, there are two radio buttons: 'English' (selected) and 'Metric'. Below this are four fields with pull-down menus: 'Pipe Schedule' set to '4 Inches ANSI Schedule 40', 'Inside Diameter' set to '4.0260', 'Diameter Units' set to 'Inches', and 'Pipe Type' set to 'Stainless Steel-Smooth'. At the bottom are two buttons: a red 'Save' button and a grey 'Exit' button.

Quick Keys: Dial-A-Gas and Units




As with Dial-A-Pipe, Dial-A-Gas is another powerful feature of the 640i/780i. Simply select the gas to be measured from the pull-down menu. The menu can support 4 different gases and can be updated from Sierra's gas-properties library as new gases and mixtures are added.

The Gas and Units quick key also allows the selection of gas, temperature and pressure units. Simply select the desired units from the pull down menus. If you need other gases in the future, contact the factory and we can download updates from our gas library.

qTherm Gas Library

Selecting qTherm Gas Library from the Dial-A-Gas pull down menu allows users to access Sierra's unique Dial-A-Gas library. Our library is continually growing and expanding. As Sierra calibrates more and more gases with the 640i, we are able to improve the accuracy of our current qTherm gases and add new ones. These new or improved gases are available for download from our qTherm Gas Library, and can then be uploaded into your 640i as a replacement gas for any of the three slots available (remember Air is always in slot 1 and is NOT replaceable).

To start the qTherm gas library, select and save qTherm Gas Library from the drop down menu. This will bring up the following screen:

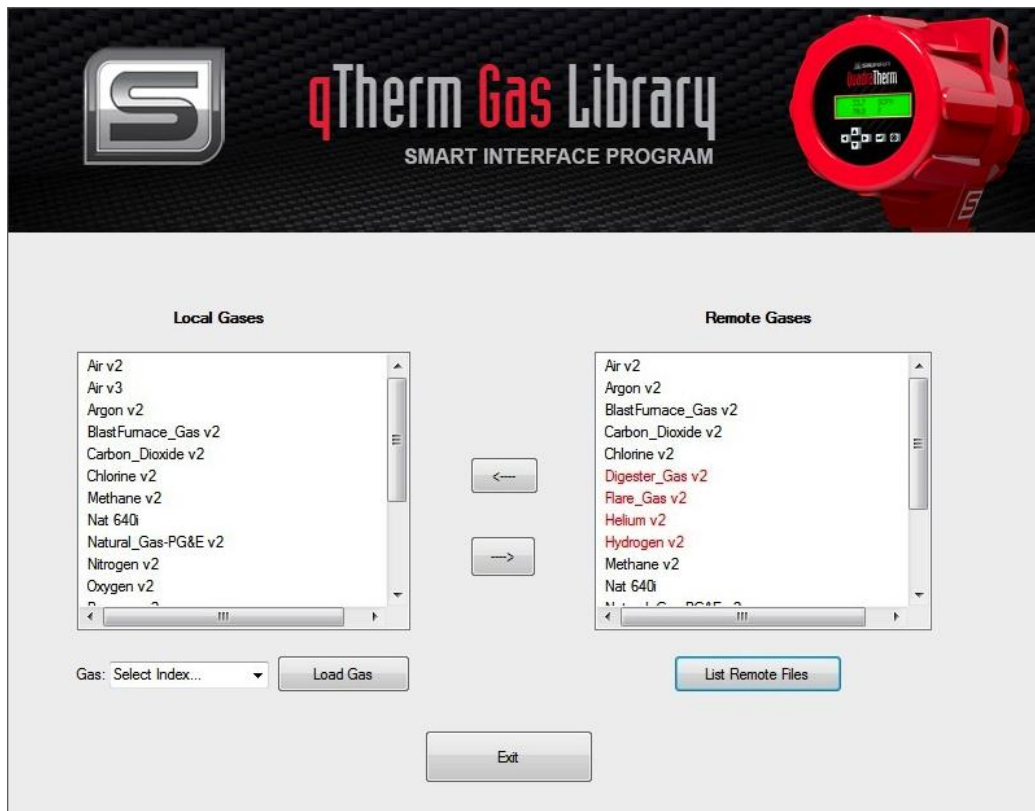

Local Gases

All Gas Files saved on your computer are displayed in the 'Local Gases' window. These are not necessarily the gas files in your meter, but ones you have downloaded from the Sierra Server previously. If you have never done so, this area will be blank.

Most recent version files are saved in c:\sierrainstruments\640i\gas
Older versions are stored in c:\sierrainstruments\640i\gas\archive

Remote Gases

By clicking the 'List Remote Files' button, the Remote Gas window is populated with gas files available for download. You must have an internet connection to connect to the Sierra server. If the gas file is a newer version than a corresponding local file or is not present locally, then it appears in red. Files that are already saved locally are black.


Download Gas File (Arrow Button)

To download a remote gas file, the file is selected in the Remote Gas window and the arrow button is clicked. Once the download is completed, the gas file will appear in the Local Gases window and will no longer appear as red in the Remote gases window.

If a new version of a gas file is downloaded, the older local version is moved into the Archive directory.

Load Gas

To load a gas into one of the 3 available slots (Air is in Slot 1 and cannot be changed), select the gas to be replaced in 'Gas' dropdown on the left and click the 'Load Gas' button, then press load gas. You will see a progress bar indicating the upload status. Upon completion your old qTherm gas will have been replaced!

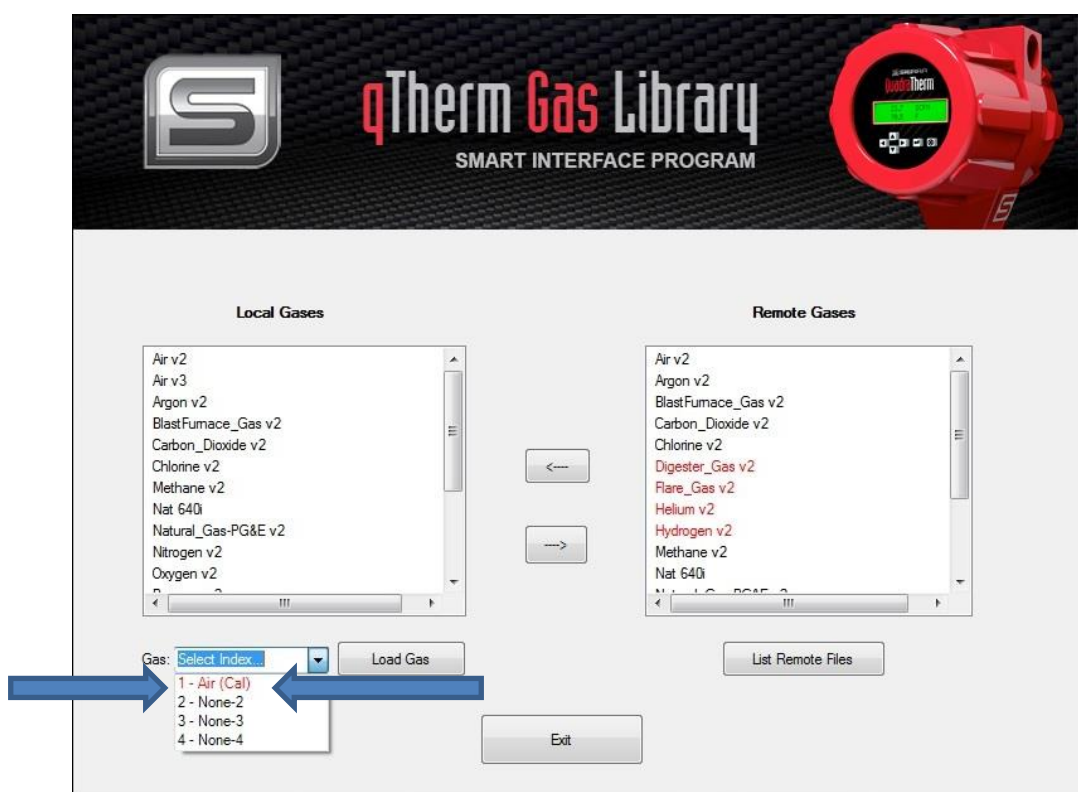

Quick Keys: Alarm Setpoint



Pressing the Alarm Setpoint Quick Key brings up the following details about the alarms:

A screenshot of the 'Alarm Settings' interface. At the top, there are two dropdown menus: 'Active' set to 'Off' and 'Mode' set to 'Low'. Below them, 'Alarm Status' is shown as 'OFF' in a green box. The main section contains four rows of parameters, each with 'Low' and 'High' setpoint inputs and a unit: 'Flow' (10.0000, 0.0000, SCFM), 'Pressure' (N/A, N/A, Not Active), 'Temperature' (70.0000, 80.0000, °F), and 'Totalizer' (0.0000, 0.0000, SCF). At the bottom are 'Save' and 'Exit' buttons. A blue arrow points to the 'Active' dropdown menu.

Only *one* alarm can be active at any time. Use the Active pull down menu to select the active alarm or to turn off the alarm function entirely.

A screenshot of the 'Alarm Settings' interface with the 'Active' dropdown menu open. The menu lists 'Flow', 'Off', 'Pressure', 'Temperature', and 'Totalizer'. 'Flow' is selected and highlighted in blue. A blue arrow points to the 'Active' dropdown menu. Below the menu, the 'Mode' dropdown is also visible, set to 'Flow'. The 'Alarm Status' is 'OFF'. The 'Flow' parameter row shows 'Low' setpoint as 50.0000 and 'High' setpoint as 89.0000.

Once you have selected the active alarm, use the Mode pull down menu to select whether the meter should alarm on low, high or to set an alarm window. A window alarm will turn on once the parameter drops below the low alarm or exceeds the high alarm setpoints, so it serves as a combination low and high alarm (the alarm is off when the active parameter is within the “window”).

Active:	Off		
Mode:	Low		
Alarm Status:	OFF		
	Low	High	
Flow:	10.0000	0.0000	SCFM
Pressure:	N/A	N/A	Not Active
Temperature:	70.0000	100.0000	°F
Totalizer:	0.0000	0.0000	SCF
Save		Exit	

You may now enter the alarm low and high values. To enter, click on the field and type in the numeric values for the desired alarm. Hit save and the entered value will be written into memory.


In the example above, flow is selected as the Active alarm. We have indicated we want the alarm to activate in Low Flow mode, and we want the alarm to activate at 10.0000. The units as set up in the units menu are in SCFM, so once flow drops below 10.000 SCFM we should see an alarm condition.

Quick Keys: ValidCal™ Diagnostics



ValidCal™ Diagnostics is a complete meter diagnostics suite. It tests all analog outputs, relays and primary variable measurements.

ValidCal™ Diagnostics is designed to be performed in AIR under ambient conditions (room temperature and pressure) It must be performed under ***no flow*** conditions. The meter must be removed from the pipe if possible, and the Sierra end cap placed over the sensor. The test may be performed in the pipe provided these same conditions are met while the probe tip is inside the pipe.

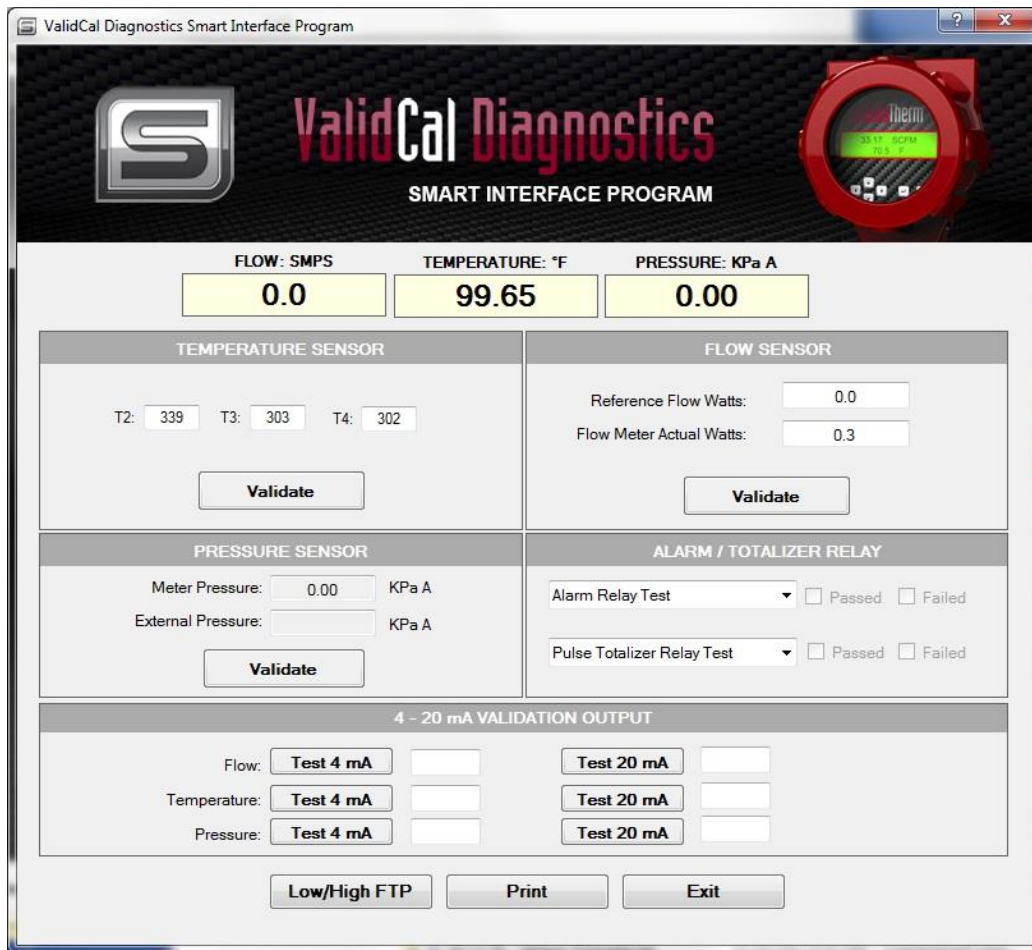


If any of the tests fail, follow the troubleshooting tips below and the more general ones contained in chapter four of this manual.


4-20 mA Output Validations

The 4-20 mA output validation allows users to force a 4 or 20 mA output on all three analog outputs. To test:

Hook a DVM (select DC current) to the +/- terminals of the output you are validating:

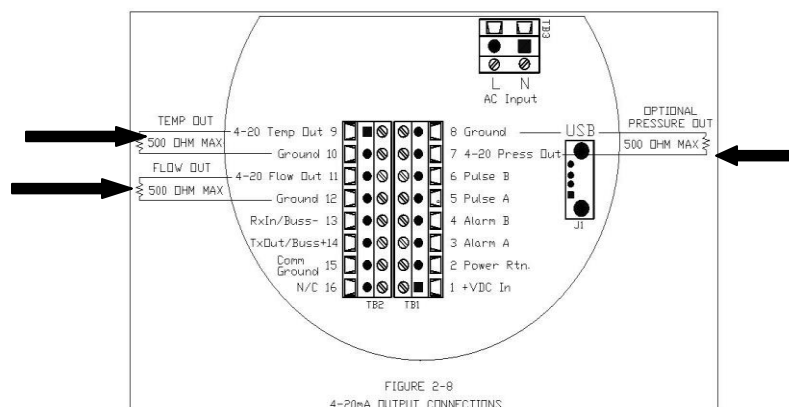

Press Test 4 mA and enter the value from your DVM (should be around 4.000 mA)

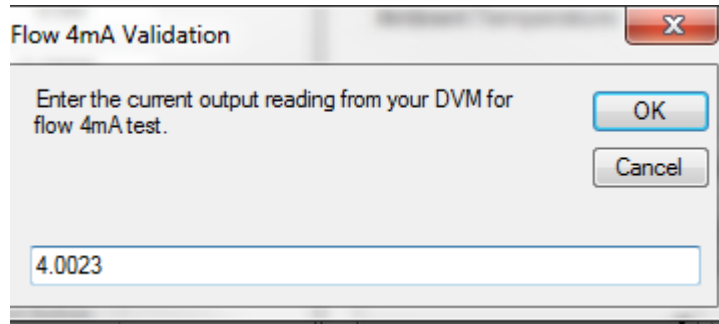

A dialog box titled "Flow 4mA Validation" with a close button (X) in the top right corner. The main text inside says "Enter the current output reading from your DVM for flow 4mA test." Below this text is a text input field containing the value "4.0023". To the right of the input field are two buttons: "OK" and "Cancel".


The program will show passed provided the reading is within tolerance. If it shows failed, please contact the factory for assistance. Repeat this procedure for all remaining 4- 20 mA tests. The most common failure is that the 4- 20 mA wires have become loose or that the DVM is incorrectly set up (must be set up for measuring direct DC current in the mA range).

The 4 to 20 mA DAQ conts may be adjusted by going to the "Flow, Pressure and Temperature 4- 20mA Output Range Setup" in the function selector.

Flow Sensor Validation


This routine tests the flow sensor and sensor drive circuitry by measuring the Watts required to heat the velocity sensor to a value of 50°C above the current temperature of the sensor.

The reference flow Watts is the watts required at the time of calibration to attain this 50°C *overheat*. Barring damage or drift, this value should remain relatively constant over time.

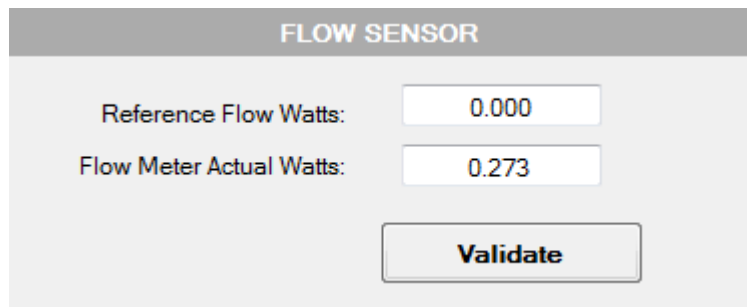

A screen titled "FLOW SENSOR" with a grey header. Below the header, there are two rows of labels and input fields. The first row is "Reference Flow Watts:" followed by an input field containing "0.000". The second row is "Flow Meter Actual Watts:" followed by an input field containing "0.273". Below these two rows is a button labeled "Validate".


Selecting validate Flow will bring up the following screen:

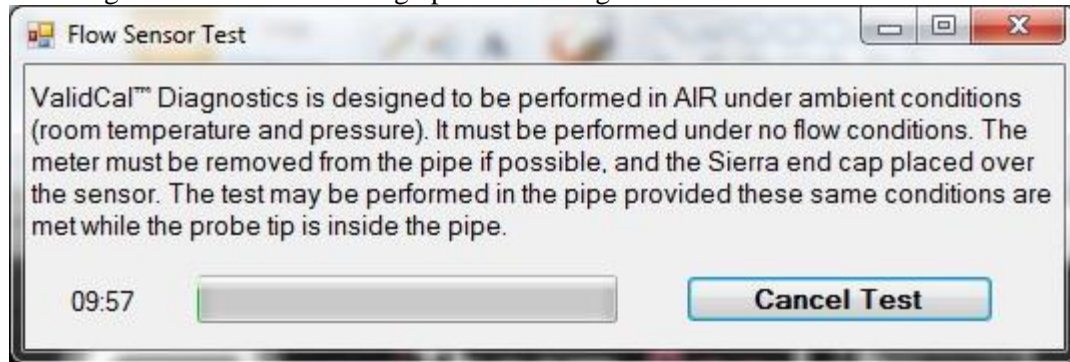

The test will automatically begin. Look at actual temperature. It will begin increasing as watts are added to the flow sensor, heating it up to 50 °C (122 °F). Once this temperature reaches set point, the test will complete itself, usually within 5 minutes. If the Reference Flow is within tolerance of actual flow, the meter will pass validation. If the test fails, ensure you have allowed adequate time for the sensor to cool down before starting the test, that the probe tip is covered and that you began the test with no flow present and at room temperature and pressure. True sensor failures are rare and will be covered by Sierra's lifetime sensor warranty.

Temperature Validation

This routine checks the QuadraTherm gas temperature sensors (T2, T3 and T4). Select Validate Temperature, then Enter the temperature in the pipe as read by another device (not the Sierra flow meter) in the pop-up window. The readings should be roughly the same. Note it can take up to 20 minutes for the probe tip to cool to the surrounding temperature once it has been removed from the pipe. This is the most common "failure". Allow the probe tip to cool and repeat the test.

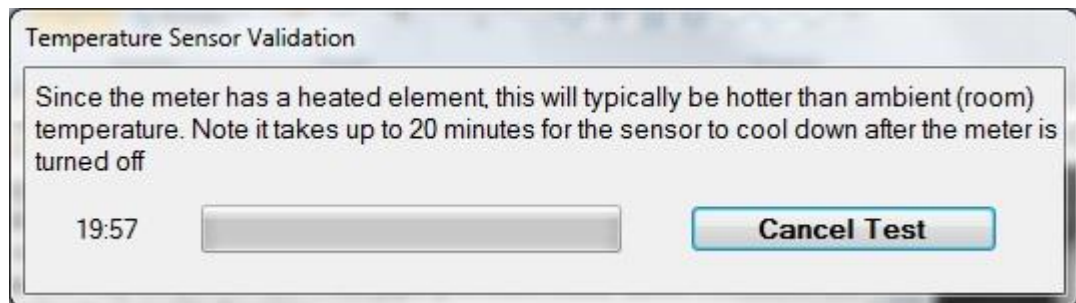

Pressure Validation

This routine validates the gas pressure sensor. Select validate pressure, then enter the pressure in the pipe or test area as read by another device (not the Sierra flow meter) in the pop-up window. The readings should be roughly the same. If there is no pressure transducer, the Screen will appear as below.

PRESSURE

XDCR Pressure: Not Active

Ambient Barometric Pressure: N/A

Validate

The typical failure for a pressure transducer is if it has been over pressurized and the pressure sensor membrane has burst. Your pressure transducer has a burst pressure of 5 times its operational rating. For example, an MP2 100 psia sensor has a burst pressure of 500 psia.

Alarm/Totalizer Relay Validation

This routine tests the Alarm and Totalizer relays.


ALARM / TOTALIZER RELAY

Alarm Relay Test ☐ Passed ☐ Failed


Pulse Totalizer Relay Test ☐ Passed ☐ Failed

Test Alarm Relay

Hook up a DVM as shown:

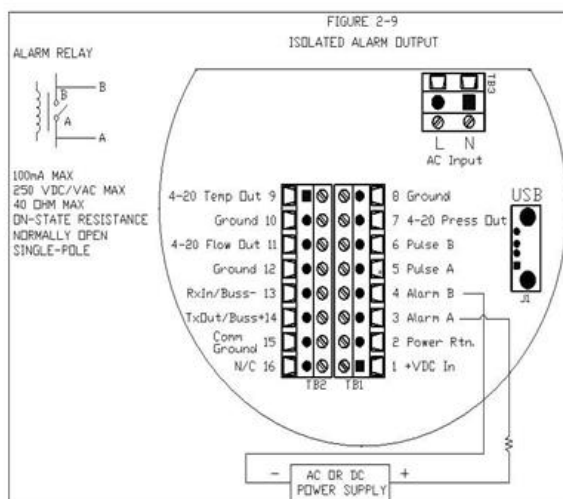


Use the pull down menu to select relay Open and close and use your DVM to check the relay.

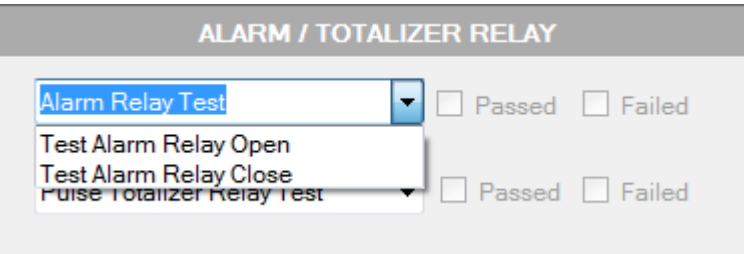


Test Totalizer Relay

Hook up DVM s shown:

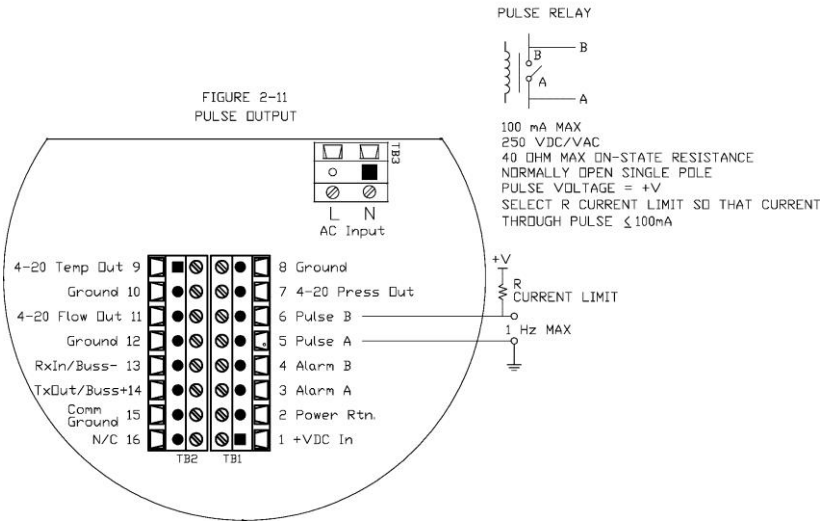


Open and close the relay and use your DVM to check the relay.

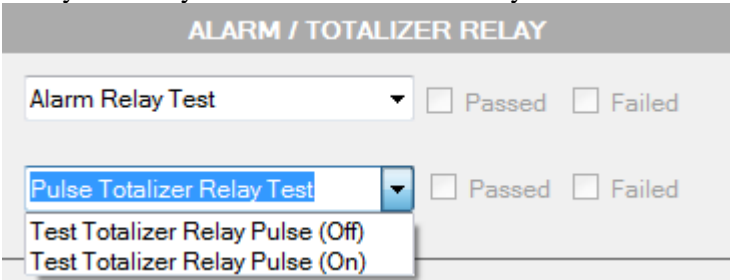

Low/High FTP

Pressing the Low/High FTP button (located at the bottom left of the main ValiCal screen brings up the following data screen. It shows the lowest and highest flow, temperature and pressure the meter has experienced since the last reset. This information is valuable in documenting events that might have caused meter damage, such as blowing out the pressure transducer or severely overheating the sensor.

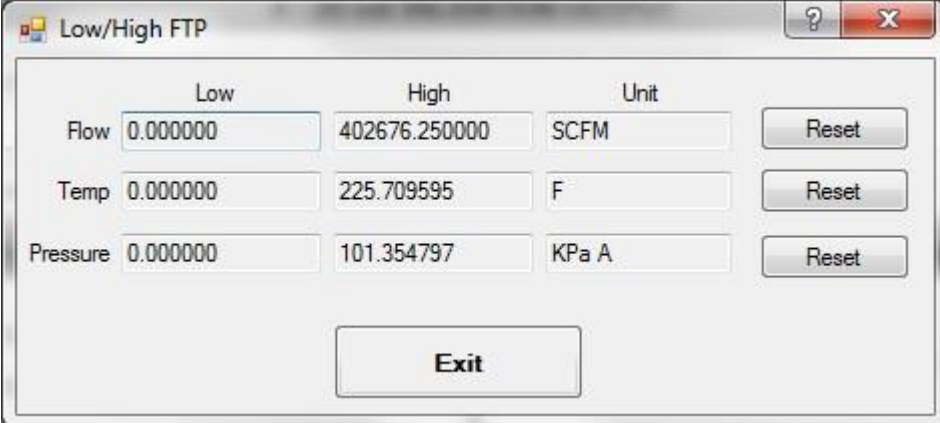


The screenshot shows a window titled "Low/High FTP" with a standard Windows-style title bar (minimize, maximize, close buttons). The window contains a table of data with three columns: "Low", "High", and "Unit". There are three rows of data: "Flow", "Temp", and "Pressure". Each row has two input fields for the "Low" and "High" values, a dropdown for the "Unit", and a "Reset" button. The "Flow" row shows "0.000000" for Low, "402676.250000" for High, and "SCFM" for Unit. The "Temp" row shows "0.000000" for Low, "225.709595" for High, and "F" for Unit. The "Pressure" row shows "0.000000" for Low, "101.354797" for High, and "KPa A" for Unit. At the bottom center of the window is a large "Exit" button.

	Low	High	Unit	
Flow	0.000000	402676.250000	SCFM	Reset
Temp	0.000000	225.709595	F	Reset
Pressure	0.000000	101.354797	KPa A	Reset

Exit

Quick Keys: Meter Tune (Span)

Meter Tune (Span Adjust) allows you to fine tune your meter reading to match other devices or expectations. Simply enter the reading from the other device and the meter span will be auto adjusted to make the readings the same.

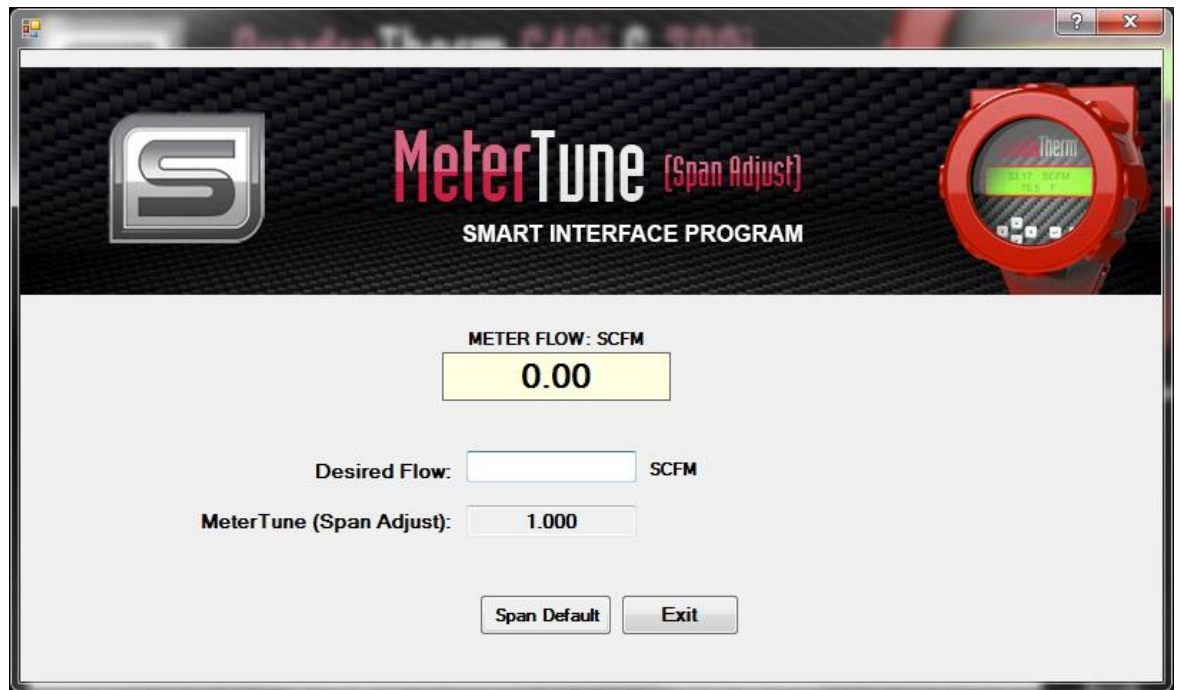


Quick Keys: Exit

Exit will immediately close the program. Any unsaved data will be lost.

Function Selector

The function selector does all of the same things the quick keys do, while giving deeper access to some functions. To operate the selector, pick the desired function from the drop-down menu and hit enter or left click.

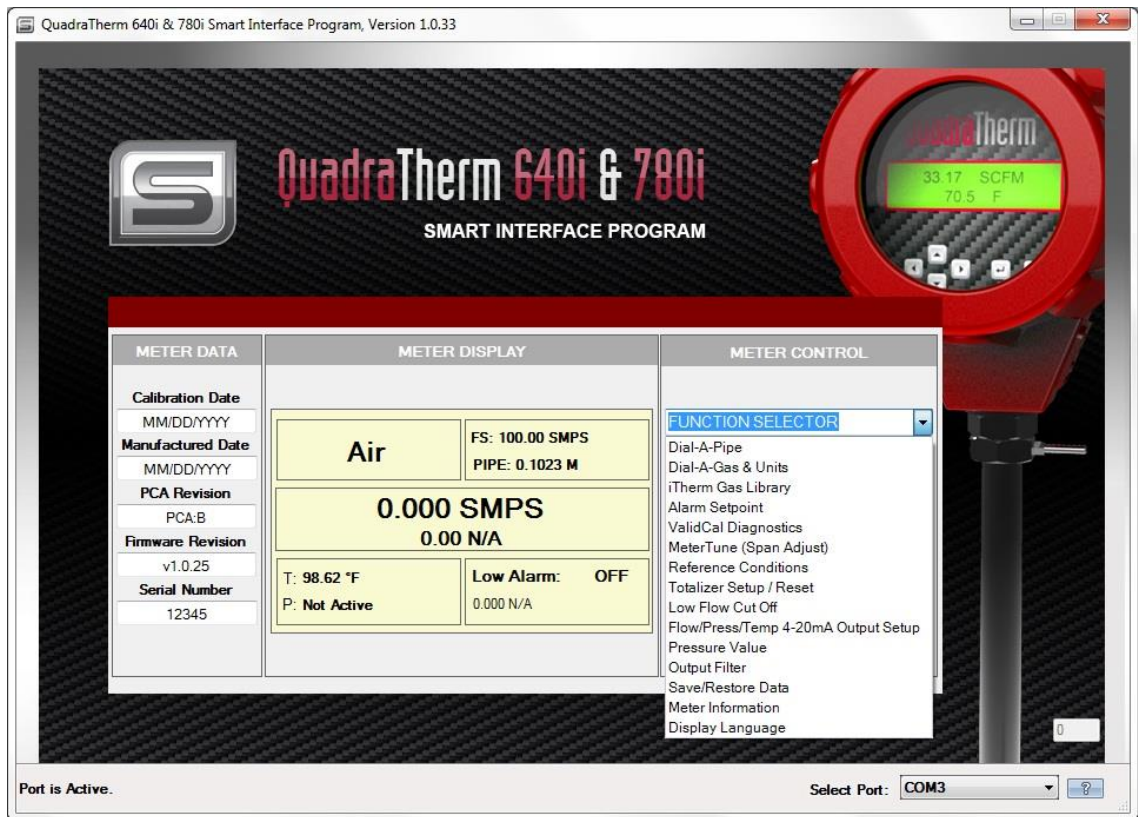

Dial-A-Pipe

See Dial-A-Pipe Quick Key Description

Dial-A-Gas and Units

See Dial-A-Gas Quick Key Description

qTherm Gas Library

See qTherm Gas Library information on page 66

Alarm Setpoint

See Alarm Setpoint Quick Key Description

ValidCal Diagnostics

See ValidCal Quick Key Description


MeterTune (Span Adjust)

See MeterTune Quick Key Description

Reference Conditions

This function allows the user to enter the normal and standard temperatures and pressures to

which gas MASS flows are referenced. Typically this is 70°F and 1 atmosphere in the USA (f.i. standard conditions as used in scfm: standard cubic feet per minute) or 0°C and 1 atmosphere in Europe (f.i. normal conditions as used in nlpm: normal liters per minute).

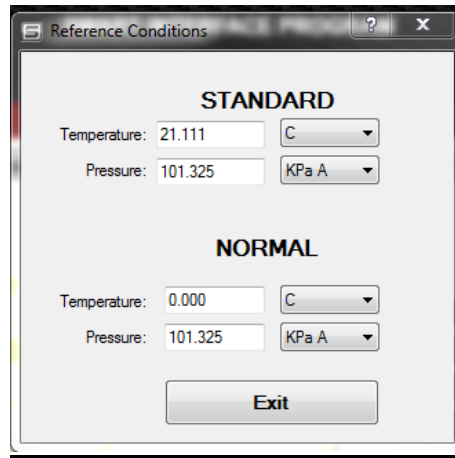A screenshot of a software dialog box titled "Reference Conditions". It contains two sections: "STANDARD" and "NORMAL". Each section has input fields for "Temperature" and "Pressure", and a unit selection dropdown menu. In the "STANDARD" section, Temperature is 21.111 and Pressure is 101.325. In the "NORMAL" section, Temperature is 0.000 and Pressure is 101.325. Both unit dropdowns are set to "C" for temperature and "KPa A" for pressure. An "Exit" button is located at the bottom of the dialog.

Totalizer Setup/Reset

If units are not mass flow, it will not turn on. The totalizer will totalize accumulated flow if it is turned *on*. Turn it on or off with the Totalizer Status drop down menu.

NOTE: The totalizer operates at a maximum frequency of 1HZ (1 pulse per second). This limits the maximum units per pulse.

For example, you have a flow of 60 scfm with a units-per-pulse set to 1 SCF This means 1 pulse per second or 1 Hz. This is within the ability of the totalizer.

Reducing the flow to 30 scfm means the totalizer will pulse once every two seconds. Again this is OK.

Increasing the flow to 120 scfm means the totalizer would pulse once every 0.5 sec, but this is too fast.

The totalizer will not count (all the pulses will run together).

This puts a limit on the resolution of the totalizer at higher flows. You must convert the flow to units per second and ensure this number is equal to or bigger than one.


The pulse itself is a negative going square wave pulse. The duration of the pulse can be set with the pulse width pull down menu.



Low Flow Cut Off Value

Due to thermal gradients, movement of gas molecules in the pipe can occur even with all valves shut. The Zero Cut Off forces both analog and digital outputs to zero at a percentage of the full scale. The Zero Cut off can be set to from 0 to 10.00% FS (full scale), meaning anytime the measured flow drops below this value the analog and digital outputs will be forced to zero. Totalization will not occur.

Full scale is the maximum flow rate for which the meter was calibrated. Exceeding it will not damage the meter, but flow readings will not be accurate. The calibrated full scale is found in the calibration menu.

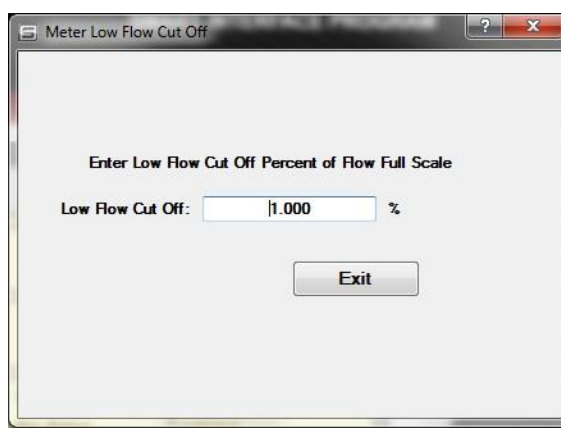

Flow/Pressure/Temperature 4 – 20 mA Output Setup

This function allows you to set up the analog outputs. The 640i and 780i comes standard with linear 4-20 mA analog outputs for flow and temperature. If the meter is orders with pressure, a third analog output for pressure is available. For flow, 4 mA is always = 0 flow. The user may select 20 mA to equal any value up to the calibrated full scale. Full scale is the maximum flow rate

for which the meter was calibrated. Exceeding it will not damage the meter, but flow readings will not be accurate. The calibrated full scale is found in the calibration menu. Note the meter will still read digital flow values up to the calibrated full scale, but analog outputs will be scaled per the user settings.

The image shows two calibration screens. The top screen, titled "4 - 20 mA OUTPUT RANGE", displays current output values for Flow (0.000 to 1444.40 SCFM), Temperature (32.00 to 212.00 °F), and Pressure (N/A). The bottom screen, titled "4 - 20 mA ADJUSTMENTS", shows DAQ counts for the same parameters (Flow: 11340, Temperature: 11340, Pressure: N/A) and includes "Test 4 mA" and "Test 20 mA" buttons for each. Both screens have "Save" and "Exit" buttons at the bottom.

Pressure and temperature may be scaled as the user desires.

All units are as set in the units menu. The 4 and 20 mA analog outputs can be adjusted by adjusting the DAQ counts until 4 or 20 mA is observed. For example if the flow 4 mA output is actually reading 3.98 mA, adjust the DAQ counts up from 1130 and press test and repeat until the readings has increased to 4.00 mA,

Pressure Math Value

This is the pressure used by the qTherm math to calculate gas properties. This makes gas properties calculations more accurate.

The image shows a "Pressure Math" dialog box with a title bar containing a close button. Inside, the unit "Psig" is displayed above a text field containing "40.0000". Below the text field are "Save" and "Exit" buttons.

Save/Restore Data


This screen allows users to:

- Save any new data
- Restore the meter to factory default (undoing any changes)
- Reboot (restart) the meter




Meter Information

User information allows you to view data about the meter and to customize some aspects of it.

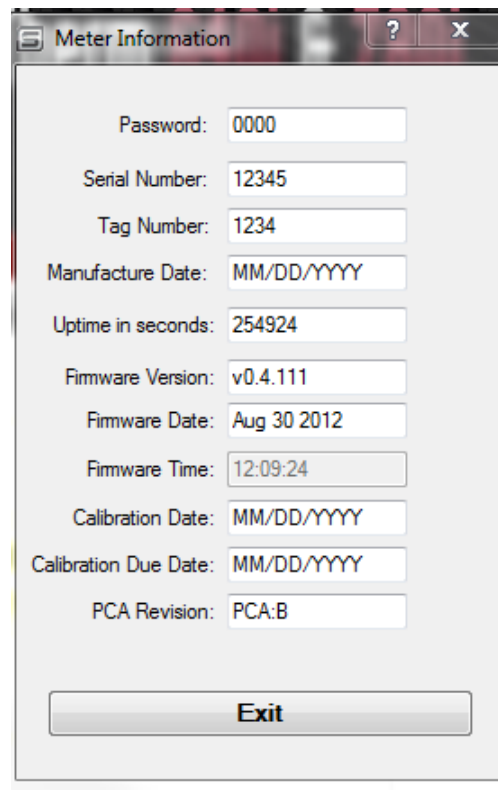

Display Language

Sierra’s qTherm Language Library is continually updated as our meter firmware is translated into other languages. These languages can be downloaded from the Sierra server.

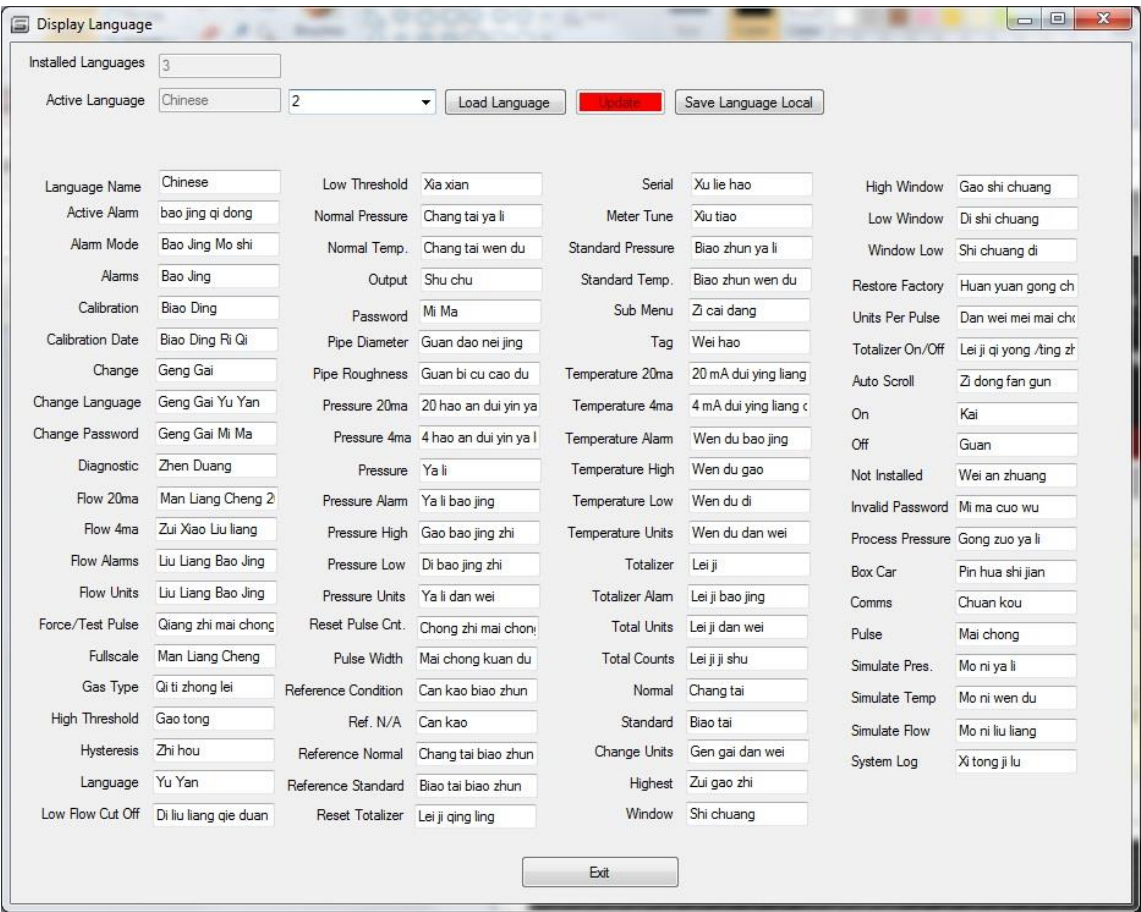

Local Languages

All Language Files saved to on your computer are displayed in the ‘Local Languages’ window. Most recent version files are saved in {Application Directory}\640i\lang. Older versions are stored in {Application Directory}\640i\lang\archive.

Remote Languages


By clicking the ‘List Remote Files’ button, the Remote Languages window is populated with language files available for download. You must be hooked up to the internet so you can download these files from the Sierra Server. If the language file is a newer version than a corresponding local file or is not present locally, then it appears in red. Files that are already saved locally are black.

Download Language File (Arrow Button)

To download a remote language file, the file is selected in the Remote Language window and the arrow button is clicked. Once the download is completed, the language file will appear in the Local Languages window and will no longer appear as red in the Remote Languages window. If a new version of a language file is downloaded, the older local version is moved into the Archive directory.

Load Language

Three language slots are available. To upload a new language to the meter, select the language you want to replace from the drop down menu, then select the language to upload from the local languages list, then press load Language. The language is uploaded to the meter and is available for use.

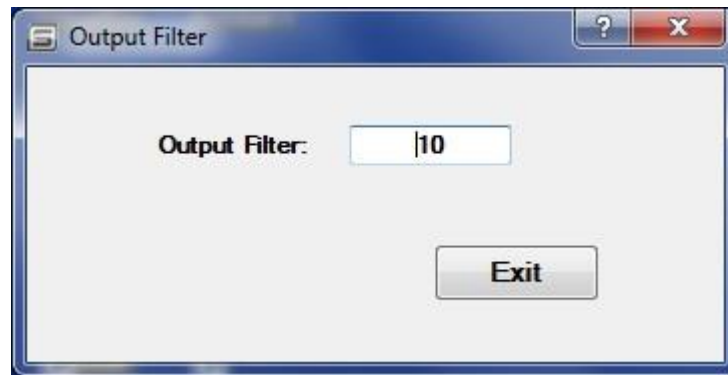

Appendix C: Flow Totalizer Feature

Flow Totalizer

Empower Your Flow Meter to Do More...

This flow totalizer feature is FREE to all QuadraTherm® 640i/780i customers. This feature is included in your Smart Interface Program (SIP) software.

Watch “How it Works” Video: <http://www.sierrainstruments.com/library/videos/multigas-flow-totalizer>.

Key Customer Benefits

With the totalizer feature, end-users can now perform the following (see Figure 1):

- View the totalized value of multiple gases
- Totalize up to four gases with one device and software package
- Set units per pulse and pulse width
- Turn totalizers on/off
- Reset totalizer

How to Get the Flow Totalizer

New Customers: Starting September 3, 2013 (firmware 1.0.74 or higher), all 640i/780i products include the totalization feature on the Smart Interface Program (SIP) Software. This feature is FREE of charge.

Existing Customers: Flowmeters shipped prior to September 3, 2013 (firmware 1.0.73 or lower) will need to send their meters back to the factory for a FREE firmware upgrade which activates the feature. Please return instrument to Sierra via the [Return Materials Authorization \(RMA\)](#) process.

Overview of Flow Totalizer Features

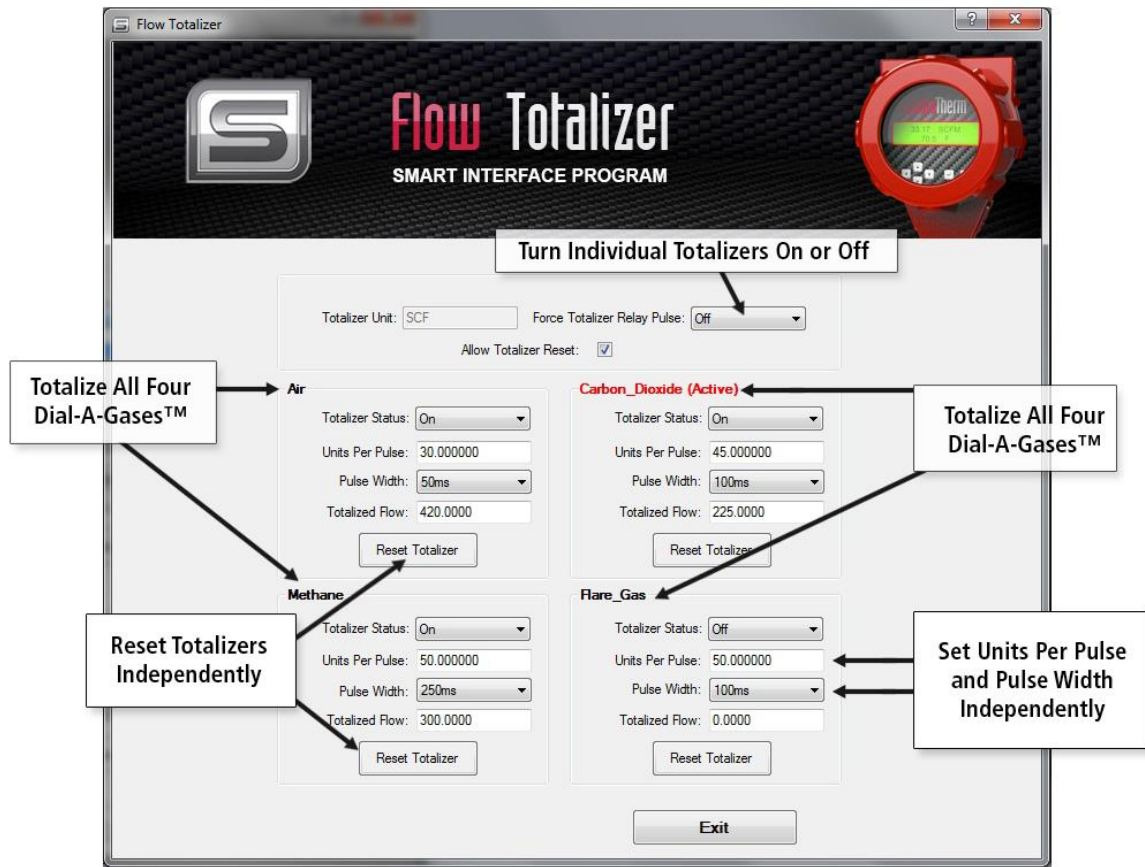


Figure 1. Flow Totalizer User Interface

Turn Totalizers On/Off, Test or Reset

Totalize accumulated flow for each of four loaded gases loaded into the instrument. The totalizer for each gas can be activated or reset independently of the others. Each gas also has its own value for pulse width and units per pulse. All totalizer counts are displayed in the current active flow units.

In Figure 2, the current active flow units are displayed at the top left. At the top right, there is a drop down menu for testing the totalizer relay. The totalizer of the active gas slot will accumulate flow if it is turned on. This is accomplished by using the Totalizer Status drop down menu.

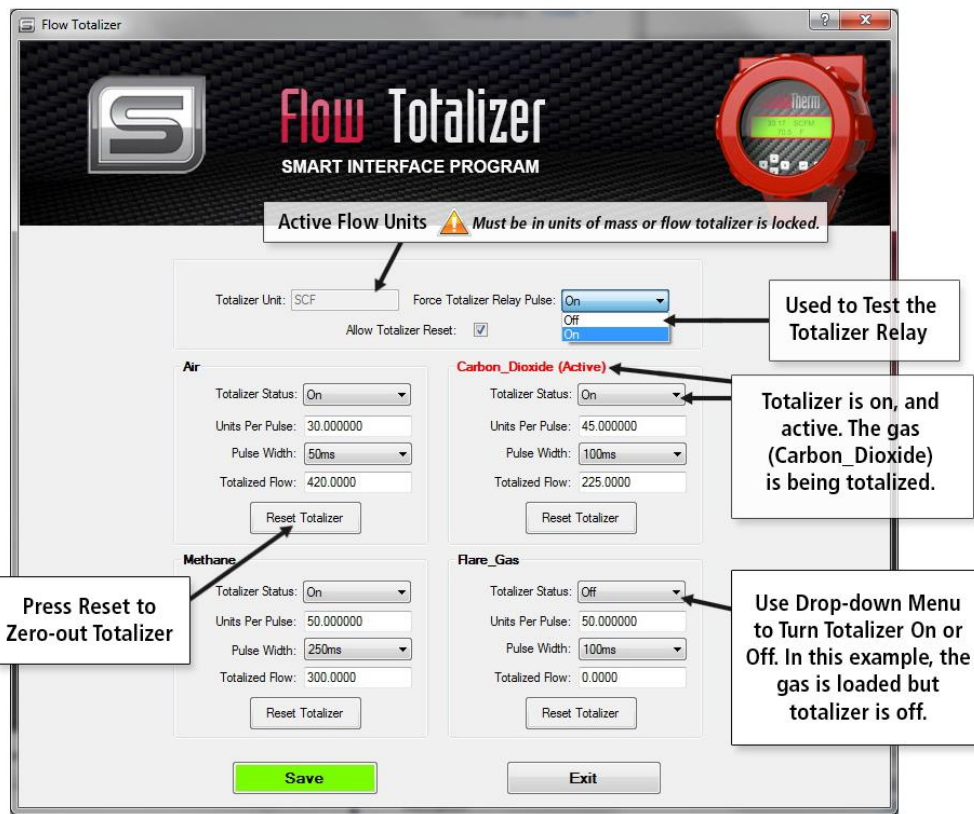


Figure 2. Turn Totalizers On/Off, Test and Reset

	<p>NOTE If units are not mass flow, this menu is locked.</p>
--	---

Set Units Per Pulse and Pulse Width

Each totalizer can use a different unit per pulse and pulse width. The unit per pulse is the mass of the active gas that must accumulate before the meter generates a pulse. It will be in the mass units selected in the units menu. The pulse width is the amount of time the pulse lasts. It is selectable from a pull down menu. A typical pulse configuration is shown in Figure 3.

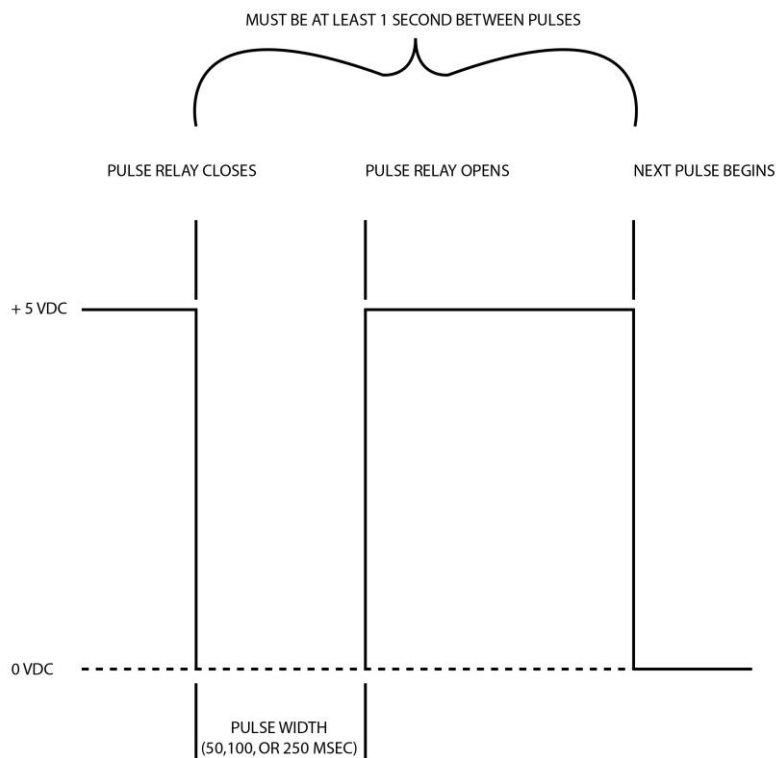


Figure 3. Typical Pulse Configuration

Each totalizer operates at a maximum frequency of 1Hz (1 pulse per second). This limits the maximum units per pulse. For example, if you have a flow of 60 scfm with a units-per-pulse set to 1 SCF. This means there is 1 pulse per second or 1 Hz. This is within the limits of the totalizer. A reduction in flow to 30 scfm means the totalizer will pulse once every two seconds. This is also within the limits of the totalizer.

However, an increase in flow to 120 scfm means the totalizer would pulse once every 0.5 sec. This is too rapid and outside the limits of the totalizer. The result is that the totalizer will not count properly (all the pulses will run together). This demonstrates a limit on the resolution of the totalizer at higher flows. You must convert the flow to units per second and ensure this number is greater than or equal to one. To set your Units Per Pulse and Pulse Width, see Figure 4.

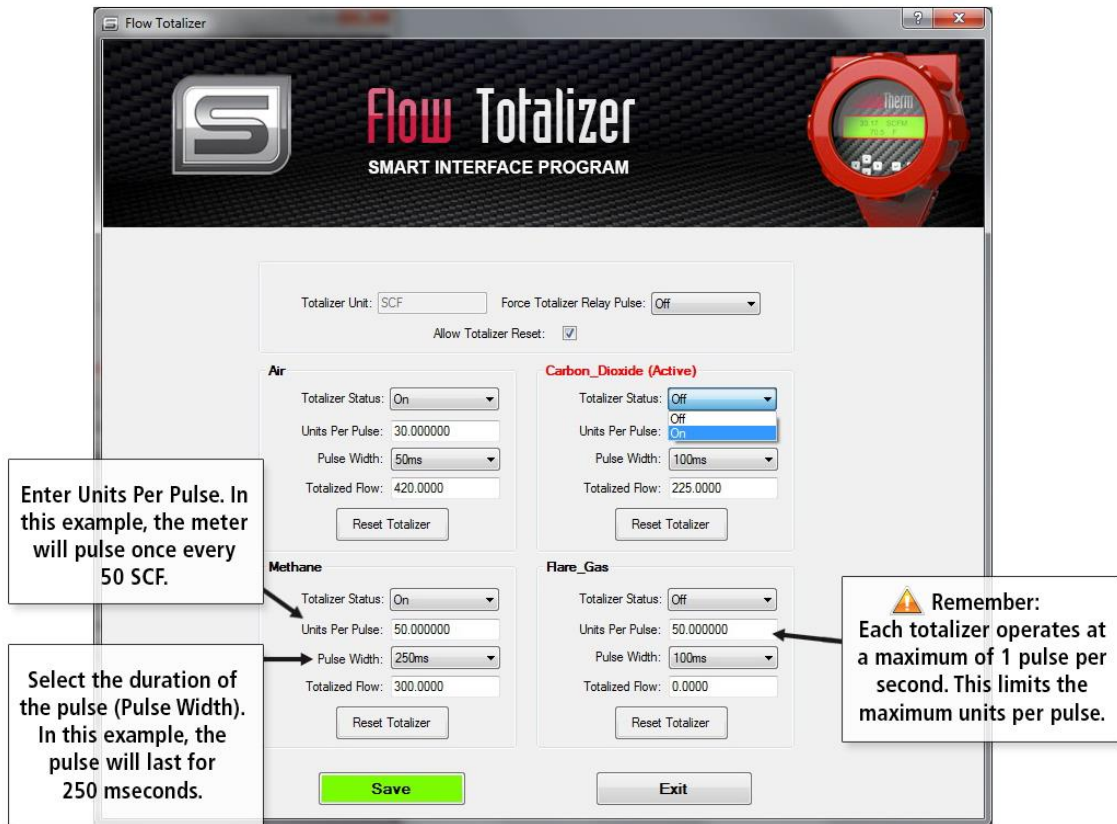


Figure 4. Setting Units Per Pulse and Pulse Width

	<p>NOTE Each totalizer operates at a maximum frequency of 1 Hz (1 pulse per second). This limits the maximum units per pulse.</p>
--	--

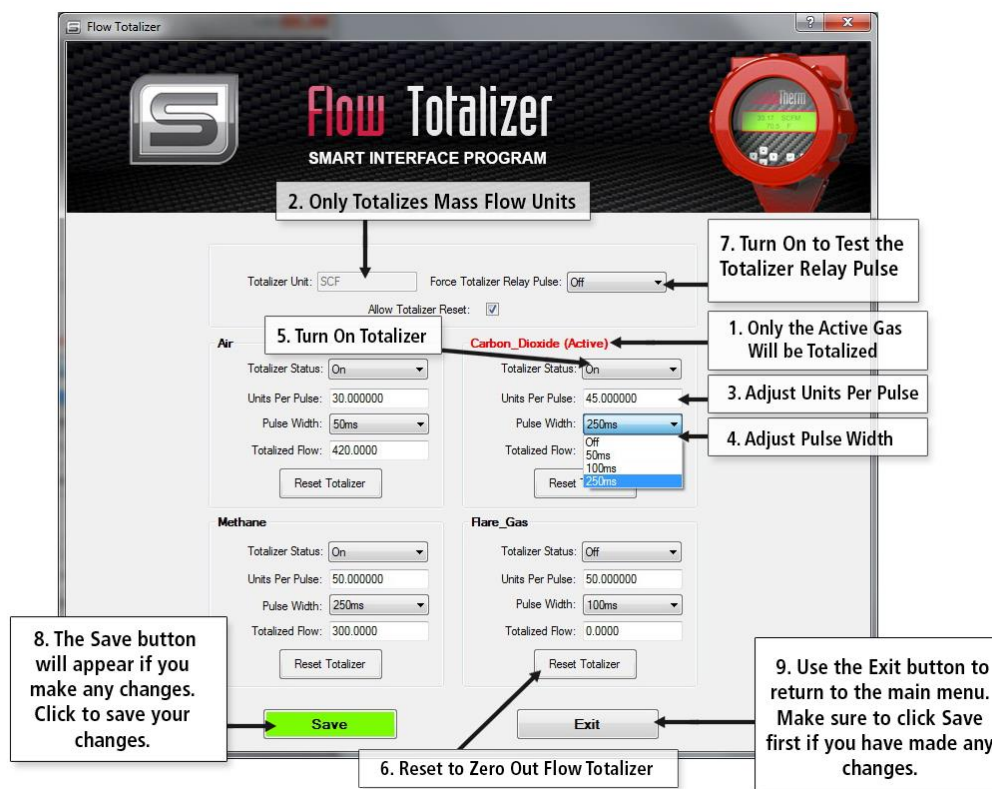


Figure 5. Setting Up a Gas to Totalize

Summary: Setting Up A Gas To Totalize (see Figure 5)

1. Only the active gas will be totalized. The active gas is selected from the Dial-A-Gas menu in the previous screen and cannot be changed from this screen.
2. Totalizer units are in the mass units as selected in the unit menu and cannot be changed from this screen.
3. For the gas you intend to totalize, adjust the Units Per Pulse to the desired value. This value determines how much flow is totalized with each pulse.
4. For the gas you intend to totalize, adjust the Pulse Width to the desired value. This value determines the interval of the pulse.
5. For the gas you intend to totalize, set the Totalizer Status to On and click the Save button. As flow accumulates, the value is displayed as Totalized Flow.
6. To zero out the flow totalizer for your intended gas and restart, click the Reset Totalizer button for that gas.

7. To test the totalizer relay pulse, set Force Totalizer Relay Pulse to On and click the Save button. Return to Off position when you wish to end the pulse testing.
8. Save your changes.
9. Use the Exit button to return to the main menu.