# BioTrak 6455/7455

Thermal Mass Flow Meter for Biogases

## **Instruction Manual**

Document: S-IM-645S/745S Rev C\_PN 109629



#### **GLOBAL SUPPORT LOCATIONS: WE ARE HERE TO HELP!**

For Global Service Centers, go to http://www.sierrainstruments.com/facilities.html

#### **CORPORATE HEADQUARTERS**

5 Harris Court, Building L Monterey, CA 93940 Phone (831) 373-0200 (800) 866-0200 Fax (831) 373-4402 info@sierrainstruments.com www.sierrainstruments.com

#### **EUROPE HEADQUARTERS**

Bijlmansweid 2 1934RE Egmond aan den Hoef The Netherlands Phone +31 72 5071400 Fax +31 72 5071401 sales@sierrainstruments.nl

#### **ASIA HEADQUARTERS**

Second Floor Building 5, Senpu Industrial Park 25 Hangdu Road Hangtou Town Pu Dong New District, Shanghai, P.R. China Postal Code 201316 Phone: + 8621 5879 8521 Fax: +8621 5879 8586

#### © COPYRIGHT SIERRA INSTRUMENTS 2022

No part of this publication may be copied or distributed, transmitted, transcribed, stored in a retrieval system, or translated into any human or computer language, in any form or by any means, electronic, mechanical, manual, or otherwise, or disclosed to third parties without the express written permission of Sierra Instruments. The information contained in this manual is subject to change without notice.

#### **TRADEMARKS**

BioTrak™, BioCal™, BioSelect™, FlowTrak™, BioView™, and DigiSense™ are trademarks of Sierra Instruments, Inc. Other product and company names listed in this manual are trademarks or trade names of their respective manufacturers.

# **Warnings and Cautions**

#### **General Safety Information**

We use caution and warning statements throughout this book to draw your attention to important information.

Symbol Key					
Symbol Symbol Meaning		Description			
	Warning	This statement appears with information that is important to protect people and equipment from damage. Pay very close attention to all warnings that apply to your application.			
0	Caution/Note	This statement appears with information that is important for protecting your equipment's performance. Read and follow all cautions that apply to your application.			

# WARNING

- Warning! Agency approval for hazardous location installations varies between flow meter models. Consult the flow meter nameplate for specific flow meter approvals before any hazardous location installation.
- Warning! Hot tapping must be performed by a trained professional. U.S. regulations often require a hot tap permit. The manufacturer of the hot tap equipment and/or the contractor performing the hot tap is responsible for providing proof of such a permit
- Warning! All wiring procedures must be performed with the power Off.
- Warning! To avoid potential electric shock, follow National Electric Code safety practices or your local code when wiring this unit to a power source and to peripheral devices. Failure to do so could result in injury or death. All AC power connections must be in accordance with published CE directives.
- Warning! Before attempting any flow meter repair, verify that the line is de-pressurized.
- Warning! Always remove main power before disassembling any part of the mass flow meter.

# 0

#### CAUTION

- Caution! Before making adjustments to the 645S/745S, verify the flow meter is not actively monitoring or reporting to any master control system. Adjustments to the electronics will cause direct changes to flow control settings.
- Caution! All flow meter connections, isolation valves and fittings for hot tapping must have the same or higher pressure rating as the main pipeline.
- Caution! The flow meter electronics and sensor probe have been manufactured and calibrated to operate as a unit. The flow meter will not operate properly if parts are replaced from another meter.
- Caution! Printed circuit boards are sensitive to electrostatic discharge. To avoid damaging the board, follow these precautions to minimize the risk of damage:
  - before handling the assembly, discharge your body by touching a grounded, metal object
  - handle all cards by their edges unless otherwise required
  - when possible, use grounded electrostatic discharge wrist straps when handling sensitive components

Disclaimer

#### **Receipt of System Components**

When receiving a Sierra mass flow meter, carefully check the outside packing carton for damage incurred in shipment. If the carton is damaged, notify the local carrier and submit a report to the factory or distributor. Remove the packing slip and check that all ordered components are present. Make sure any spare parts or accessories are not discarded with the packing material. Do not return any equipment to the factory without first contacting Sierra Customer Service.

#### **Technical Assistance**

If you encounter a problem with your flow meter, review the configuration information for each step of the installation, operation, and setup procedures. Verify that your settings and adjustments are consistent with factory recommendations. Installation and troubleshooting information can be found in the Chapter 2 (Installation) and Chapter 6 (Troubleshooting) of this manual.

If the problem persists after following the troubleshooting procedures outlined in Chapter 6 of this manual, contact Sierra Instruments by e-mail (see inside front cover). For urgent phone support you may call (831) 373-0200 between 8:00 a.m. and 5:00 p.m. PST. In Europe, contact Sierra Instruments Europe at +31 72 5071400. In the Asia-Pacific region, contact Sierra Instruments Asia at +8621 5879 8521. When contacting Technical Support, make sure to include this information:

- The serial number (marked on the meters label)
- The firmware version (visible on the display at startup)
- The problem you are encountering and any corrective action taken
- Application information (flow range, gas, pressure, temperature and piping configuration)

#### **Using This Manual**

This manual provides information needed to install and operate the Series BioTrak 645S/745S Mass Flow Meter.

#### **Additional Resources**

Visit <u>Sierrainstruments.com</u> for additional resources. Note: the most current versions of the 645S/745S documents can be found at https://www.sierrainstruments.com/products/downloads.html.

# Table of Contents

1. Introduction	Pages 9-21
a. Quick Start Guide	p. 9
b. Menu Trees	p. 11
c. General	p. 19
2. Installation (Mechanical)	Pages 21-33
a. Lateral Placement	p. 23
b. Welding Branch Outlet to Pipe (Insertion)	p. 25
c. Installation Depth	p. 26
d. Orientation	p. 28
e. Mounting Instructions	p. 27
f. Retractor Installation	p. 31
3. Wiring (Electrical)	Pages 34-43
a. Wiring Access	p. 35
b. Input Power	p. 36
c. Signal Wiring and HART Communication Option	p. 37
d. Pulse/Alarm Wiring (optional feature)	p. 40
e. RS485 Wiring: Modbus RTU	p. 42
f. HART Handheld Wiring	p. 44
4. Operation (Standard Operation)	Pages 45-68
a. Start Up	p. 45
b. Programming	p. 48
c. BioCal™	p. 63
d. BioSelect <sup>TM</sup>	p. 65
5. Communication Protocols	Pages 69-83
a. Modbus RTU (RS485).	p. 69
C HART	n 91

## **Table of Contents**

6. Maintenance	Pages 85-93
a. Safe Meter Removal from Retractor	p. 85
b. Troubleshooting	p. 92
7. Appendices	Pages 96-107
a. Specifications	p. 96
b. Agency Approvals	p. 99
c. Dimensions	p. 100
d. Warranty	p. 104
e. Returning your meter	p. 104
8. Definitions	Page 106
9. Index	Page 107

Use the table below as a guide while using the worksheet on the next page to record your notes.

**NOTE!** Please read the entire quick-start procedure before beginning installation.

1.	Record inside diameter (ID). Ensure the actual pipe ID matches the pipe ID shown on the factory calibration certificate. If IDs do not match, refer to p. 59.	ID OD
2.	Record up/downstream straight-pipe requirements based on Pipe ID and meter style (insertion or inline). [refer to p. 23]	Pipe ID min.  FLOW  8X = Inline  15X = Insertion  10X = Insertion
3.	The Flow Direction Indicator must point in the direction of flow. The housing can be rotated for a better view of the meter's display. Note that the 2 set screws must be loosened before the housing will turn. [refer to p. 29]	FLOW INDICATOR: - POINT IN DIRECTION OF FLOW - REMOVE TO ROTATE HOUSING ±90°, ±180° - REPLACE INDICATOR WHEN DONE  FLOW - PENDONE  FLOW - REMOVE TO ROTATE HOUSING ±90°, ±180° - REPLACE INDICATOR WHEN DONE
4.	Ensure correct probe depth setting. If using 1 ½" size pipe, please see note on p. 26.	Q FLOW 0.73" (18.5 mm)
5.	Open the housing. If needed, the orientation of display can be rotated in 90° increments for a better view. [refer to p. 28 for more information]	ACCESS DISPLAY BY UNSCREWING COVER  REMOVE SCREWS ON DISPLAY TO ROTATE DISPLAY ±180°
6.	Ensure power wiring and output signal wiring are properly connected. [refer to wiring section p. 35 for more information.] The Pulse/Alarm and serial communication wiring options are based on model type.	(-)(+) (-
7.	Apply power to the flow meter.	Sisteran Initializing
8.	Check the remaining flow meter settings by accessing to panel of the display or by using the BioView™ Software items A - E on the following page.	the meter settings either through the front e. Record the settings in the spaces given for

Quick Start Guide

Before applying power to your meter, use this worksheet to record your notes.

		Serial Number:	Serial Number:	Serial Number:	Serial Number:
	Item to verify				
1.	What is the Pipe ID?	ID =	ID =	ID =	ID =
2.	Calculate the Upstream/ Downstream straight-pipe requirements	UP = DN =	UP = DN =	UP = DN =	UP = DN =
3.	<ul><li>a. Is the flow indicator pointed in direction of flow?</li><li>b. Must the housing be rotated for easy viewing?</li></ul>	Y/N Y/N	Y/N Y/N	Y/N Y/N	Y/N Y/N
4.	Is the probe depth setting correct?	Y/N	Y/N	Y/N	Y/N
5.	Have you rotated the display for easier viewing?	Y/N	Y/N	Y/N	Y/N
6.	Verify proper power wiring				
7.	Verify proper input/output wiring				


After applying power to your meter, check items A - E below by accessing the meter settings either through the front panel of the meter's display or by using the  $BioView^{m}$  software tool.

A.	Which flow units have been set in meter? (SCFM, KG/H, etc)				
B.	Correct values for reference temperature and pressure?	Y/N	Y/N	Y/N	Y/N
C.	Confirm the pipe ID listed above same as "Pipe_id="				
D.	Verify 4mA and 20mA meter settings	4mA = 20mA =	4mA = 20mA =	4mA = 20mA =	4mA = 20mA =
E.	Confirm the correct gas is selected for your application in the BioSelect™ menu				

Your Notes:

If you are experiencing any problems after completing this procedure, please call the Sierra Instruments Tech Department at 831-373-0200 to review this information.

Fig. 1.1: 645S/745S Menu Tree - Main Menu

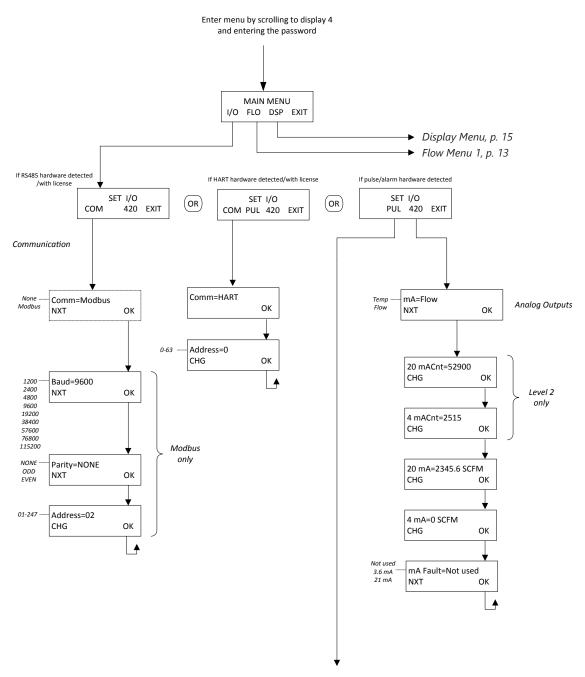

Digital Output Menu, p. 12

Fig. 1.2: 645S/745S Menu Tree - Digital Outputs

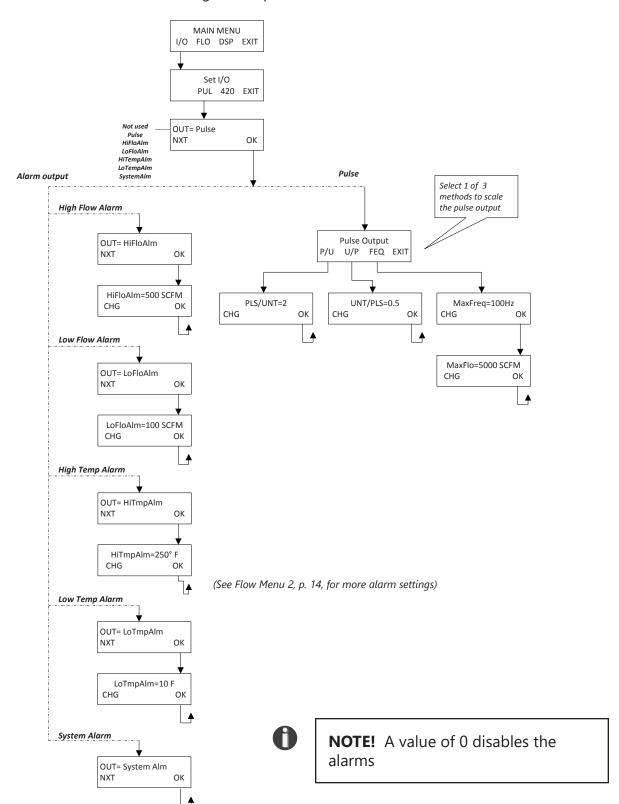


Fig. 1.3: 645S/745S Menu Tree - Flow Menu 1

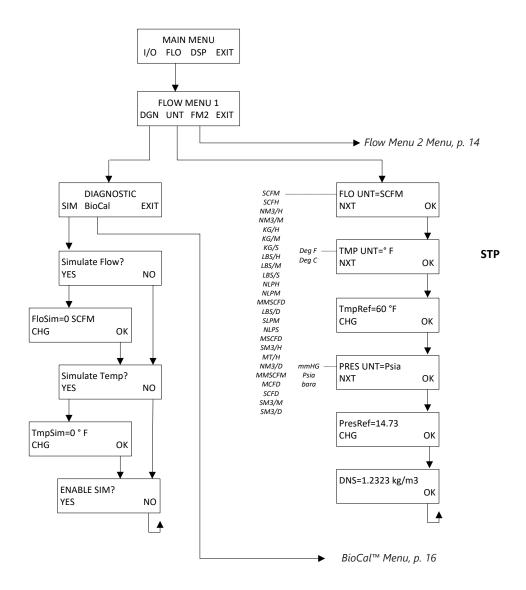


Fig. 1.4: 645S/745S Menu Tree - Flow Menu 2


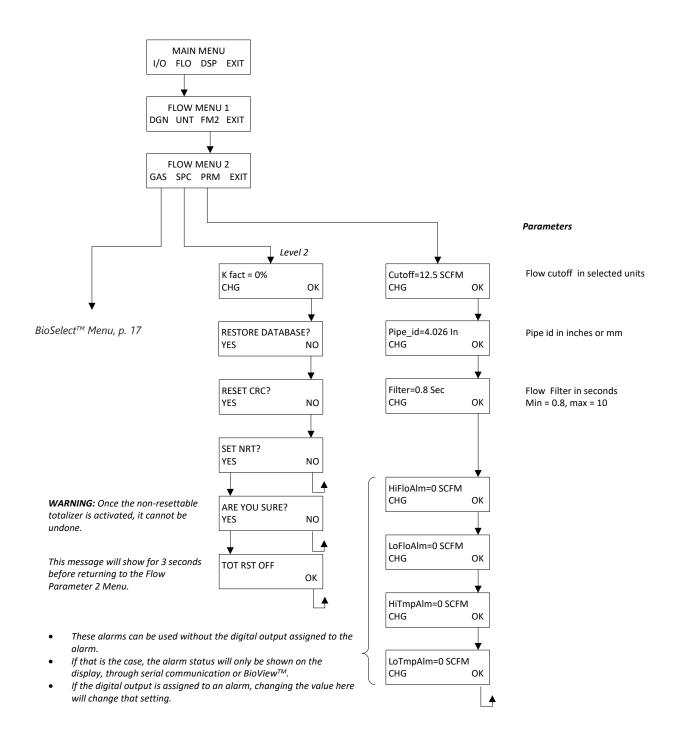


Fig. 1.5: 645S/745S Menu Tree - Display Menu



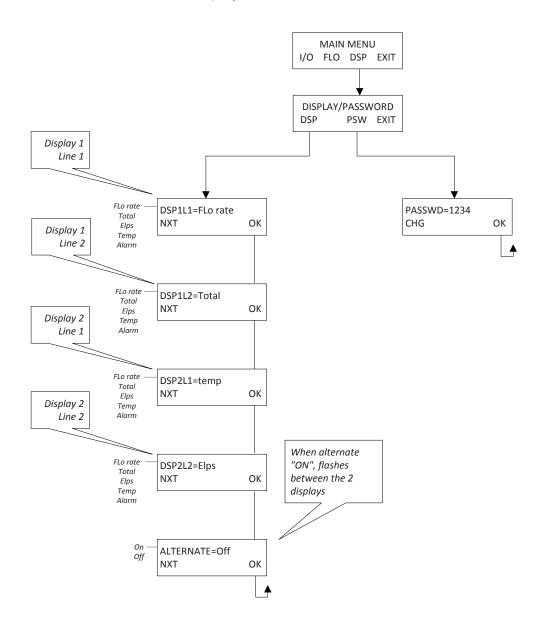

# **NOTE!** All readings updated every second

- Flo Rate = Flow rate of process gas
- Total = Total flow of process gas
- Elps = Elapsed time since reset of flow total
- Temp = Temperature of process gas
- Alarm = Notification of errors; diagnostic errors

Fig. 1.6: 645S/745S Menu Tree - BioCal™ Menu

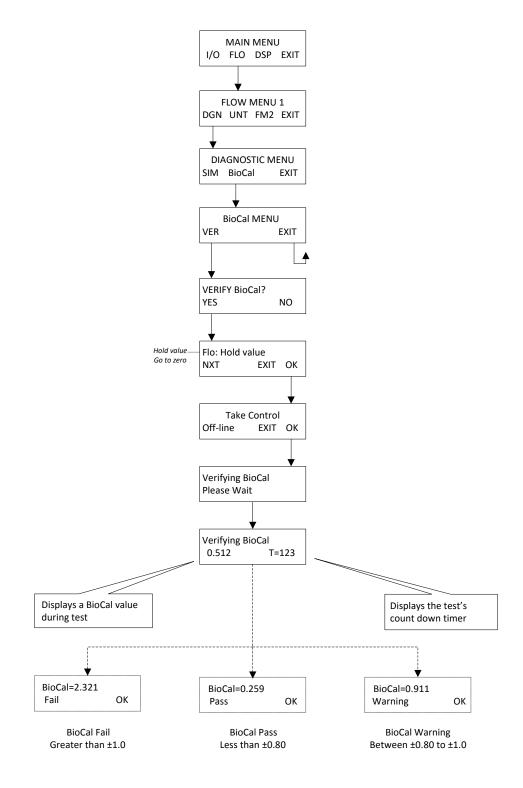


Fig. 1.7: 645S/745S Menu Tree - BioSelect™ Menu

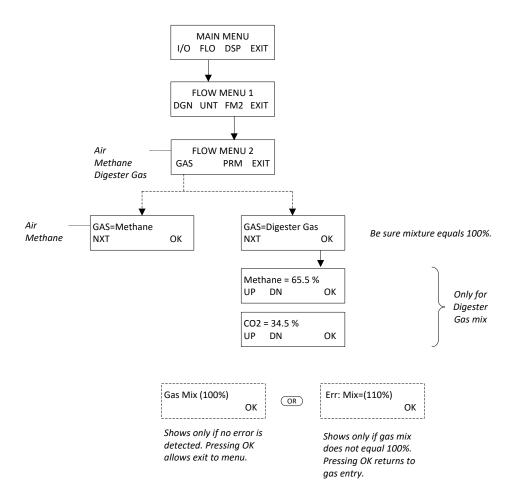


Fig. 1.8: 645S/745S Menu Tree - Engineering Screens


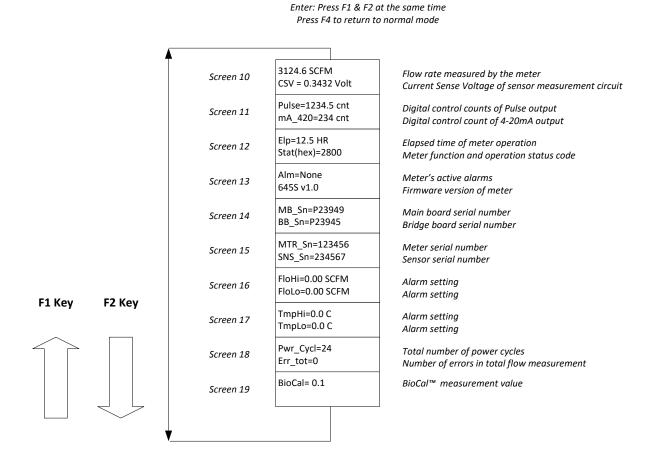


Fig. 1.9: 645S/745S Menu Tree - Reset Flow Total

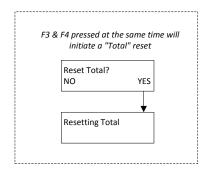

#### Welcome

Thank you for purchasing the BioTrak 645S/745S Thermal Gas Mass Flow Meter from Sierra Instruments. The BioTrak is one of the most technically advanced flow meters in the world. Extensive engineering effort has been invested to deliver advanced features, accurate measurement performance, and outstanding reliability.

This instruction manual contains the electrical and mechanical installation instructions as well as details for programming, maintaining and troubleshooting the meter. This manual is divided into the following sections: Introduction, Installation, Wiring, Operation, Communications, Maintenance, Appendices, Definitions, and Index.

#### **Theory of Operation**

The BioTrak is an innovative thermal mass gas flow meter and temperature transmitter. It is microprocessor-based and field programmable. The 645S/745S thermal sensor operates on the law that gases absorb heat. A heated sensor placed in an air or gas stream transfers heat in proportion to the stream's mass velocity. There are two sensor elements. One sensor element detects the gas temperature and a second element is maintained at a constant temperature above the gas temperature. The energy transferred from the heated element is proportional to the mass flow velocity. The 645S/745S flow meter maintains accurate flow measurement over a large temperature and pressure range.

#### **Mass Flow**

The BioTrak 645S/745S measures mass flow; an advantage over other flow meters which measure volumetric flow rate. Volumetric flow is incomplete because temperature and pressure are unknown and must be measured separately. For example, the mass flow of a gas depends on its temperature and pressure. As temperature and pressure changes, the gas volume changes but not its mass. Therefore a device measuring mass flow is independent of temperature and pressure changes. The BioTrak 645S/745S provides a direct measurement of gas flow in mass units (kg/hr, lb/hr), standard units (SCFM, SLPM) or normal units (NM3/hr, NLPM) with no additional temperature or pressure measurements required.

#### **Calibration Validation**

Validate the calibration of the 645S/745S in the field using the BioCal™ test. The goal of Calibration Validation is to provide operators with the ability to verify that the meter is capturing accurate data at scheduled recalibration times - or at any time - instead of sending the meter back to the factory for recalibration. By performing BioCal™ in the field, operators can verify that the meter is running accurately by testing the functionality of the sensor and its associated signal processing circuitry. This test can be done in the pipe under normal process conditions.

#### Flow Calibration

Every Sierra Instruments flow meter is set to the customer's configuration at the factory using an App ID which is generated by the on-line configurator. The App ID specifies the gas type, flow range, serial communication and other settings in the meter. If these settings match the final customer application, the meter is ready to use. The Sierra Instruments Calibration Lab maintains instrument calibration data on every flow meter. Calibration files include details on process conditions, customer gas, line size and other information. All NIST-traceable equipment utilized for the calibration procedure is identified on the Calibration Certificate, which is sent with every flow meter.

Introduction

#### I/O Description


The 645S/745S features one galvanically isolated 4-20mA analog output, HART communication (optional), a pulse output, and Modbus RTU (RS485) (optional). There is also a USB port for interfacing with a laptop or computer. The 4-20mA output can be used for HART communication. The 4-20mA output can be configured for flow rate or process gas temperature and can be scaled by the user. The pulse output can be used for pulse or alarm and is programmable to represent flow rate.

The BioView<sup>™</sup> software interfaces to the USB port and is a free Sierra Instruments PC-based software program that displays flow meter readings and permits flow meter configuration. The software is available for download on the Sierra Instruments website.

#### 645S/745S Functional Diagram

An optional on-board 2 line x 16 character backlit LCD display shows flow rate, total flow, elapsed time, process gas temperature, and alarms. The display is also used in conjunction with the Configuration Panel for field configuration of flow meter settings such as gas selection, 4-20mA scaling, pulse output scaling, pipe area, flow cutoff, flow filtering, display configurations, diagnostics, communication parameters, and alarm limits.

Fig. 1.10: 645S/745S Function Diagram

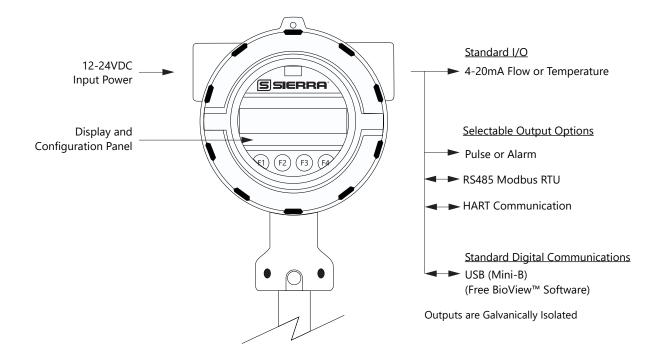

#### **Installation Scope**

This section describes how to install the Sierra Instruments BioTrak 645S/745S Flow Meter and how to get started. Installation methods will vary according to the flow meter type (insertion or inline).

#### For 645S Insertion Types:

- 1. Determine lateral position on the pipe.
- 2. Determine radial position of probe, if moisture or condensation is present in the gas.
- 3. Verify sensor installation depth.
- 4. Determine sensor orientation in relation to sensor length and direction of flow.
- 5. Determine if the display orientation must be changed.
- 6. Ensure proper tightening of compression fitting for mounting meter.

#### For 745S Inline Types:

- 1. Determine lateral position on the pipe.
- 2. Ensure the correct flow body orientation in relation to direction of flow in pipe.
- 3. Determine if the display orientation must be changed.
- 4. Ensure proper tightening of compression fitting for mounting meter.

Installation procedures must be performed using a combination of the end user's best engineering practices, in compliance with local codes, and with manufacturer's recommendations.



#### **General Precautions**

The following general precautions should be observed:


- 1. Exercise care when handling the flow meter to avoid damaging the probe, sensor or enclosure.
- 2. Close any unused conduit openings in the enclosure with plugs certified for your application.
- 3. The enclosure cover must be closed except during configuration or at times during installation.
- 4. Mounting 645S/745S in direct sunlight can cause the temperature inside the enclosure to increase beyond design limits, resulting in failure of LCD display and reduced component life. It is recommended that a sunshade be installed to avoid direct sunlight (see maximum enclosure operating temperature specification).
- 5. Ensure the flow direction indicator/pointer for the meter is in line with the direction of flow in the pipe.
- 6. Do not install the 645S/745S enclosure near an igniter, igniter-controller or switching equipment.
- 7. Do not install an external power supply in a cabinet containing an igniter controller or switching equipment.
- 8. For accurate flow measurement, review flow meter placement instructions before installation to ensure a proper flow profile in the pipe.
- 9. For safety reasons, Teflon ferrules are only appropriate for applications with pressures of 60 psig or less. At higher pressures, use of a Teflon ferrule risks unwanted probe movement or ejection of the probe from the pipe. For all applications above 60 psig, the standard stainless steel ferrule is required.

#### Instructions for Flow Meter Lateral Placement

Install the BioTrak 645S/745S flow meter so that it is far enough away from bends in the pipe, obstructions, or changes in line sizes to ensure a consistent flow profile. See Fig. 2.1 below for your meter type.

Fig. 2.1: Upstream and Downstream Pipe IDs for 645S Insertion and 745S Inline Flow Meters

#### **645S INSERTION**

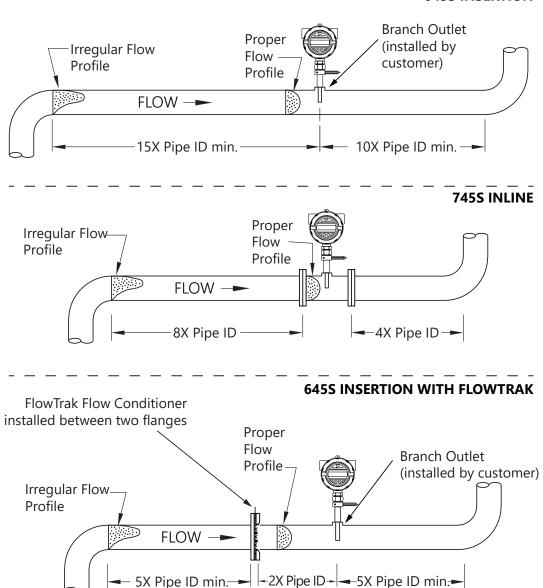




#### NOTE!

- Pipe ID = Inside Diameter
- The probe diameter is 3/4"
- An irregular flow profile will affect sensor accuracy
- See FlowTrak installation instructions for more information

#### Radial Probe Position - Moisture in the Gas or Condensation

The radial position of the meter may help prevent moisture and condensation from forming on the sensor and disrupting accurate flow measurement. Sierra Instruments recommends that our flow meters be used in dry gas conditions for highest accuracy whenever possible. Contact Sierra for further recommendations.


Fig. 2.2: Installation at 180°

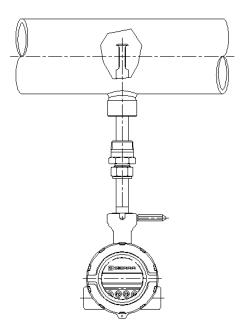

# **Alternate Installations - Vertical Pipes or Restricted Installation Spaces**

When restricted physical installation space exists, the 645S/745S can also be installed at other angles. Please note that the display and the enclosure orientation can be rotated in 90° increments.

Fig. 2.3: Alternate Installation at 90° (CCW)



#### **Welding Branch Fitting to Pipe (645S Only)**


The probe of the 645S must be installed perpendicular in the pipe to measure flow accurately. Use the following steps to ensure that the branch fitting is correctly welded to the pipe. Directions:

- 1. Drill a 0.781" (25/32") hole through the wall of the pipe (1 wall only).
- 2. Assemble the compression fitting and branch fitting hand tight onto the probe of the 645S.
- 3. Insert the probe into the hole in the pipe and use the 645S probe and compression fitting to align the branch fitting with the hole and the probe perpendicular to the pipe.
- 4. Tack-weld the branch fitting carefully onto the pipe.
  - Before welding the fitting completely, verify the probe is aligned to the center of the pipe and the hole is centered in the branch fitting (see Figure 2.4).
- 5. To verify that the correct hole position has been achieved, carefully slide the 0.75" sensor in and out of the branch fitting and 0.781" hole.

**WARNING!** Do not force the 0.75" sensor through the 0.781" hole. Forcing it through the 0.781" hole can damage the probe!

- 6. Verify that the temporary weld of the branch fitting positions the probe window on the pipe's centerline.
  - Figure 2.4 shows an incorrect welding of the branch fitting, causing the 0.75" sensor to be "off center".
- 7. Once the branch fitting is aligned properly, remove the 0.75" sensor from the branch fitting and finish welding. Then verify the probe is still aligned with the center of the pipe.
- 8. Set the depth of the flow meter (see "Fig. 2.5: Cross Section of Insertion Sensor Depth in Pipe" on page 26).
  - Do not tighten compression fitting until proper depth of flow meter is determined. See Fig. 2.5.

Fig. 2.4: Alignment of Branch Fitting

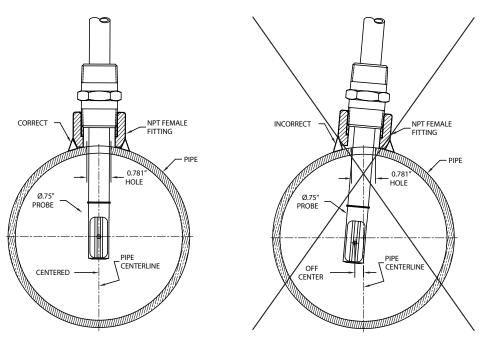


#### **Installation Depth**

The installation depth of the sensor in the pipe is dependent on the pipe size. To get the most accurate reading, proper placement of the sensor window within the pipe is necessary. As shown in Fig 2.5, the end of the sensor window should be 0.73" (18.5 mm) past the center line of the pipe. Review the dimensional drawing below with the following equation to calculate insertion depth: L + D/2 + .73" = insertion depth. Insertion depth is measured from the top of the compression fitting to the bottom end of the probe.



**CAUTION!** For a 1½" pipe, do not tighten compression fitting without 0.2" distance from wall or damage to probe will occur.

Fig. 2.5: Cross Section of Insertion Sensor Depth in Pipe

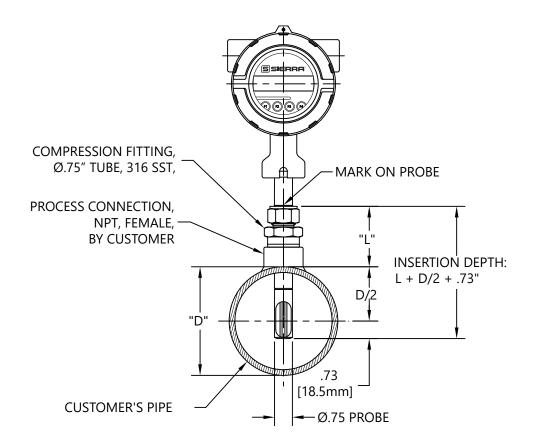


#### **Mounting Instructions - Compression Fittings (645S Only)**

The 645S is mounted through a 0.781" hole and a female NPT branch outlet in the customer's pipe. Insertion style flow meters are not designed for use in pipes smaller than 1½".

- Install the compression fitting into the female NPT branch outlet.
- When installing in a 2" pipe or larger, install the end of the probe 0.73" (18.5 mm) past the center line of the pipe (refer to figure 2.5).
- When installing into a 1½" pipe carefully install the probe into the pipe until it touches the opposite wall and pull back 0.2".
- Rotate the nut finger-tight.
- Further tighten the nut just enough until the tube will not turn by hand or move axially in the fitting.
- Mark the nut at the 6 o'clock position.
- While holding the fitting body steady, tighten the nut one and one-quarter (1 1/4) turns to the 9 o'clock position. See Figure 2.6.

Fig. 2.6: Proper Tightening of the Compression Fitting Nut

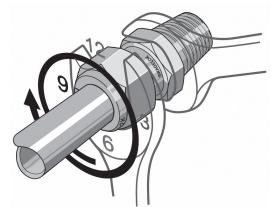



**NOTE!** Before removing a probe with compression fitting, mark the tube at the back of the nut, and mark a line along the nut and fitting body. Use these marks when reinstalling the probe. Reference the instructions on p. 28.

**NOTE!** When installing a probe with compression fitting that has been tightened previously, use the instructions on p. 28.

**CAUTION!** For a 1½" pipe, do not tighten compression fitting without 0.2" distance from wall or damage to probe will occur.

**CAUTION!** Once the stainless steel compression fitting ferrule is locked onto the probe, the probe can be removed or rotated, but the insertion depth is locked in place.

**CAUTION!** If the compression fitting is not properly tightened or the recommended pressure is exceeded, the fitting can slip on the probe and cause damage to the meter or bodily harm.


Installation

Mounting Instructions - Compression Fittings (Inline and Insertion Meters Previously Installed)

In cases where a compression fitting has already been swaged in an inline flow body or an insertion meter, use the following procedure.

- Carefully insert the probe with swaged ferrules into the fitting until the front ferrule seats against the fitting (see Figure 2.7).
- Verify that the probe is installed the correct depth in the pipe (refer to Figure 2.5 on p. 26).
- Rotate the nut with a wrench until the probe and nut are in their previously marked positions, or you feel a significant increase in resistance (see Figure 2.7).
- Tighten the nut slightly (approximately 1/8 turn).

Fig. 2.7: Proper Re-Tightening of the Compression Fitting Nut

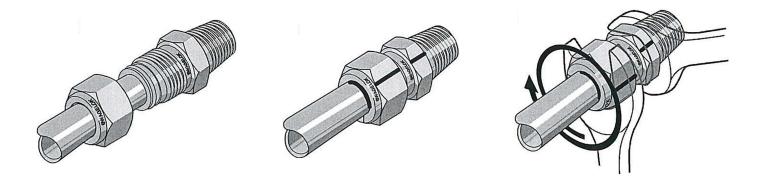



**CAUTION!** Do not use a gap inspection gauge with reassembled fittings.


#### **Rotating the Enclosure**


The 645S/745S enclosure has been designed to allow the enclosure to rotate for optimal viewing of the display. To rotate the enclosure, first loosen the two set screws near the Flow Direction Indicator, then unscrew and remove the flow direction indicator. Rotate the enclosure into the desired position, reinstall the flow direction indicator, and tighten the set screws. Do not rotate the enclosure more than 360 degrees.

#### **Direction of Flow and Orientation of the Probe**

Install the meter with the flow direction indicator pointing in the direction of flow and centered on the middle of the pipe. The rotational misalignment of the flow direction indicator must be less than 2 degrees.

Fig. 2.8: Orientation of Flow Meter

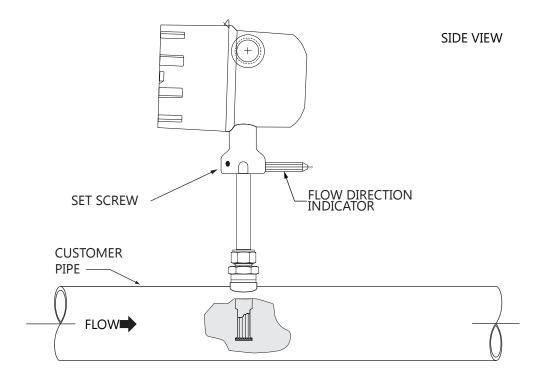


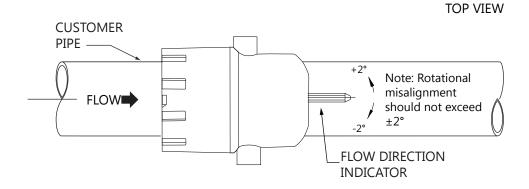

#### Changing the Orientation of the 645S/745S Optional Display

The optional display can be rotated in 90° increments for optimum viewing of the screen. First, open the enclosure by unscrewing the enclosure cap and loosen the two captive screws to open the display assembly. Detach the display board from the metal shield by loosening the three screws on the back of the round shield. Rotate the display board to the desired orientation. Ensure that the display cable is routed flat and straight through the display hinge to prevent binding. Reattach the display board to the metal shield by tightening the three screws. Close the display assembly and secure it to the enclosure with the two captive screws. Finally, install the enclosure cover back on the front of the enclosure.


Fig. 2.9: Rotating the Display Orientation

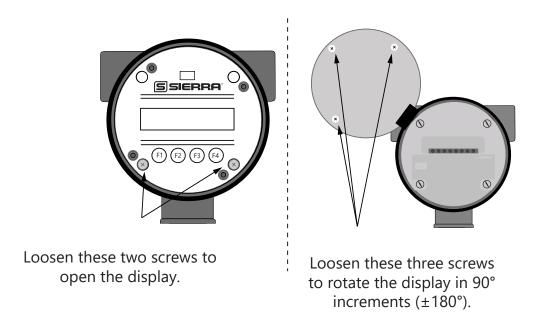

#### **Installation of a New Retractor Assembly**


- 1. Remove collar clamp from probe using a 3/16" Hex Key.
- 2. Remove meter probe from retractor assembly and leave the ball valve open. Keep the collar spacer on the probe so it is not misplaced.
- 3. Install the valve assembly on the pipe, by tightening the Hex Nipple with a 1 3/8" wrench.

Fig. 2.10: Retractor Assembly With and Without Probe Installed

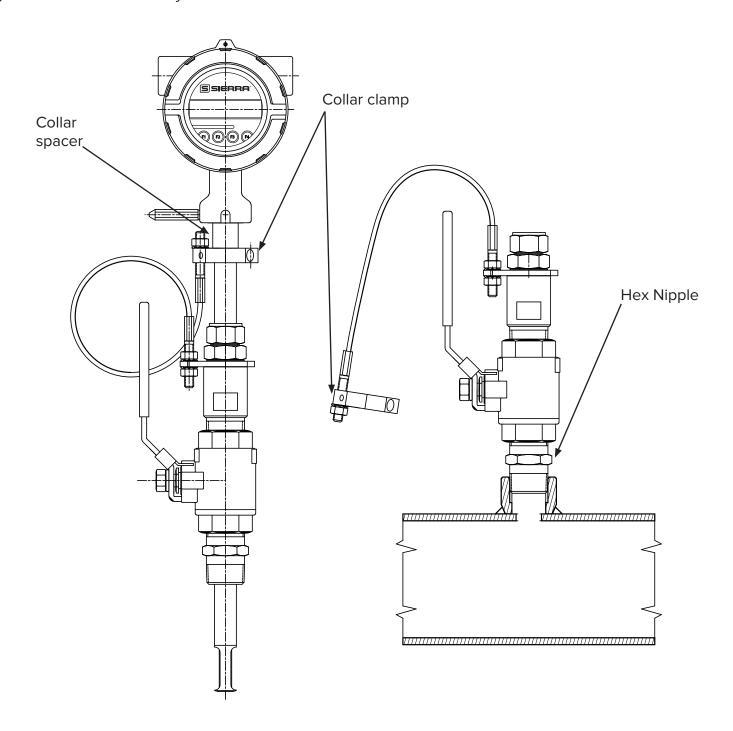


4. Carefully slide the probe through the retractor assembly and through the hole to see if there is interference by touching the pipe wall with the end of the probe on the far side or until the probe cannot go deeper. Remove the probe. Remove the retractor and rework the hole, if required.

Fig. 2.11: Verify Probe Insertion

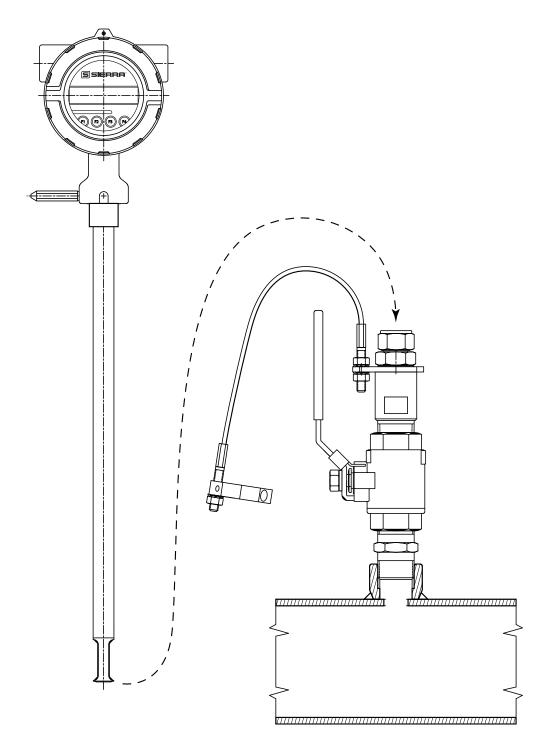


- 5. Using the equation (L + D/2 + 0.73) from Figure 2.12, calculate the insertion depth and mark on the probe while measuring from the end of the probe.
- 6. The Retractor Clearance table of Figure 2.21 lists the space required to remove the meter from the retractor. Use the model code of your meter to determine the dimension.

Fig. 2.12: Determining and Marking Insertion Depth

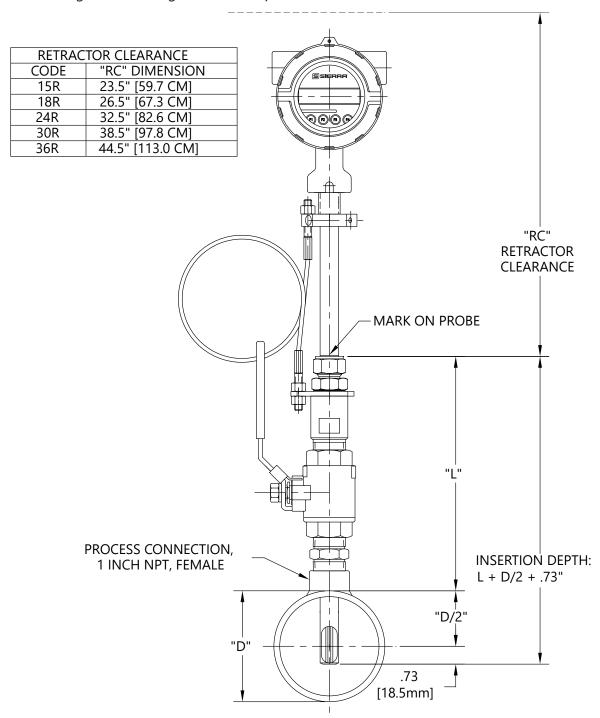

- 7. Insert probe back into the retractor to the depth mark and hand-tighten the compression fitting. Make sure collar spacer is in place on the probe.
- 8. Verify that flow direction indicator is in line with pipe and in the direction of flow.

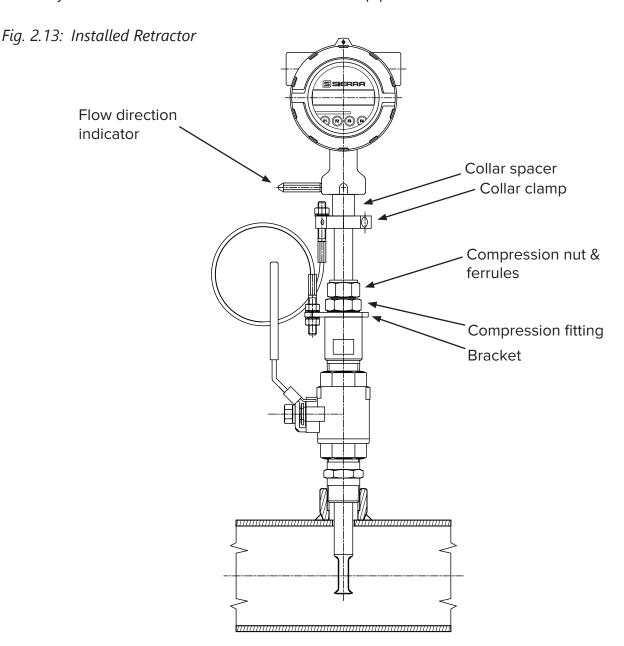

- 9. Fully tighten compression fitting (refer to the instructions on p. 27).
- 10. Install collar clamp back on probe just below the collar spacer. Install collar so that the cable mounting hole is in line with the mounting hole on the bracket.
  - 0

**NOTE!** For instructions on how to properly remove and replace the meter from a retractor, please refer to "Instructions for Removing and Inserting the Meter from a Pressurized Pipe using the Retractor" on page 88.




#### **Wiring Instructions**

To wire the 645S/745S connect the power and signal wires to the terminal blocks according to the label and instructions on the following pages.

Fig. 3.1: 645S/745S Wiring Access

Loosen these two screws to open the display and access wiring terminals.

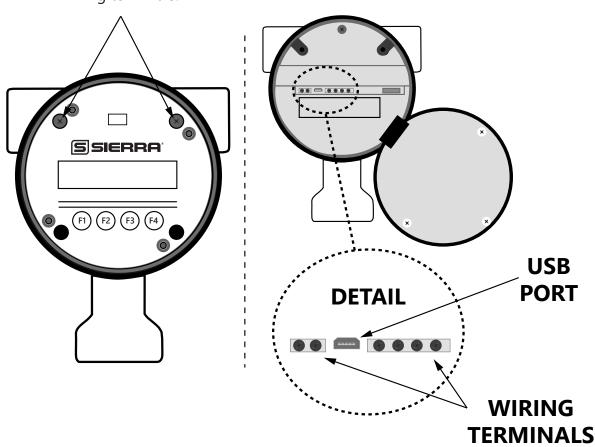

To wire the 645S/745S, unscrew and remove the enclosure cap. Loosen the two captive screws on the display assembly and rotate it open to access the wiring terminals. Connect the power and signal wires to the terminal blocks according to the label and instructions on the following pages.

Cut all wires as short as allowable for a minimum service loop. Obtain the correct length for the 645S/745S wires using one of these methods:

- Trim the wires to extend 2 inches out of the enclosure after the conduit and wires are routed to the 645S/745S.
- Trim the wires to extend 5 inches from the end of the conduit before attaching them to the 645S/745S.





#### **Wiring Precautions**

**WARNING!** - DO NOT OPEN THE ENCLOSURE WHEN ENERGIZED OR AN EXPLOSIVE ATMOSPHERE IS PRESENT.

- All plumbing and electrical installations of flow meters must be in compliance with local codes, the end user's best engineering practices, and manufacturer's recommendations.
- Do not install the 645S/745S enclosure near an igniter, igniter-controller or switching equipment to eliminate the possibility of noise interference.
- Do not install an external power supply in a cabinet containing an igniter controller or switching equipment.
- This flow meter contains components that can be damaged by static electricity. You must discharge yourself by touching a grounded steel pipe or other grounded metal prior to working inside this flow meter.
- Close any unused conduit openings with suitable certified plugs

#### **Power Wiring**

For wiring the 12 to 24VDC power, use stranded copper wire. Twisted pair shielded cable is recommended. Supply connection wiring must be rated for at least 90°C.

#### Grounding

The enclosure must be properly grounded with a quality earth ground. 16 gauge, stranded wire is recommended.

#### **Signal and Serial Communication Wiring**

For signal and serial communication wiring, the recommended wire gauge is 18 to 22 AWG. Always use twisted pair shielded cable.

#### **Modbus Cable Specs**

A shielded 22 to 18 gauge three conductor cable is recommended for Modbus communication wiring. Two of the wires in the cable should be twisted pair and used for the Modbus transmit and receive signals. The third wire is for the Modbus common signal. The shield drain wire of the cable should be connected to chassis or earth ground at the Modbus modem. Belden number 3106A or a similar type of cable is recommended, depending on the environment or temperature requirements of the application.



#### **Power Input Requirements: 12 to 24VDC**

External DC power supply must provide 12 to 24VDC (10 to 30VDC full input power range) at 6 Watts minimum.


With 12VDC power, the 645S/745S can use up to 500mA. With 24VDC power, the 645S/745S can use up to 250mA.

A 20 Watt or greater power supply is recommended to ensure it can provide enough current under all temperature, ventilation, and power on conditions.

The enclosure must be properly grounded with a quality earth ground. Sixteen (16) gauge, stranded wire, is recommended for earth ground.

Connect the power wiring as shown in the diagram below.

Fig. 3.2: Connections for 12 to 24VDC Supply

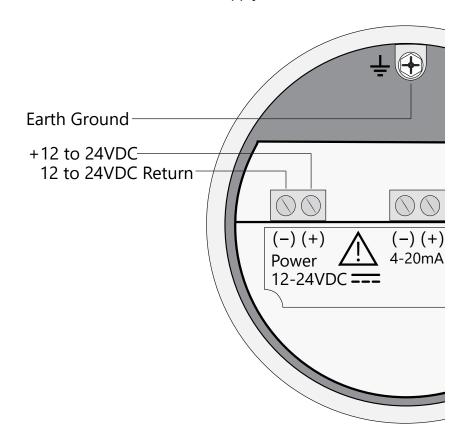



### **CAUTION!**


Supply connection wiring must be rated for at least 90°C.



# 4-20mA Output Wiring: Customer-Supplied Power Source (Recommended)

Bring the wiring in through either conduit hub. Connect the 4-20mA flow rate, 4-20mA temperature, and HART communication option wiring as shown in the diagram below.

Fig. 3.3: 4-20mA Output Wiring for Isolated Customer-Supplied Power Source

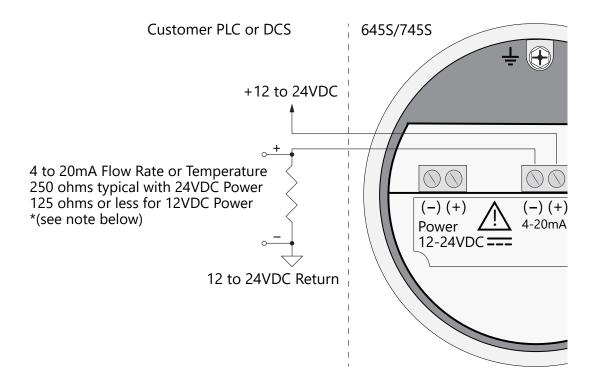




- When using a 12 volt power supply, the load resistor on the 4-20mA output must be 125 ohms or less to operate properly.
- When using 24 volt power, the load resistor is typically 250 ohms. A 250 ohm resistor in the 4-20mA circuit will result in a 1 to 5 volt signal to the PLC or DCS.
- When using a 24 volt power supply, the load resistor on the 4-20mA output must be 600 ohms or less.
- Some PLC and DCS equipment have built in load resistors, please refer to the technical manuals of such equipment.



### 4-20mA Output Wiring: Loop Power Provided by 645S/745S

Bring the wiring in through either conduit hub. Connect the 4-20mA flow rate, 4-20mA temperature, and HART communication option wiring as shown in the diagram below.

Fig. 3.4: 4-20mA Output Wiring for Loop Power Provided by 645S/745S

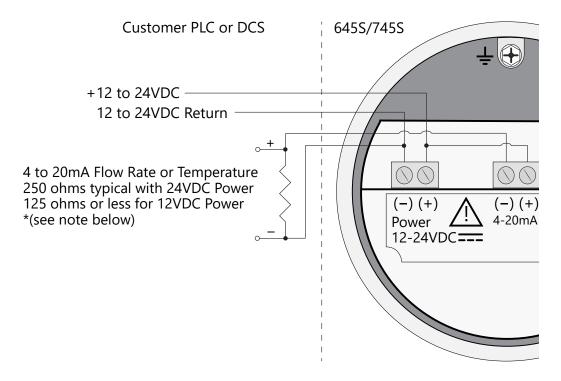




- When using a 12 volt power supply, the load resistor on the 4-20mA output must be 125 ohms or less to operate properly.
- When using 24 volt power, the load resistor is typically 250 ohms. A 250 ohm resistor in the 4-20mA circuit will result in a 1 to 5 volt signal to the PLC or DCS.
- When using a 24 volt power supply, the load resistor on the 4-20mA output must be 600 ohms or less.
- Some PLC and DCS equipment have built in load resistors, please refer to the technical manuals of such equipment.



# **Pulse/Alarm Output Wiring: Customer Supplied Power Source (Recommended)**

Bring Pulse/Alarm wiring in through either conduit hub. Connect the Pulse/Alarm wiring as shown in the diagram below. The Pulse/Alarm output is an open collector circuit capable of sinking a maximum of 20mA of current. Pulse or alarm selection is programmed using the display or BioView™. Only one option, pulse or alarm, can be active at a time.

Fig. 3.5: Pulse/Alarm Output Isolated (Recommended)

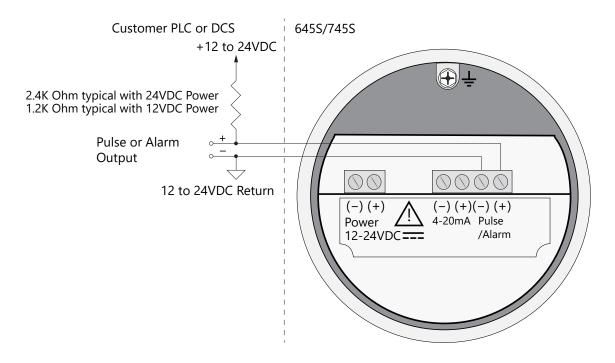




- The 645S/745S Pulse/Alarm output is typically used to drive digital circuitry or solidstate relays. The output of a solid state relay may, in turn, operate loads such as electromechanical relays or alarm indicators.
- The maximum load current of the Pulse/Alarm output is 20mA. Choose a load resistance that provides approximately 10mA with the power supply operating voltage.
- When the output is configured for Alarm and an alarm is not active, the output will be on (0 volts output). When an alarm is active, the output will be off (12 to 24 volts output).
- In order to use the Pulse/Alarm feature on the BioTrak 645S/745S, this feature must be chosen when the meter is ordered from the factory. Pulse output not available with meters ordered with Modbus RTU (RS485).



### Pulse/Alarm Output Wiring: Power Provided by 645S/745S

Bring pulse/alarm wiring in through either conduit hub. Connect the pulse/alarm wiring as shown in the diagram below. The pulse/alarm output is an open collector circuit capable of sinking a maximum of 20mA of current. Pulse or alarm selection is programmed using the display or BioView™. Only one option, pulse or alarm, can be active at a time.

Fig. 3.6: Pulse/Alarm Output Power Provided by 645S/745S

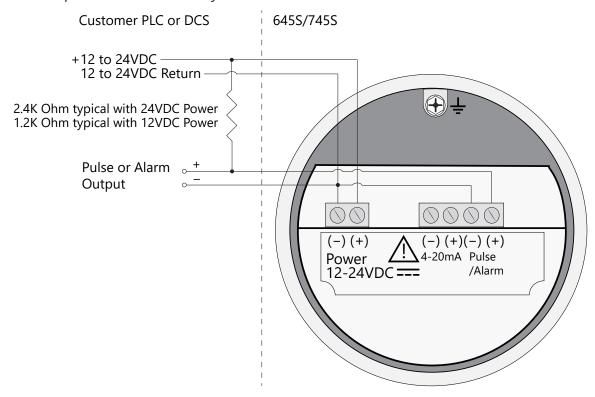



- The 645S/745S Pulse/Alarm output is typically used to drive digital circuitry or solidstate relays. The output of a solid state relay may, in turn, operate loads such as electromechanical relays or alarm indicators.
- The maximum load current of the Pulse/Alarm output is 20mA. Choose a load resistance that provides approximately 10mA with the power supply operating voltage.
- When the output is configured for Alarm and an alarm is not active, the output will be on (0 volts output). When an alarm is active, the output will be off (12 to 24 volts output).



# **RS485 Wiring for Modbus RTU**


Wiring connections are made as shown in the diagram below for Modbus communication.

### **Termination Resistor**

Connect a termination resistor across the receive/transmit signals of the last device on the communication line. To connect the 121 ohm termination resistor on the 645S/745S, set jumper W1 to the Terminated position, see Fig. 3.7.

Disconnect the termination resistor on all other external RS485 devices. The termination resistor of the 645S/745S is disconnected by setting jumper W1 to the "open" position.

Fig. 3.7: RS485 Wiring

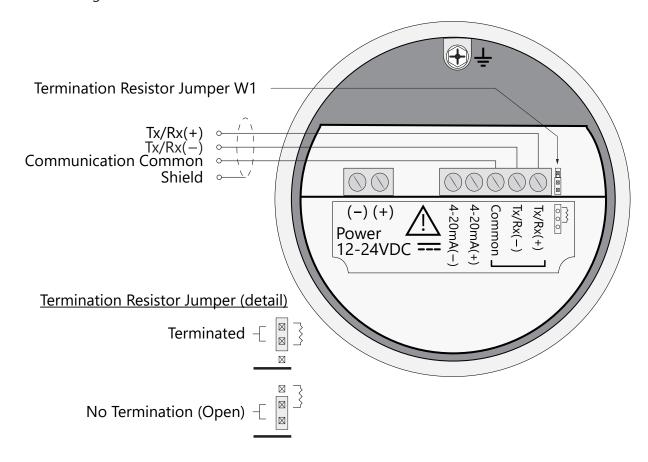



- In order to use the RS485 feature on the 645S/745S, this feature must be chosen when the meter is ordered from the factory. Modbus RTU is not available with meters ordered with the Pulse/Alarm option.
- W1 jumper will either be in the open or terminated position. It should be in the terminated position on the last meter in the series.



### **HART Wiring**

The HART connections are made as shown in the diagram below.




**NOTE!** Meters ordered with HART will be configured for flow as default. If the customer changes the 4-20mA output to temperature, HART should report temperature.

### **HART 4-20mA Output Wiring: Customer-Supplied Power Source**

The 4-20mA current loop and HART modem connections are made as shown in the diagram below.

Fig. 3.8: HART Wiring, Customer-Supplied Power Source

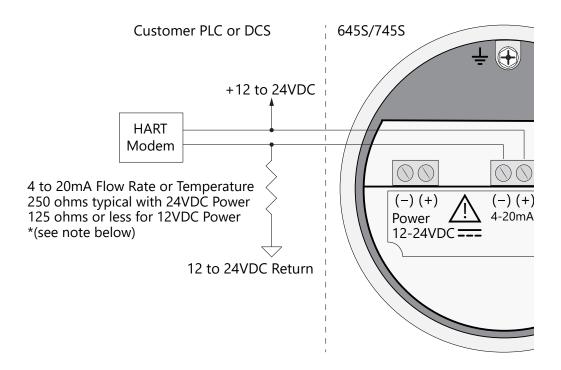



- When using a 12 volt power supply, the load resistor on the 4-20mA output must be 125 ohms or less to operate properly.
- When using 24 volt power, the load resistor is typically 250 ohms. A 250 ohm resistor in the 4-20mA circuit will result in a 1 to 5 volt signal to the PLC or DCS.
- When using a 24 volt power supply, the load resistor on the 4-20mA output ust be 600 ohms or less.
- Some PLC and DCS equipment have built in load resistors, please refer to the PLC/ DCS technical manual.




# **HART 4-20mA Output Wiring: Handheld Communicator**

The 4-20mA current loop connections are made as shown in the diagram below.

A hand-held HART communicator can be connected to test points TP12 (+) and TP13 (-) with clip leads or to the 4-20mA terminal block.

Fig. 3.9: HART 4-20mA Output Wiring, Handheld Communicator

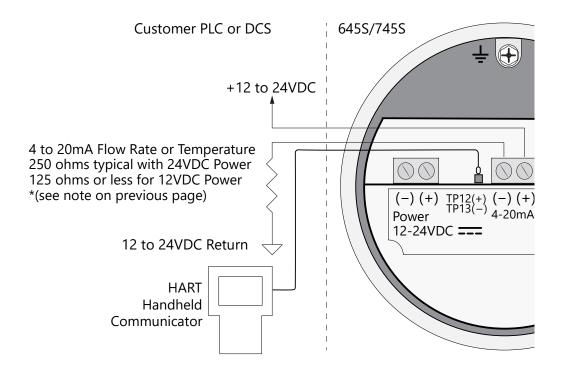




# HART 4-20mA Output Wiring: Loop Power Provided by 645S/745S

The 4-20mA current loop and HART modem connections are made as shown in the diagram below.

Fig. 3.10: HART 4-20mA Output Wiring, Loop Power Provided by 645S/745S

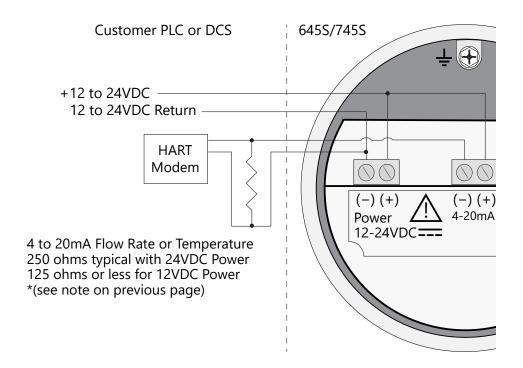

Operation

# **Start Up Sequence**

The program automatically enters the Run/Measure mode after power up. The screen will show the software version of the 645S/745S during power up.


#### **USB** Interface

The USB interface is a standard feature which allows communication with a PC to monitor readings and configure settings. The BioView™ Software, is a free application program from Sierra Instruments that connects to the USB interface and allows data monitoring, configuration setting, data logging to Excel, and an option to save and recall 645S/745S configuration data.

# 645S/745S Display and Configuration Panel

The 645S/745S has an optional 2 line x 16 character display with four mechanical buttons. The meter can be programmed by using the display and configuration panel. The configuration panel can be accessed by removing the 645S/745S cap. Be sure to replace the cap after you are done configuring the 645S/745S.

Fig. 4.1: 645S/745S Optional Display and Configuration Panel

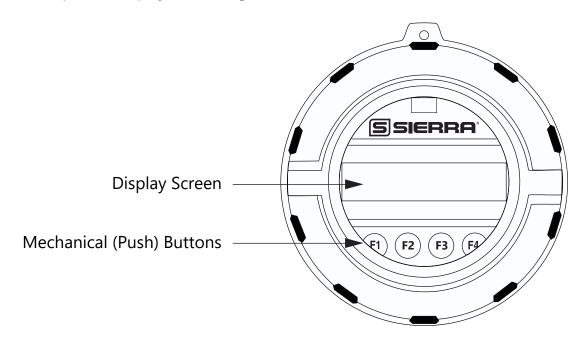


# **Measurement Mode Display Screens**

In the measurement mode, there are four different display screens (Display 1, 2, 3 and a prompt screen to enter the programming mode). Two display screens are user programmable (refer to Display Setup p. 54). Scrolling through the display is accomplished by pressing the **F1** or **F2** key to view the next or previous screen.

Pressing the **F1** and **F2** keys at the same time enters the "Log Menu" and "Engineering Menu" screens (refer to p. 18).

Pressing the **F3** and **F4** keys at the same time brings up the "Reset Total" screen prompt.

Fig. 4.2: Measurement Mode Display Screen Navigation

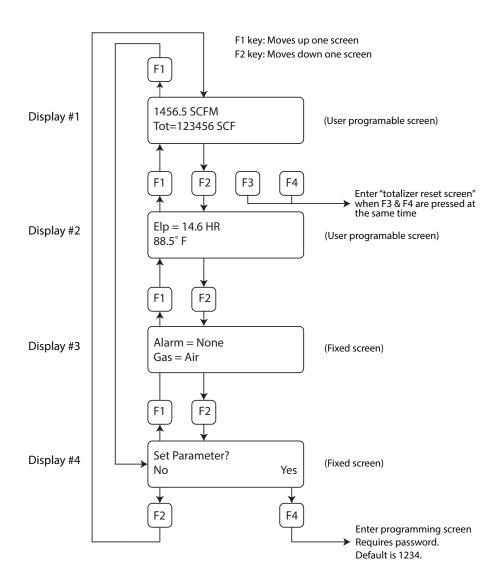


Operation


# **Programming: Data Entry using the Display and Configuration Panel**

There are two basic types of menu entries: one for changing value or string and one for selecting from a selection list.

### To Change a Value or String:




Press CHG (F1) key to change the value, OK (F4) to accept the value.



Press the **UP (F1) or DN (F2)** key to select a new digit or character, the cursor points to the selected digit. Press **NXT (F3)** to select the next digit and **OK (F4)** to accept the entry.


#### To Select from a List:




Press **NXT (F1)** key repeatedly until the correct selection is made and **OK (F4)** key to accept the entry.

# **Entering the Programming Mode**

To enter the programming mode and access the **Main Menu**, press the **F1** or **F2** key in the normal running mode until the following screen is shown:



Press **YES (F4)** and the following screen will prompt user to enter password:




Enter the correct password, then follow the instructions for changing a value as specified above. The default Level 1 password is "1234".

If the wrong password is entered, the message "Wrong Password" will display and then return to the programming entry screen.

#### Main Menu


If the password is accepted, the **Main Menu** screen will be shown:



This is the Main Menu screen for the programming mode. Press EXIT (F4) repeatedly until "Normal Mode" is seen briefly to exit the programming mode.

# **Analog 4-20mA Outputs**

The following menu allows the scaling of the analog 4-20mA output. From the Main Menu, press I/O (F1) to move to the 4-20mA output selection. In this screen press 420 (F3) (screen appearance may vary according to options).



The 4-20mA output is programmable for flow or temperature:




Selections for the 4-20mA output are:

Flow


Temp

Select **NXT (F1)** to select Flow or Temperature and then press **OK (F4)**.




Enter the value for the 20mA and press **OK (F4)** key to accept the setting. Then the following screen will display:

### Operation




Enter the value for the 4mA and press OK (F4).

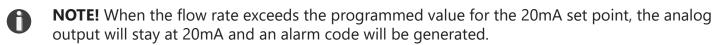

**NOTE!** 4mA is normally set to 0.

After setting the 4mA output value, choose the **mA Fault** value:



This menu allows the user to select an alarm fault level on the 4-20mA output. The alarm is activated when a serious issue is detected preventing the calculation of the correct flow rate. The 3.6mA and 21mA alarm outputs are related to the NAMUR NE 43 alarm feature.


The options are:

- mA Fault=3.6 mA (Force the 4-20mA signal to 3.6mA on alarm)
- mA Fault=21 mA (Force the 4-20mA signal to 21mA on alarm)
- mA Fault=Not use (4-20mA signal alarm fault not used)

The following events will set the output to 3.6mA or 21mA if the alarm level is selected:

- Sensor resistance above high limit
- Bridge Shutdown

Fig. 4.3: Range of 4-20mA Output and NAMUR Alarm

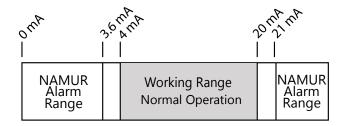


Press (F4) repeatedly until "Normal Mode" is seen briefly to exit the programming mode.




**NOTE!** When the flow rate exceeds the programmed value for the 20mA set point, the analog output will stay at 20mA and an alarm code will be generated.

# **Pulse/alarm Output**

The Pulse/Alarm feature can be accessed from the Main Menu, press I/O (F1).



Press **OUT (F1)** to select the pulse output. The following screen will show:




Press **NEXT (F1)** to cycle through output options until you have the selection for "OUT=Pulse" and press **OK (F4).** 

The pulse output can be configured in one of three ways:

- 1. Specifying how many pulses per unit, P/U (i.e., 10 pulses per SCF)
- 2. Specifying how many flow units total per pulse, U/P (i.e., 0.1 SCF per pulse)
- 3. Specifying a maximum frequency to a defined maximum value of flow rate

All of these approaches are equivalent.




Use **P/U (F1)** to enter pulse per unit, **U/P (F2)** for unit per pulse or **FEQ (F3)** to enter the flow and maximum frequency to scale the Pulse/Alarm output.



**NOTE!** When data is entered with any of the three described methods, the other values will be re-calculated according to the settings.

# **Entering data in Pulse per Unit:**

From the Pulse/Alarm Output Menu above, press **P/U** (F1) and the following screen will show:



Press CHG (F1) to change the setting and then OK (F4) to accept entry.

The value entered is in pulse per selected flow unit total (i.e., 2 pulses per SCF).

Operation

# **Entering data in Unit per Pulse:**


From the Pulse/Alarm Output Menu, press **U/P (F2)** and the following screen will show:



Press **CHG (F1)** to change the setting and then **OK (F4)** to accept entry. The value entered is in unit per pulse (i.e. 0.5 flow unit total per pulse)

# **Entering data with flow and maximum frequency:**

From the Pulse/alarm Output Menu, press **FEQ (F3)** and the following screen will show:




Enter the maximum pulse rate (frequency) and press OK (F4).



**CAUTION!** Maximum pulse rate (frequency) cannot exceed 100 Hz.

The next screen will show:






**NOTE!** If the flow rate exceeds the maximum pulse rate (frequency), the output will stay at 100 Hz and the 645S/745S will issue an alarm code.

# **Alarm Output**

To access the Pulse/Alarm feature, press **I/O (F1)** key from the **Main Menu** screen. The screen will show:



Then press **OUT (F1)** and the screen may show:



Then press NXT (F1) to select the correct alarm and press OK (F4).

Selections are:

Not used

Pulse

HiFloAlm = High Flow Alarm


LoFloAlm = Low Flow Alarm

HiTempAlm = High Temperature Alarm

LoTempAlm = Low Temperature Alarm

System Alarm

When the output is set to Alarm and there is no alarm condition, the output will be on (0 volts). When an alarm is active, the output is turned off (12 to 24 volts).



Enter the value for the limit by pressing **CHG (F1)** and then **OK (F4).** A value of zero (0) disables the alarm.



**NOTE!** There is only one output to operate as a pulse output or an alarm output. Both cannot operate at the same time.


# **Serial Communication Settings**

If RS485 Communication feature was purchased, the Serial communication settings can be programmed by pressing **I/O** (F1) key from the Main Menu. The screen will show:



Press **COM (F2)** to select Serial communication.

The screen may show:



#### Operation

Options for serial communication are:

None

Modbus


**HART** 



**NOTE!** Any selection other than "None" requires the communication option for the selected communication type. If enabling a communication option, see the Communications Protocols section of this manual.


# **Display Setup**

There are four display screens that you can cycle through in normal operating mode (see Figure 4.2 on p. 47). Two of the four display screens are fixed and cannot be changed (Displays #3 & 4). The other two screens are programmable to show the information that you prefer and is discussed in this section.

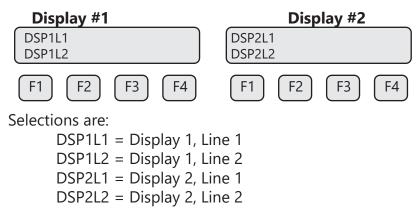


# To Program Display Screens #1 & 2:

From the Main Menu press **DSP (F3)** to select the display menu:



Press **DSP (F1)** key. The display will show:



These are the selections for the "Display 1, Line 1".

Selections are:

Flo rate = Flow rate


Total = Total mass or volume

Elps = Elapsed time

Temp = Temperature

Alarm = Error codes

When the selection is correct, press **OK (F4)** to accept. The display will then go through the same process for all four lines of the two programmable displays (DSP1L1, DSP1L2, DSP2L1 and DSP2L2). After the last line of Display 2 is accepted, the display will show the following menu:



This menu allows you to alternate between menu display 1 and 2 every few seconds. Selections are: On or Off

Press **OK (F4)** to accept selection. Press **EXIT (F4)** repeatedly until "Normal Mode" is seen briefly to exit the programming mode.

#### **Password**

There are two user level passwords, only **Level 1** is programmable and gives access to all the normal settings. The second password is used to allow access to calibration settings.


Default **Level 1** password is "1234," and **Level 2** password is "9111." The **Level 1** programmable password can be disabled by setting it to "0."

From the Main Menu press **DSP (F3)** to select the display menu.

# To Program the Password:



Press **PSW (F3)** key to select password.



This screen displays the current **Level 1** password.

Press **CHG** (F1) key to change the password and enter new value.

Press **OK (F4)** to accept new data and exit programming by pressing **EXIT (F4)** key repeatedly until out of the programming mode.




**NOTE!** Password can be number or letter characters up to four digits.

Operation


# **Units Settings Menu**

This menu is used to set the units for flow, temperature, and pressure as well as the setting of reference temperature and reference pressure.

These values will be set at Sierra Instruments using information supplied by the customer. These values can be changed to match a new application. The units setting is accessed from the **Main Menu**. To access the **Unit Settings Menu**:




Press FLO (F2):



Press UNT (F2) for Unit selection.

The screen will show:



Press NXT (F1) to change selection and OK (F4) to accept.



**NOTE!** The totalizer (total flow measured) will roll over when reaching a certain value. The maximum value is dependent on the flow units selected (see Totalizer Rollover p. 63).

#### **Flow Units**

Selections for flow units are:


SCFM	KG/M	LBS/D	SM3/H	MSCFD (MCFD)
SCFH	KG/S	NLPH	SM3/D	MMSCFD (MMCFD)
NM3/H	LBS/H	NLPM	NM3/D	MCFD (MSCFD)
NM3/M	LBS/M	NLPS	SLPM	MMSCFM (MMCFM)
KG/H	LBS/S	SM3/M	SCFD	MT/H



**WARNING!** The 645S/745S re-calculates area, 4 and 20mA values, maximum flow for the pulse output and flow cutoff when changing flow units.

# **Temperature Units**

After pressing **OK (F4)** to accept the Flow unit the display will prompt for the temperature unit setting:




Press NXT (F1) to change selection and OK (F4) to accept.

Selections for Temperature units are: °C or °F.

### **Reference Temperature**


After pressing **OK (F4)** to accept the temperature unit setting, the display will prompt for temperature reference in selected unit.



Press CHG (F1) to change the reference and OK (F4) to accept.

#### **Pressure Units**

After pressing **OK (F4)** to accept the reference temperature, the display will prompt for the reference pressure unit selection:



Press **NXT (F1)** to select next entry and OK (F4) to accept.

Selections are:


mmHG = Millimeters of mercury (absolute)

Psia = Pounds per square inch absolute

bara = Bar absolute

### **Reference Pressure**

After the pressure unit selection is made, the display will show a menu to enter the reference pressure:



Press CHG (F1) to change it and OK (F4) to accept.


Operation

# **Accessing Flow Parameters and Alarm Settings**


This is the menu used to set various flow parameter values. They are: flow cutoff, pipe diameter, filter, high and low alarm for flow and temperature.




**NOTE!** The parameters in this menu are set to the customer specifications at the factory. They should only be changed when changing the application of the flow meter.



The menu is accessed from the Main Menu by pressing **FLO (F2)**:



Then press FM2 (F3):






NOTE! The SPC function key will only appear and be accessible from a Level 2 password.

Then press **PRM (F3)**. This will move into settings for flow cutoff, pipe diameter, and filter value. These settings will be followed by the high and low alarm settings for flow rate and/or temperature.

# **Programming Flow Parameters Flow Cutoff**

The first parameter is Flow Cutoff:



Enter the value for the flow cutoff and then press **OK (F4)**. When the flow rate falls below the flow cutoff, the flow meter will display a flow value of zero.

# **Pipe Diameter**




To set the pipe Diameter, enter the pipe diameter in inches or **millimeters** and then press **OK (F4)**. Use millimeters for metric flow unit selections and inches for English flow unit selections. This selection is dependent on the flow unit selected (English vs metric). If the pipe/duct is a square or rectangle, the hydraulic diameter (equivalent value for a round pipe) must be entered for the pipe ID.

#### Filter Value

The filter value is entered in seconds. The allowable time constant range is 0.8 to 10 seconds. The filter time interval is proportional to the dampening.

Enter the filter value and then press **OK (F4)**.



# **Programming High and Low Alarm Settings**

Settings for the alarms directly follow the flow parameters for flow cutoff, pipe diameter, and filter value. These alarms can be used without the digital output assigned to the alarm. If that is the case, the alarm status will only be shown on the display, through serial communication, or  $BioView^{TM}$ . If the digital output is assigned to an alarm, changing the value here will change that setting.

### **High Flow Rate Alarm**

This is the upper flow limit alarm value that can be associated with the alarm output. An alarm code is generated when the flow value exceeds this limit. If no alarm is needed, set this value to zero.

To set the parameters for a high flow rate alarm, press **CHG (F1)**:




Press **OK (F4)** to accept the value.

Operation

### **Low Flow Rate Alarm**

This is the lower flow limit alarm value that can be associated with the alarm output. An alarm code is generated when the flow value is below this limit. If no alarm is needed, set this value to zero. To set the parameters for a low flow rate alarm, press **CHG (F1)**:




Press **OK (F4)** to accept the value.

# **High Temperature Alarm**

This is the upper temperature limit alarm value that can be associated with the alarm output. An alarm code is generated when the temperature value exceeds this limit. If no alarm is needed, set this value to zero.

To set the parameters for a high temperature alarm, press **CHG (F1)**:




Press **OK (F4)** to accept the value.

# **Low Temperature Alarm**

This is the lower temperature limit alarm value that can be associated with the alarm output. An alarm code is generated when the temperature value is below this limit. If no alarm is needed, set this value to zero.

To set the parameters for a high temperature alarm, press **CHG (F1)**:



Press OK (F4) to accept the value.


#### Simulation

This menu allows for simulation of flow rate and temperature. It should only be used for testing and demonstration purposes. Make sure to return all of these simulation values to zero, before returning to the normal mode of operation.




**CAUTION!** If the 4-20mA and/or the Pulse/Alarm outputs are connected to controllers, set the controllers to "manual" to ensure that the simulated signals do not cause false controller action.


The menu is accessible from the "Main Menu" by pressing **FLO**:




Pressing **DGN (F1)** will show:




Pressing **SIM (F1)** will show:




Press YES (F1) to continue.




Enter the value and then press OK (F4).

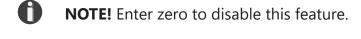




Press YES (F1) to continue.

### Operation



Enter the value and then press **OK (F4)**. Enter zero to disable this feature.



Press **YES** (**F1**) to start the simulation mode, otherwise press **NO** (**F4**). Upon pressing either key, the program will return to the FLOW MENU 1 screen.




**NOTE!** Simulation Mode will be cleared if the power is cycled.


#### **K Factor**

The K Factor allows the user to adjust the meter's calibration. The Sierra Instruments flow meter increases the calculated flow rate by the K Factor. This results in a direct scaling of the meter's output across the entire full range.

The K Factor parameter is accessed from the "Flow Menu 2" menu by entering a **Level 2** password "9111" and pressing the **SPC** key (**F2**).



The following screen will be displayed:



Press CHG (F1). Add the correction factor and press OK (F4).

If you want the flow meter to read 5% higher, enter 5.0%.

If you want the flow meter to read 5% lower, enter -5.0%.

If an existing K Factor is present, add the additional K Factor to the existing value.

Upon pressing **OK (F4)**, an option to restore the database will follow.

#### **Restore Database**


In case of user error, the ability to restore the meter to the original factory settings can be achieved in this menu. The display will show:



Press **YES (F1)** ONLY if you want to restore your database to the initial factory setting that the meter was shipped with. All current user-entered settings will be overwritten. The green LP3 LED will flash at a faster pace until the recall is performed. The "RESET CRC" screen will follow "RESTORE DATABASE". Upon pressing **OK (F4)**, an option to reset the NVRAM CRC will follow.

### **Reset CRC**


If the NVRAM CRC check fails (Error Code 36), the programmed settings values will need to be verified and corrected before clearing the error. Call Sierra Instruments Customer Service if you need assistance.



Press YES (F1) ONLY if you want to reset the CRC and generate a new CRC value.

# **Reset Total and Elapsed Time**

Enter the flow totalizer and elapsed time screen by pressing the **F3** and **F4** keys at the same time in the normal running mode.



Press YES (F4) and enter password to reset total and elapsed time. Press NO (F1) to cancel.



**NOTE!** This feature is not available on non-resettable units.

**Totalizer Rollover:** The 645S/745S has an automatic roll-over function. The total flow count of the 645S/745S will roll over after 99,999,999. Except for:

MSCFD: 999,999,999 MMSCFM: 9,999,999 MMSCFD: 999,999

Operation

### Calibration of the Sierra Instruments BioTrak 645S/745S Thermal Flow Meter

To ensure that all Sierra Instruments flow meters meet specified performance parameters and provide accurate, repeatable measurements in the field, all calibrations are performed with NIST-traceable flow standards. Each meter is shipped from the factory with a Sierra Instruments Calibration Certificate.

#### **BioCal™ Calibration Validation Test**

Sierra Instruments has developed the BioCal<sup>™</sup> Calibration Validation test to help our customers avoid sending the meter back for annual or biennial recalibration.

BioCal<sup>™</sup> ensures the repeatability, functionality of the sensor and its associated signal processing circuitry. By performing a simple test, the operator can verify that the meter is running accurately.

During the BioCal<sup>™</sup> calibration validation test, the microprocessor adjusts current to the sensor elements and determines the resulting electrical characteristics. Data within established tolerances confirms the meter is accurate.

# **Recommended Conditions for Performing BioCal™ Test**


Sierra Instruments recommends the BioCal<sup>™</sup> test be run under flowing conditions, especially in smaller pipe sizes. If the BioCal<sup>™</sup> test does not produce a "PASS" result, refer to "BioCal<sup>™</sup> Test Results" on page 66.




**NOTE!** If the BioCal<sup>™</sup> test is performed using the Sierra Instruments BioView<sup>™</sup> Software, at the completion of the test, a BioCal<sup>™</sup> Certificate may be printed for a record of the test. This certificate will display a pass/fail result.

# **Performing the BioCal™ Calibration Validation Test**


Press **FLO** (**F2**) from the "Main Menu." The display will show:




Press **DGN (F1).** The display will show:




Press **BioCal (F2)**. The display will show:




Press **VER (F1)** to perform the BioCal<sup>™</sup> verification test.



Press **NXT (F1)** to toggle between "Hold value" and "Go to zero". During the BioCal test, "Hold value" will keep the flow at the last value measured. "Go to zero" will set the flow output to zero.



Press OK (F4) to continue.




When ready to begin the test, press **OK (F4)**.



**WARNING!** If you are using closed loop control, the system needs to be taken off-line during the test.

Press **OK (F4)** to start BioCal™. BioCal™ test screen:



Operation

This test takes about 3 minutes (200 seconds). During the test, the display will show the BioCal<sup>™</sup> value changing as the power to the sensor is adjusted. "T=xx" is a BioCal<sup>™</sup> timer indicating how much time is left to finish the test.

#### **BioCal™ Test Results**


Upon test completion, the final BioCal<sup>™</sup> value will be displayed along with a "Pass," "Fail," or "Warning" message:

- Pass: less than ±0.80
- Warning: between ±0.80 to ±1.0
- Fail: greater than ±1.0

Recommended next steps if a "Warning" or "Fail" result is displayed:

- Run the test again under a higher flow rate if possible.
- Remove the probe from the pipe, clean the sensor, and perform the test again under a normal or high flow rate.

If a "Warning or "Fail" result is displayed after repeating the test, please call Sierra Customer Service at (831) 373-0200 for assistance.



Press **OK (F4)** to exit the menu when the test is complete.

### **BioSelect™** Available Gases and Gas Mixes

This menu allows the user to select a gas or Digester Gas Mix from a pre-calibrated list of gases available on the Sierra Instruments BioTrak 645S/745S flow meter. Gases available in the BioSelect™ feature include:


Air, Methane, and Digester Gas

After installing your 645S/745S flow meter, power up the device. When the meter finishes initializing, it will begin to monitor flow in the assigned gas and flow units.


# Accessing the BioSelect<sup>™</sup> Gas Selection Menu Feature

Enter the programming mode on the meter (refer to p. 48) and then follow these instructions to access the BioSelect<sup>TM</sup> feature:


<sup>\*</sup>The molar percent of the Digester Gas Mix is programmable in 0.1% increments.



Press FLO (F2) from the Main Menu to enter Flow Menu 1.




Press FM2 (F3) to get to Flow Menu 2.



Press **GAS** (**F1**) to access the BioSelect<sup>™</sup> feature.

# Choosing a Gas from the BioSelect™ Menu

The BioSelect<sup>™</sup> Menu will show one of the available gases/gas mixtures:



Press **NXT (F1)** to choose from a list of gases.


Choices are:

- Air
- Methane
- Digester Gas Mix = Mix of Carbon Dioxide and Methane; proportions must equal 100%


To choose "Air" or "Methane," cycle through the gas options until the desired gas is selected, then press **OK (F4)** to choose the gas.

### Operation


To create a "Digester Gas Mix," choose **Digester Gas** from the list and press **OK (F4)**.



The screen will show:




This screen shows the percentage of the gas mixture allocated to "Methane." In this case, it shows 40%. To program the specific mixture of "Methane," press **CHG (F1)**.




To set the percentage of "Methane" in the gas mix, press UP (F1) or DN (F2).


Once the desired "Methane" percentage is displayed, press **OK (F4)**. The display will move to the view of the concentration of Carbon Dioxide (CO2).



Once the desired gas percentages are programmed, press **OK (F4)**. One of the following messages will appear:



Shows only if no error is detected. Pressing OK allows exit to menu.




Shows only if gas mix does not equal 100%. Pressing OK returns to gas entry.



**NOTE!** The gas selection must be valid or the gas mix must have a valid 100% mixture before the user is allowed to exit.

Once the "Gas Mix (100%)" message appears, you have successfully programmed the gas mix in  $BioSelect^{TM}$  and can exit. Press **OK (F4)** to set the mixture.

The 645S/745S will begin to monitor flow based on the pre-calibrated algorithm for the gas selected in the BioSelect™ feature. The screen will show the flow in units and the total flow similar to the example below:



From normal operating mode, the gas selection can be seen on Display 3 (see p. 47).

Communications

# **Scope - Modbus Communications**

This portion of the manual describes the Modbus implementation using RS485 serial communication physical layer for the Sierra Instruments 645S/745S Thermal Mass Flow Meter based on the Modicon Modbus Protocol (PI-MBUS-300 Rev. J).

#### **Modbus Protocol**

Modbus Protocol is an application layer messaging protocol that provides client/sever communications between devices. Modbus is a request/reply protocol and offers services specified by function codes.

The size of the Modbus Protocol Data Unit is limited by the size constraint inherited from the first Modbus implementation on Serial Line network (max. RS485 Application Data Unit = 256 bytes). Therefore, Modbus PDU for serial line communication = 256 – Server address (1 byte) – CRC (2 bytes) = 253 bytes.

RS485 ADU = 253 + Server address (1 byte) + CRC (2 bytes) = 256 bytes.

For more information on Modbus go to the web site http://www.modbus.org/.

### Command Request:

- <Meter Address> <Function code> <Register start address high> <Register start address low> <Register count high> <Register count low> <CRC high> <CRC low>
- Command Response:

<Meter Address> <Function code> <Data byte count> <Data register high> <Data register low> ... <Data register high> <Data register low> <CRC high> <CRC low>



**NOTE!** The data shown in brackets < > represents one byte of data.

### **Modbus Indicators**

Green LED indicator LP3 cycles on and off to indicate that the 645S/745S is operating. Orange LED indicator LP2 blinks when Modbus signals are received and Yellow LED LP1 blinks when Modbus signals are transmitted. The LEDs are located behind the display panel.

# Modbus Function Codes Supported by the 645S/745S

The 645S/745S supports the following commands:

- 1) Command 03: Read multiple registers
- 2) Command 04: Read single register.
- 3) Command 06: Write single register
- 4) Command 16: Write multiple registers (limited to gas percentage register pairs)

### **Read Multiple Registers (command 03)**

This command reads one or more 16 bit registers from the 645S/745S and has the following format:

### Request:

<Meter Address > <Command code=03 > <Register start address high > <Register start address low > <Register count high > <Register count low > <CRC high > <CRC low >

### Response:

<Meter Address> <Command code=03> <Byte count> <Data high> <Data low> ... <Data high> <Data low> <CRC high> <CRC low>

Example: Request data register at starting address 0x0000 and specifying 2 registers

#### Response:

<0x01> <0x03> <0x04> <xx> <xx> <xx> <cRC high> <CRC low>

Where xx xx is the data register value.

# Communications

Table 5.1: 645S/745S Modbus Registers

Modbus Register	Data Type	Description	Units
40001	32-bit int LSW	Flow	User selected
40002	32-bit int MSW		
40003	32-bit int LSW	Flow Total	User selected
40004	32-bit int MSW		
40005	32-bit int LSW	Temperature x10	User selected x 10
40006	32-bit int MSW		
40007	32-bit int LSW	Elapsed time x 10	Hours x 10
40008	32-bit int MSW		
40009		Reserved	
40010		Reserved	
40011	16-bit int	Flow x 10 (flow scaled for 16 bits)	User selected x 10
40012	16-bit int	Flow x 100 (flow scaled for 16 bits)	User selected x 100
40013	16-bit int	Total x 100 (flow total scaled for 16 bits)	User selected x 100
40014		Reserved	
40015		Reserved	
40016	16-bit int	Status	
40017	16-bit int	Status 2	
40018	16-bit int	Control Register (Write Only): Reset Total = 2 Perform BioCal = 173 Abort BioCal = 174	
40019		Reserved	
40020	32-bit float LSW	Flow	User selected
40021	32-bit float MSW		
40022	32-bit float LSW	Total	User selected
40023	32-bit float MSW		
40024		Reserved	
40025		Reserved	
40026	32-bit float LSW	Temperature	User selected
40027			

Table 5.1: 645S/745S Modbus Registers (cont'd)

Modbus Register	Data Type	Description	Units
40028	32-bit float LSW	Elapsed time	Hours
40029	32-bit float MSW		
40030	32-bit float LSW	BioCal result	
40031	32-bit float MSW		
40032 - 40055		Reserved	



#### NOTES!

- In the table, LSW means Least Significant Word, and MSW means Most Significant Word. In this case a "word" is one 16-bit Modbus register. A 32-bit float or 32-bit integer is stored in a pair of Modbus registers. When a register is designated as "32-bit int LSW", it means that bits 0-15 of the variable are in that register. A register designated as MSW has bits 16-31 of the variable. For instance, the flow total can be read as a 32-bit integer from registers 40003 (LSW) and 40004 (MSW). If the flow total is 0x12345678, then register 40003 will hold 0x5678, and register 40004 will hold 0x1234. See the layout of a 32-bit floating point value on page 74.
- 32-bit floating point values are defined by the IEEE 754 standard: https://ieeexplore.ieee.org/document/8766229
- Refer also to Wikipedia: https://en.wikipedia.org/wiki/Single-precision\_floating-point\_format

#### Communications

# **Read Single Register (Command 04)**

This command is used to report the status information.

#### Request:

<Meter Address > <Command code=04> <Register address =0> <Register address =0> <Register count =0> <Register count =1> <CRC high> <CRC low>

# Response:

<Meter Address> <Command code=04> <Byte count =2> <Status High> <Status Low> <CRC high> <CRC low>

Table 5.2: Status Bits Definitions for Command 04, Modbus Address 40016

Bit	Definition	Comment		
0	Power up indication	Cleared when out of the power up sequence		
1	Flow rate reached high limit threshold	Set limit to zero to disable		
2	Flow rate reached low limit threshold	Set limit to zero to disable		
3	Temperature reached high limit threshold	Set limit to zero to disable		
4	Temperature reached low limit threshold	Set limit to zero to disable		
5	Sensor reading is out of range	Check sensor wiring		
6	Gas mix error	Gas mix must total 100%		
7	Incorrect Settings	Check settings		
8	In simulation mode	Set simulation value to 0 to disable		
9	Pulse/alarm output is out of range	Check pulse/alarm output settings		
10	Analog CH1 4-20mA is out of range	Check analog output settings		
11	Not used	Not used		
12	Not used	Not used		
13	Not used	Not used		
14	CRC error	Check parameters and reset CRC		
15	Error in Total	Reset total to clear alarm		

# Table 5.3: Status 2 Bits Definitions for Command 04, Modbus Address 40017

Bit	Definition	Comment
0	Pulse hardware	
1	Busy	
2	HART hardware	
3	Not used	
4	BioCal in process	
5	BioCal fail	
6	BioCal aborted	
7	BioCal warning	

# **Write Single Register (Command 06)**

This command is used to perform miscellaneous functions such as clearing the totalizer and elapsed time. The register address is Modbus=40018 and the data to write is described in table 5.1.

#### Request:

<Meter Address > <Command code=06> <Register address high=0x00> <Register address low=0x11> <Register data high=0x00> <Register data low =0x02> <CRC high> <CRC low>

#### Response:

<Meter Address> <Command code=06> <Register address =0x00> <Register address =0x11> <Register data=0x00> <Register data =0x02> <CRC high> <CRC low>

# **Write Multiple Registers (Command 16)**

This command is restricted to writing to the gas mix percentage settings in registers 40058 - 40061. Reference Table 5.5, pg 79. The preset single register command is not allowed to write to these registers. The percentage settings are 32-bit floating point numbers in units of percent. A setting of 12.7 means 12.7%.

#### Request message:

<Meter Address> <Command code=16 (0x10)> <Starting register address MSB> <Starting register address LSB> <Number of registers MSB> <Number of registers LSB> <Byte count> <Register data MSB> <Register data LSB> ... <Register data MSB> <Register data LSB> <CRC MSB>

#### Response message:

<Meter Address> <Command code=16 (0x10)> <Starting register address MSB> <Starting register
address LSB> <Number of registers high> <Number of registers low> <CRC LSB> <CRC MSB>

#### Floating point data layout

Each 32-bit floating point value uses two consecutive Modbus registers. The most significant byte of the lower numbered register holds the least significant byte of the significand. The least significant byte of the lower numbered register holds the next most significant byte of the significand. The most significant byte of the higher numbered register holds the sign bit and most significant 7 bits of the exponent. The least significant byte of the higher numbered register holds the least significant bit of the exponent and the most significant 7 bits of the significand.

#### Communications

In the following tables:

SO – S23 are the significand bits from least to most significant.

EO – E7 are the exponent bits from least to most significant.

Sign is 1 if the number is negative, and 0 if the number if positive.

Lower numbered register															
15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	0
S15	S14	S13	S12	S11	S10	S9	S8	S7	S6	S5	S4	S3	S2	S1	S0

High	Higher numbered register														
15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	0
Sign	E7	E6	E5	E4	E3	E2	E1	EO	S22	S21	S20	S19	S18	S17	S16

Since the Modbus register data is sent most significant byte first and the registers are sent lowest numbered first, a floating point value will look like this in the data stream:

First byte (MSB of lower register)									
Data bit	7	6	5	4	3	2	1	0	
Value bit	S15	S14	S13	S12	S11	S10	S9	S8	

Second byte (LSB of lower register)									
Data bit	7	6	5	4	3	2	1	0	
Value bit	S7	S6	S5	S4	S3	S2	S1	S0	

Third byte (MSB of higher register)									
Data bit	7	6	5	4	3	2	1	0	
Value bit	Sign	E7	E6	E5	E4	E3	E2	E1	

Fourth byte (LSB of higher register)									
Data bit	7	6	5	4	3	2	1	0	
Value bit	EO	S22	S21	S20	S19	S18	S17	S16	

Example: For Methane, register pair 40058-40059 must be set to 60. To set Carbon Dioxide to 40, use registers 40060-40061.

First you must set the Gas select code to 250 for Digester Mix, using a preset single register command to 40057. Then you will be able to set the gas percentages.

This requires setting the four registers 40058 through 40061. Register pair 40058-40059 will be set to 60.0, register pair 40060-40061 will be set to 40.0.

The message byte stream will be (bytes on the same line are sent leftmost first):

<0x01> Address = 1

<0x10> function = write multiple registers

<0x00> <0x39> start index = fifty seven, meaning register 40058

<0x00><0x04 register count = 4 (holding 2 32-bit floating point values)

<0x08> number of data bytes = 8

<0x00><0x00><0x42><0x70> value = 60.0% <0x00><0x00><0x42><0x20> value = 40.0%

<0xCA> <0x24> CRC

#### Response message:

<0x01> Address = 1

<0x10> function = write multiple registers


<0x00> <0x39> start index = fifty-seven = register 40058

<0x00><0x08> Number of data bytes written = 8


<0x10> <0x37> CRC

#### **Communication Protocol and Parameters**

To program the communication parameters, start at the **Main Menu**:




Then press I/O (F1) to set Inputs/Outputs:




Then press **COM (F1)** to select communication parameters.

Set Bus protocol for Modbus:



Press **NXT (F1)** repeatedly until "Modbus" is selected as shown and then press **OK (F4)** to accept the setting.

The following communication settings apply only to Modbus:



Press **NXT (F1)** repeatedly until the correct selection is shown then press **OK (F4)** to accept the setting.

Selections are: 115200 9600

76800 4800 57600 2400 38400 1200


19200



Press **NXT (F1)** repeatedly until the correct selection is shown and then press **OK (F4)** to accept the setting.

Selections are: NONE

ODD EVEN



Press CHG (F1) to change the address and then press OK (F4) to accept the setting.

Selections are between 01 and 247.



**NOTE!** Power cycle is required for the new settings to take effect.

# **Using Modbus to Program BioSelect™**

Modbus can be used to access and program gases/gas mixes in the BioSelect™ feature available on the BioTrak 645S/745S.

Communications

# Selecting 645S/745S Gases and Gas Mixes

Modbus register 40057 selects the gas which may be a pure gas (Air or Methane) or a Digester Gas Mix (Methane and CO2), will read the gas selection that was chosen. Writing to register 40056 will produce an error response. See the Gas Selection Codes table for the values to write.

Table 5.4: Gas Selection Codes

Selection Code	Gas
0	Methane
3	Air
250	Digester Gas

# **Setting Mix Percentages**

To set a custom gas mix, first set the Selection Code to 250 (Digester Gas). Next, go through each gas mix register and set the percentages to the desired 32-bit floating point values (see table 5.5 below, where these values are split in two 16-bit registers). Ensure that all gas percentages entered add up to exactly 100.0%. Do not write a custom gas percentage when the Selection Code is set to a pure gas (see codes 0 through 3 in Table 5.4 above).

Table 5.5: 645S Modbus Holding Registers for BioSelect™

40056	16-bit int	Gas type selection	See table of gas selection codes for
40057	16-bit int	Gas type selection	Modbus
40058	32-bit float LSW	Methane percentage	Percent (75%)
40059	32-bit float MSW		
40060	32-bit float LSW	Carbon Dioxide percentage	Percent (25%)
40061	32-bit float MSW		

#### **Scope - HART Communications**

The Sierra Instruments BioTrak 645S/745S transmitter complies with HART Protocol Revision 7.1. This section of the manual specifies all the device-specific features and documents HART Protocol implementation details (e.g., the Engineering Unit Codes supported). The functionality of this Field Device is described sufficiently to allow its proper application in a process and its complete support in HART-capable Host Applications.

# **Purpose**

This specification provides a complete description of this Field Device from a HART Communication perspective. The specification is designed to be a technical reference for HART capable Host Application Developers, System Integrators and knowledgeable End Users. It also provides functional specifications (e.g., commands and performance requirements) used during development, maintenance and testing. This document assumes the reader is familiar with HART Protocol requirements and terminology.

#### References

HART Smart Communications Protocol Specification. HCF\_SPEC-12. Available from the HCF.

#### **Device Identification**

Manufacturer Name:	Sierra Instruments Instruments	Model Name:	645S/745S
Manufacture ID Code:	165	Device Type Code:	57583 (EOEF Hex)
HART Protocol Revision:	7.1	Device Revision:	1
No. of Device Variables:	None		
Physical Layers Supported:	FSK		
Physical Device Category:	Transmitter, DC-isolated Bus Device		

#### **Product Overview**

The 645S/745S HART communication option can be monitored and configured using a HART master device or a hand-held communicator.

Communications

#### **Process Flow Rate 4-20mA Analog Output**

The 4-20mA output of the 645S/745S HART represents the process flow rate measurement, linearized and scaled according to the configured range of the instrument. This output corresponds to the Primary Variable. HART Communication is supported on this loop.

The 4-20mA output of the 645S/745S should be configured for flow rate when using HART. If the 4-20mA output is set to report temperature, HART communication will report the 4-20mA value for temperature rather than flow.

#### **HART Indicators**

Green LED indicator LP3 cycles on and off to indicate that the 645S/745S is operating. Orange LED indicator LP2 blinks when HART signals are received and Yellow LP1 blinks when HART signals are transmitted. The LEDs are located behind the display panel.


The orange LED indicator LP2 will be on continuously when HART communication is enabled and the 4-20mA wiring is not connected.

#### 645S/745S HART Communication Setup


HART communication must be selected in the 645S/745S Serial Communication menu for HART communication to operate. When this communication parameter is changed, power to the 645S/745S must be cycled for it to take effect.

#### **Communication Protocol and Parameters**

To program the communication parameters, press I/O (F1) key from the Main Menu.




This is the Main Menu for the programming mode. To exit the programming mode, press **EXIT (F4)** repeatedly until "Normal Mode" is seen briefly. Choose **I/O (F1)** to access the communication output.



Then press **COM (F1)** to select communication parameters.

Set Bus protocol for HART:



Press NXT (F1) until HART is selected as shown and then press OK (F4) to accept the setting.



**NOTE!** Power cycle is required for the new settings to take effect.

Variable	Meaning	Units
PV	Flow Rate	In Selected Units
SV	Total	In Selected Units
TV	Temperature	In Selected Units
QV	Elapsed Time	In Hours

# **Dynamic Variables**

Four Dynamic Variables are implemented.

#### **Status Information**

#### **Device Status**

Bit 4 ("More Status Available") is set when any failure is detected. Command #48 provides additional detail.

# **Extended Device Status**

This bit is set if a sensor error is detected. "Device Variable Alert" is set if the Primary Variable (PV) is out of limit.

# **Additional Device Status (Command 48)**

Command #48 returns 2 Device-Specific Status bytes of data, with the following status information: These bits are set when an alarm or error condition is present. The bit automatically clears when the condition returns to its normal state.

Byte	Bit	Meaning	Class
0	0	Power Up Indication	Status
	1	High Flow Limit Alarm	Alarm
	2	Low Flow Limit Alarm	Alarm
	3	High Temperature Limit Alarm	Alarm
	4	Low Temperature Limit Alarm	Alarm
	5	Sensor out of range	Error
	6	Mix Error Alarm	
	7	Check Parameter Settings Error	

1	0	In Simulation Mode	Alarm
	1	Frequency output out of range	Alarm
	2	CH 1 4-20mA out of range	Alarm
	3	Not used	
	4	Not used	
	5	Not used	
	6	CRC database error	Error
	7	Error with Total	Error

# **Common-Practice Commands, Supported Commands**

The following common-practice commands are implemented:

- Write Primary Variable (PV) Damping Value
- 35 Write PV Range Value
- 36 Set PV Upper Range Value
- 37 Set PV Lower Range Value
- 38 Reset "Configuration Changed" Flag
- 40 Enter/Exit Fixed Current Mode
- 44 Write PV Units
- 45 Trim Loop Minimum
- 46 Trim Loop Maximum
- 48 Read Additional Device Status (Command #48 returns 2 bytes of data)
- Write Number of Response Preambles

# **Common-Practice Commands, Unsupported Commands**

**Burst Mode -** This device does not support Burst Mode.

Catch Device Variable - This device does not support Catch Device Variable.

**Device-Specific Commands -** No Device-Specific commands are implemented.

#### Modes

Fixed current mode is implemented, using Command 40. This mode is cleared by power loss or reset.

# **Damping**

Damping is standard, affecting only the PV and the loop current signal.

# **Capability Checklist**

Manufacturer, model	Sierra Instruments, 645S/745S
Device Type	Transmitter
HART revision	7.1
Device Description available	No
Number and type of sensors	1
Number and type of actuators	0
Number and type of host side signals	1: 4-20mA analog
Number of Device Variables	0
Number of Dynamic Variables	4
Mappable Dynamic Variables	No
Number of common-practice commands	17
Number of device-specific commands	0
Bits of additional device status	8
Alternative operating modes	No
Burst mode	No
Write-protection	Yes

Maintenance

#### **PRECAUTIONS**



**WARNING!** BEFORE ATTEMPTING ANY MAINTENANCE, TAKE THE NECESSARY SAFETY PRECAUTIONS BEFORE REMOVING THE PROBE FROM THE DUCT (EXAMPLE: PURGE LINES OF TOXIC AND/OR EXPLOSIVE GAS, DEPRESSURIZE, ETC...).

**WARNING!** EXPLOSION HAZARD. DO NOT REMOVE OR REPLACE COMPONENTS OR FUSES UNLESS POWER HAS BEEN SWITCHED OFF WHEN A FLAMMABLE OR COMBUSTIBLE ATMOSPHERE IS PRESENT.

**WARNING!** EXPLOSION HAZARD. DO NOT DISCONNECT EQUIPMENT WHEN A FLAMMABLE OR COMBUSTIBLE ATMOSPHERE IS PRESENT.

#### **Access to Electronics**

Accessing electronics is not normally required for maintenance purposes. If a loose connection is suspected, unscrew the cap of the meter to access the wiring terminations.



**CAUTION!** BE SURE POWER TO METER IS SWITCHED OFF BEFORE ATTEMPTING TO ACCESS ELECTRONICS. If there is a problem and a loose connection is not found, please contact Sierra Instruments Customer Service for technical assistance at (831) 373-0200.

### **Broken or Damaged Probe**

If the sensor is broken or damaged, the probe and electronics must be returned to the factory. A new sensor will be installed and calibrated. Refer to "Returning Your Meter" on p. 104.

#### Flow Calibration and Calibration Validation

To ensure high accuracy of your BioTrak 645S/745S Thermal Mass Flow Meter, Sierra Instruments provides a full NIST traceable calibration. It is recommended that the meter's accuracy be checked annually by performing the BioCal™ Calibration Validation test.

#### **Fuse Replacement**



**WARNING!** Turn input power OFF before removing or installing a fuse. Use only recommended fuse replacements.

Verify the fuse is defective by measuring it with an Ohm Meter (Two replacement fuses are provided with each unit). Replacement fuse is Littelfuse part number 0454.750MR

# To replace the fuse:

The fuse F1 is located near the power terminal block and can be removed by using tweezers or needle-nose pliers.

#### **Sensor Cleaning**

The sensor is insensitive to small amounts of residue, but continued use in dirty environments will require periodic cleaning. To inspect the sensor, remove power from electronics and remove the unit from the pipe or duct, exposing the sensor elements. If they are visibly dirty, clean them with water or alcohol (ethanol) using an appropriate brush until they appear clean again. Even though the sensor elements are rugged, avoid touching them with any solid object and use a light touch while cleaning them.

# Instructions for Removing and Inserting the Meter from a Pressurized Pipe using the Retractor


- **WARNING!** Possible injury or damage to equipment may occur if the retractor is not used correctly. Please read the following instructions carefully prior to using the retractor.
- **CAUTION!** Never remove the restraint cable without first closing the Ball Valve and bleeding off pressure.
- **WARNING!** When working with the retractor, do not stand or position any part of your body in the path of the flow meter. An injury may occur if the probe is forced outward by system pressure.

#### How to Remove the Meter from the Retractor (System Pressurized)

#### **Step 1 - Remove the Probe from the Flow Stream**

- 1. Disconnect power from the meter.
  - **NOTE!** At 150 psig of max system pressure, the probe will have approximately 66 lbs. of force pushing it out.
- 2. System pressure may force the probe out of the retractor when the compression nut is loosened. Hold the flow meter to counteract the force of the system pressure, and carefully loosen and unscrew the compression nut.
- 3. While supporting the meter, slowly slide the probe out of the retractor until the restraint cable is taut.
- 4. Close the ball valve all the way.
  - CAUTION! At this point there is still pressure inside of the retractor.


Figure 6.1

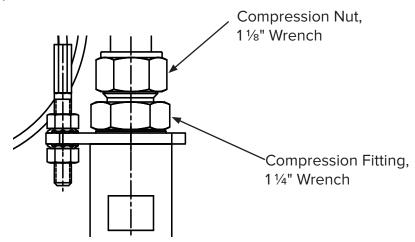

# **Step 2 - Remove the Probe from the Retractor Body**

- 5. After removing the probe from the flow stream (#1-4 on previous page), slowly loosen the compression fitting (see figure 6.1), until the pressure in the retractor is relieved.
- 6. Retighten the compression fitting.
- 7. Remove the Collar Clamp by using a 3/16" Hex Key.
- 8. Carefully slide the probe out of the retractor while supporting the meter.


Figure 6.2

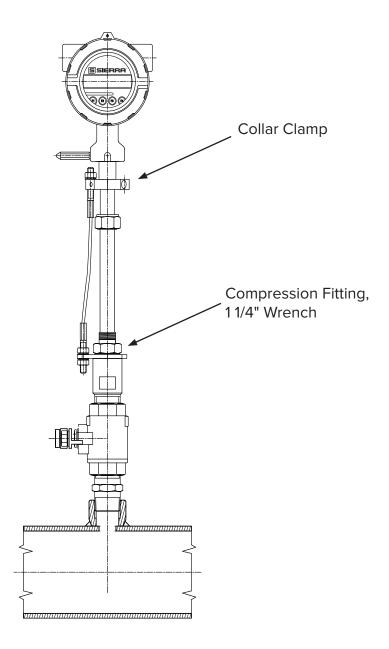

# How to Insert the Probe into the Flow Stream (Valve closed, System Pressurized)


- 1. Carefully, slide the probe into the retractor.
- 2. Install the collar clamp just below the collar spacer, and tighten it in place on the probe. Slide the probe back out of the retractor until the cable is straight and taut.

Figure 6.3

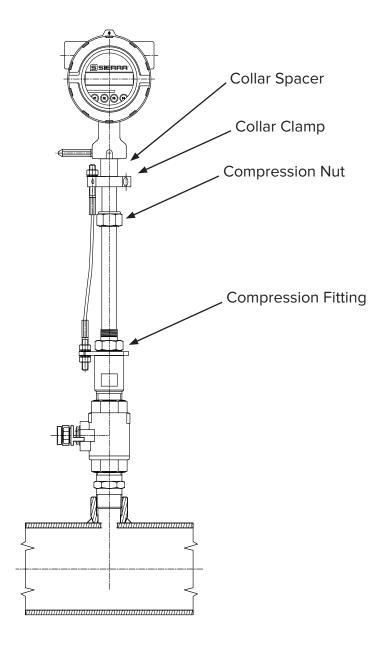

- 3. Slowly open the ball valve to the full open position. Push the meter and probe into the pipe, then hand tighten the compression nut onto the compression fitting.
- **NOTE!** At a maximum system pressure of 150 psig, the force required to push the probe in place to tighten the compression nut will be approximately 66 lbs.
- 4. Verify that the probe is aligned with the center line of the pipe, and pointed in the direction of flow.

Figure 6.4

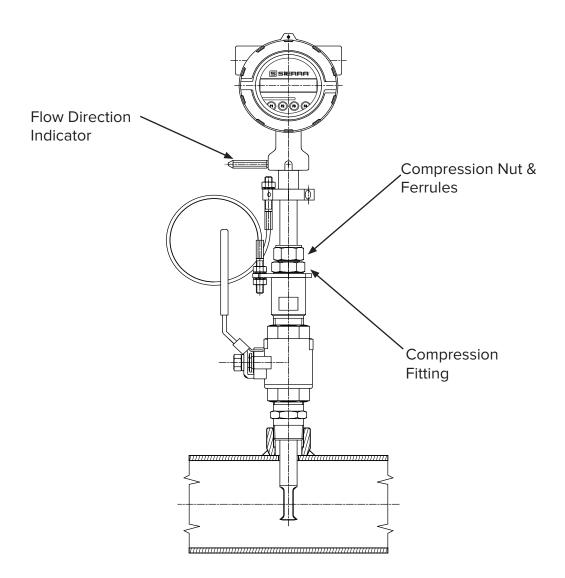

- 5. Secure the probe in place by tightening the compression nut with a  $1\frac{1}{8}$ " wrench and a  $1\frac{1}{4}$ " wrench on the compression fitting. See p. 27 of the manual for detailed instructions to tighten the compression nut.
- 6. Power may now be applied to the meter.



# **Troubleshooting**



**CAUTION!** The electronics and sensor supplied by Sierra Instruments are calibrated as a single precision mass flow meter. Interchanging sensors will decrease the accuracy of the flow meter. If you experience any problem with your BioTrak 645S/745S, call Sierra Instruments Customer Service Department, Technical Assistance at (831) 373-0200.

Problem	Possible Cause	Action
Meter does not initialize	<ol> <li>Malfunction in flow meter</li> <li>Electromechanical interference</li> </ol>	<ol> <li>Return flow meter to Sierra Instruments for repair (Refer to p. 104 for shipping instructions)</li> <li>Check meter power cycles.</li> <li>Press and release F1 and F2 at the same time; the display will enter Engineering screens.</li> <li>Press F1 to get to screen #23; record power cycle value.</li> <li>Press F4 to return to normal operation; monitor meter until problem returns.</li> <li>Return to screen #23 to see if power cycles have increased; microprocessor is resetting due to EMI electrical noise entering the meter.</li> <li>Check Power input and output cables grounding and routing.</li> </ol>
Flow measurement is erratic or fluctuating	<ol> <li>Very turbulent flow</li> <li>Sensor dirty</li> <li>Sensor broken</li> <li>Probe not mounted securely</li> <li>Malfunction in flow meter</li> <li>Meter installed incorrectly</li> </ol>	<ol> <li>Increase dampening (see filter settings in "Flow Parameters" on p. 58)</li> <li>Clean sensor (Refer to Maintenance section, p. 87)</li> <li>Return flow meter to Sierra Instruments for repair (Refer to p. 104 for shipping instructions)</li> <li>Remount probe (see Installation section, p. 23); must be mounted securely without vibration. If vibration persists, choose a new mounting location without vibration.</li> <li>Return flow meter to Sierra Instruments for repair (Refer to p. 104 for shipping instructions)</li> <li>Re-install meter according to instructions (Refer to installation section, p. 23)</li> </ol>



Problem	Possible Cause(s)	Action(s)
Display Error	1. Loose or damaged	1. Visual inspection.
	ribbon cable 2. Damaged electronics	2. Return the meter or display for repair.
	3. Ambient temperature	3. Operate meter between -20 to 70°C
Flow measure- ment seems low	Probe not oriented properly	1. Orient probe per installation sections: Insertion (p. 29)
	2. Sensor dirty	2. Clean sensor (p. 87)
Unit will not	1. No power input	1. Check fuse (F1) located next to TS1 on main
power-up	2. Bad fuse	board.
	3. Bad Power supply	2. Check for correct power supply voltage at TS1 on main board.
		If fuse is OK and unit still won't power up, call Sierra Instruments for additional assistance

# **Troubleshooting BioCal**<sup>™</sup>

If the 645S/745S Meter fails a BioCal™ Calibration Validation test, there are a few reasons that could be the cause:

- 1. Flow rate in the pipe:
  - Run the test again under a higher flow rate if possible.
- 2. The sensor may be dirty or damaged:
  - Visually inspect the meter for damage. If damage is found, meter may need to be serviced. Contact Sierra Instruments Technical Assistance at techsupport@sierrainstruments.com for more information.
  - Try cleaning the sensor and try the test again under flow conditions.
- 3. If the meter fails again, contact Sierra Instruments Technical Assistance at 831-373-0200 for more information.

#### Troubleshooting



#### **Installation Problems**

The following is a summary listing of problems that may be encountered with the installation of the 645S/745S Thermal Mass Flow Meter.

- Improper wiring connections.
   Refer to Figures 3.1 to 3.11 and "Wiring Precautions" in Wiring section (p. 35) for further guidance.
- 2. Inadequate power source.
  - The 645S/745S requires 12 to 28VDC at to 6 Watts to operate. A 20 Watt power supply is recommended for powering the 645S/745S to ensure it operates properly under all temperature ventilation, and power on conditions. If the voltage supplied at the input terminals of the 645S/745S is not within the range of 10VDC to 30VDC, a variety of problems can occur including a dim display, inaccurate flow readings or faulty 4-20mA, pulse and communication interface.
- 3. Flow measurement seems inaccurate.
  - Check to ensure that the flow meter is installed so that the Flow Direction Indicator is pointing in the direction of flow. Refer to Figure 2.6 (p. 29). If not, change orientation of meter.
  - Check that the insertion depth of the sensor/probe is correct. The end of the probe should be adjusted as per Figure 2.5 (p. 26).
  - Ensure that there are a minimum of fifteen diameters of straight pipe upstream of the sensor and ten diameters downstream. If complex flow disturbances are upstream of the sensor, extension of the straight pipe may be required to ensure accurate flow measurement. Contact Sierra Instruments for assistance.
  - Ensure that pipe inside diameter in the meter matches data on the Sierra Instruments Calibration Certificate. The pipe inside diameter is programmed into the flow meter through the front panel (see Flow Parameters, p. 58).
- 4. Erratic flow reading (especially a flow reading spiking high).
  This may be a symptom of moisture in the flow stream. Sierra Instruments flow meters are designed to work in relatively dry gas applications only. Contact Sierra Instruments to discuss resolutions to this problem.
- 5. Flow meter is not responding to flow.
  - Check to ensure adequate power is supplied to the flow meter. If things appear to be correct, perform this functional test before calling Sierra Instruments. Carefully remove the probe and sensor from the pipe. For those flow meters with a display and if the display is reading zero blow on the sensor to see if a response occurs. If nothing happens, take a damp rag or sponge and place it in contact with the sensor. A reading should occur. Contact Sierra Instruments Customer Service with this information.
- 6. Display and/or 4-20mA signal reading above zero flow when no flow is occurring in the pipe. If the reading is less than 5% of full scale, it is likely this is a normal condition caused by convection flow created by the heated sensor. It does not mean that the zero of the instrument is improperly set. The Sierra Instruments sensor is extremely sensitive to gas flow and can even read the small flow caused by convection. If this is an unacceptable condition, please contact Sierra Instruments Customer Service for alternatives.



# **Alarm Codes**

Alarm Code	Reason	Action	
13	Flow rate above high limits	Refer to the FLOW MENU 2 section on p. 58 of this Manual to verify limit is within range. Check ALM = HiFloAlm under PRM.	
14	Flow rate below low limits	Refer to the FLOW MENU 2 section on p. 58 of this Manual to verify limit is within range. Check ALM = LoFloAlm under PRM.	
15	Temperature above high limits	Refer to the FLOW MENU 2 section on p. 58 of this Manual to verify limit is within range. Check ALM=HiTempAlm under PRM.	
16	Temperature below low limits	Refer to the FLOW MENU 2 section on p. 58 of this Manual to verify limit is within range. Check ALM = LoTempAlm	
22	Sensor out of range	Check the CSV voltage in ENG menu of the Engineering Screens, refer to page 18. It should be approximately 0.04 volts when 645S/745S is measuring no flow and up to 0.25 volts at high flow.  Verify that parameters in 645S/745S are set correctly. If BioTrak View is available, check parameter settings in Configuration page. If using 645S/745S front panel, check parameters in UNIT menu of FLOW MENU 1 and PRM menu of FLOW MENU 2, refer to pages 13-14.	
23	Gas mix error	Gas mix must equal 100%.	
24	Check settings	One or more internal settings are corrupted or out of spec. Contact Sierra Instruments Service for instructions to verify settings.	
25	Simulation mode	Meter is in Simulation Mode. Refer to the FLOW MENU 1 section on p. 60 of this Manual. Use the SIM Section under Diagnostics to return to normal operation.	
26	Pulse/alarm output over range	Refer to the DIGITAL OUTPUT MENU on p. 12 of this Manual. Verify the Pulse/alarm Output settings are within limits.	
32	4-20mA is out of range	Refer to the MAIN MENU on p. 11 of this Manual. Use the Set I/O section to verify range limits.	
34	Busy	Meter is recalculating new parameters.	
36	Database CRC Error	Refer to the Reset CRC section on p. 63 of this manual. Verify the programmed values are verified and corrected before clearing the error. Contact Sierra Instruments Service Department for possible causes.	

**Appendix** 

# **Performance Specs**

Flow Accuracy:

±2% full scale

Accuracy specification applies to customer's selected flow range

Maximum range: 15 to 25,000 SFPM (0.07 to 118 NMPS) Minimum range: 15 to 500 SFPM (0.07 to 2.4 NMPS)

Straight, unobstructed pipe requirement

Insertion Meters: 15 diameters upstream; 10 downstream

Inline Meters: 8 diameters upstream; 4 downstream

Insertion Meters with Flowtrak: 5 diameters upstream; 5 downstream

Flow Repeatability: ±0.2% of full scale

Flow Response Time: 0.8 seconds (one time constant)

Temperature Accuracy: ±1° F (±0.6° C)

Calibration:

Factory Calibration to NIST traceable standards

BioCal™: In-situ, operator-initiated calibration validation

# **Operating Specs**

BioSelect™ Gas Selections:

Air, Methane, and Digester Gas

Units of Measurement (field selectable):

SCFM, SCFH, NM3/M, NM3/H, NM3/D, NLPS, NLPM, NLPH, MCFD, MSCFD, SCFD, MMSCFD, MMSCFM, SM3/D, SM3/H, SM3/M, LB/S, LB/M, LB/H, LB/D, KG/S, KG/M, KG/H, SLPM, MT/H

Gas Pressure (maximum at 100° F):

645S Insertion Meters: 740 psiq (51.02 barq)

316 SS 745S inline meter with NPT ends: 500 psig (34.47 barg)

316 SS 745S inline meter with 150 lb. flanges: 230 psig (15.86 barg)

Carbon steel 745S inline meter with NPT ends: 500 psig (34.47 barg)

Carbon steel 745S inline meter with 150 lb. flanges: 285 psig (19.65 barg)



**NOTE!** The EU Pressure Equipment Directive (PED) requires that the minimum ambient and fluid temperature rating for carbon steel flow bodies not be below -29°C.

Retractor Assembly: 150 psig (10.34 barg) Check with factory for higher pressure options.

\*NOTE! When teflon ferrule option ordered, gas pressure is 60psig (4.1 barg) maximum

Relative Humidity: 90% RH maximum; non-condensing

**NOTE!** Condensing liquids contacting the sensor can cause erratic flow indication.

# **Operating Specs (cont'd)**

Temperature:

DigiSense™ Sensor: -40°F to 250°F (-40°C to 121°C)

Enclosure: -40°F to 158°F (-40°C to 70°C)\*

\*NOTE! Display dims below -4°F (-20°C), function returns once temperature rises again.

Flow Velocity Range:

15 to 25,000 SFPM (0.07 to 118 NMPS) Turndown: up to 1000:1; 100:1 typical

Maximum Flow Ranges for 645S Insertion Flow Meters			
Pipe Diameter	SCFM	MSCFD	NM <sup>3</sup> /hr
1.5" (40mm)	0-354	0-510	0-558
2" (50mm)	0-583	0-840	0-920
2.5" (63mm)	0-830	0-1,310	0-1,200
3" (80mm)	0-1,280	0-1,840	0-2,020
4" (100mm)	0-2,210	0-3,180	0-3,480
6" (150mm)	0-5,010	0-7,210	0-7,910
8" (200mm)	0-8,680	0-12,500	0-13,700
10" (250mm)	0-13,600	0-19,600	0-21,450
12" (300mm)	0-19,400	0-27,900	0-30,600

**NOTE!** To determine if the 645S will operate accurately in other pipe sizes, divide the maximum flow rate by the pipe area. The application is acceptable if the resulting velocity is within the velocity range above.

Maximum Flow Ranges for 745S Inline Flow Meters			
Size	SCFM	MSCFD	NM <sup>3</sup> /hr
0.75"	0-93	0-134	0-146
1"	0-150	0-216	0-237
1.25"	0-260	0-374	0-410
1.5"	0-354	0-510	0-558
2"	0-583	0-840	0-920
2.5"	0-830	0-1,310	0-1,200
3"	0-1,280	0-1,840	0-2,020
4"	0-2,210	0-3,180	0-3,480
6"	0-2,500	0-3,600	0-3,950

**NOTE!** Standard conditions of air at 70°F and one atmosphere. Consult factory for other gases and for flow ranges above those listed. Inline meters above 2,500 SCFM (3,950 NM3/H) air may require third party calibration. Contact Sierra Instruments.

**Appendix** 

# **Operating Specs (cont'd)**

Input Power: 12 to 24VDC, 6 watts

- Full Input Power Range: 10 to 30VDC.
- A 20 Watt or greater power supply is recommended to power the 645S.
- Class I Equipment (Electrical Grounding Required for Safety).
- Installation (Over-voltage) Category II for transient over-voltages.

#### **Outputs:**

#### Channel 1:

- Standard isolated 4-20mA output configured to indicate flow; fault indication per NAMUR NE43.
- The 4-20mA load resistance must be 125 ohms or less when operating on 12 volt power and 600 ohms or less on 24 volt power.
- HART communication option

#### Channel 2:

645S/745S can be ordered with either the pulse output or serial communication option.

- Pulse option: Isolated open collector output rated for 5 to 24VDC, 20mA maximum load, 0 to 100Hz (the pulse output can be configured to either transmit a 0 to 100hZ signal proportional to flow rate or an on/off alarm).
- Serial communication option: Isolated Modbus RTU (RS485).

#### **USB** Communication:

- Isolated USB 2.0 for interfacing with a laptop or computer is standard.
- BioView Software™: A free PC-based software tool that provides complete configuration, remote process monitoring, and data logging functions through USB communication.

#### 4-20mA and Loop Verification:

Simulation mode used to align 4-20mA output with the input to customer's PLC/DCS.

#### **Physical Specs**

Probe diameter: 3/4"

#### Sensor material:

316 stainless steel

#### **Enclosure:**

NEMA 4X (IP67), aluminum, dual 3/4" FNPT conduit entries.

# **Agency Approvals**

CE: Approved

EMC Directive; 2014/30/EU

Electrical Equipment for Measurement, Control and Lab Use: EN61326-1:2013

Pressure Equipment Directive: 2014/68/EU

Weld Testing: EN ISO 15614-1 and EN ISO 9606-1, ASME B31.3

#### FM (FM21US0123X) and FMc (FM21CA0089X): Approved

Class I, Division 1, Groups B,C,D;

Class II, Division 1, Groups E,F,G;

Class III, Division 1; T4, Ta =  $-40^{\circ}$ C to  $+70^{\circ}$ C;

Class 1, Zone 1, AEx/Ex db IIB + H2 T4 Gb; Ta = -40°C to +70°C; Type 4X, IP66/67

#### ATEX (FM23ATEX0041X): Approved

II 2 G Ex db IIB + H2 T4 Gb Ta =  $-40^{\circ}$ C to +70°C; IP66/67 II 2 D Ex tb IIIC T135°C Db Ta =  $-40^{\circ}$ C to +70°C; IP66/67

#### IECEx (IECEx FMG 23.0019X): Approved

Ex db IIB + H2 T4 Gb Ta =  $-40^{\circ}$ C to +70°C; IP66/67 Ex tb IIIC T135°C Db Ta =  $-40^{\circ}$ C to +70°C; IP66/67

#### ATEX and IECEx Standards:

EN IEC 60079-0 IEC 60079-0 EN 60079-1 IEC 60079-1 IEC 60079-31 EN 60529 +A1 +A2 IEC 60529

#### **Specific Conditions of Use:**

- 1. The flameproof joints of the equipment are not intended to be repaired. Consult the manufacturer if dimensional information on the flameproof joints is necessary.
- 2. Refer to the manufacturer's instructions to reduce the potential of an electrostatic charging hazard on the equipment enclosure.

Fig. 7.1: 645S Insertion Meter with Retractor Dimensions Measurements shown in inches (millimeters).

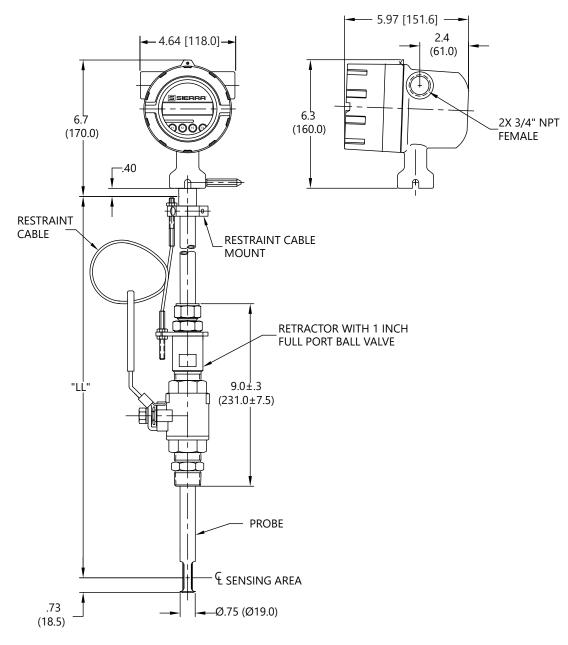


Table 7.1: 645S Insertion Meter with 316 stainless steel probe

Probe Size	Probe Size	Dimension "LL" ± .10
[model code]	[inches]	[inches / millimeters]
15R	15"	15.0" (381mm)
18R	18"	18.0" (457mm)
24R	24"	24.0" (610mm)
30R	30"	30.0" (762mm)
36R	36"	36.0" (914mm)

Fig. 7.2: 645S Insertion Meter Dimensions

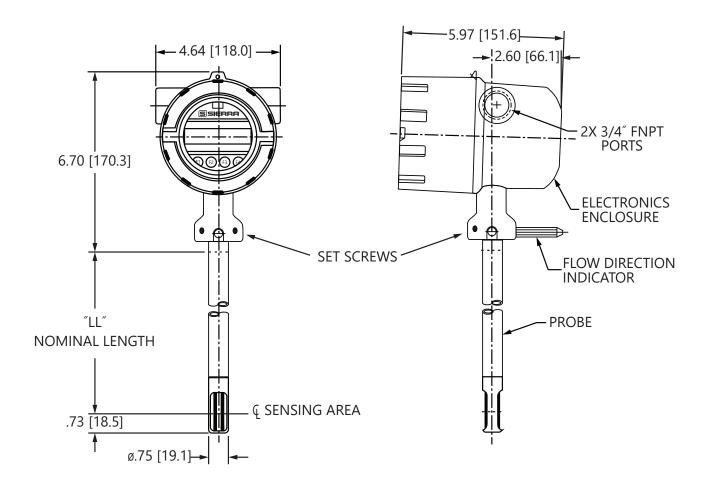


Table 7.2: 645S Insertion Meter with 316 stainless steel probe

Probe Size	Probe Size	Dimension "LL" ± .10
[model code]	[inches]	[inches / millimeters]
061	6"	6.0" (152mm)
091	9"	9.0" (229mm)
121	12"	12.0" (305mm)
151	15"	15.0" (381mm)
181	18"	18.0" (457mm)
241	24"	24.0" (610mm)
301	30"	30.0" (762mm)
361	36"	36.0 " (914mm)

Fig. 7.3: 745S Inline Meter with Flow Body NPT End Connections Dimensions

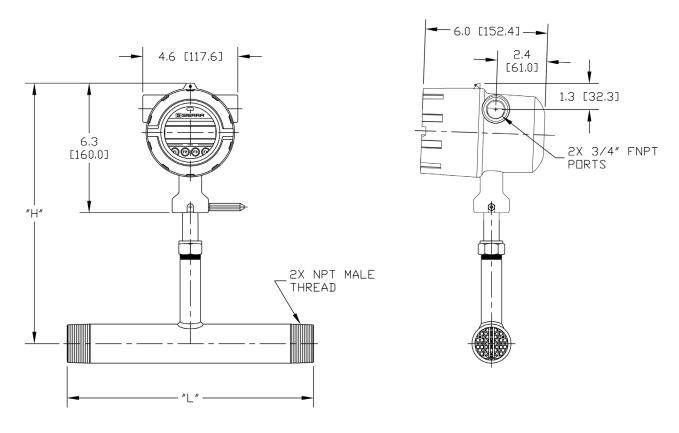


Table 7.3: 745S Inline Meter with Flow Body and NPT End Connections

Body Size	Body Size	Dimension "L" +/10	Dimension "H" +/25
[model code]	[inches]	[inches]	[inches / millimeters]
075P *	0.75"	12"	10.7" (271.8mm)
10P *	1.00"	12"	10.7" (271.8mm)
125P *	1.25"	12"	10.7" (271.8mm)
15P *	1.50"	12"	12.7" (322.6mm)
20P **	2.00"	12"	12.7" (322.6mm)
25P **	2.25"	18"	12.7" (322.6mm)
30P **	3.00"	18"	12.7" (322.6mm)

<sup>\*</sup>available in 316 stainless steel only

<sup>\*\*</sup>available in 316 stainless steel or A106 Grade B Carbon steel pipe

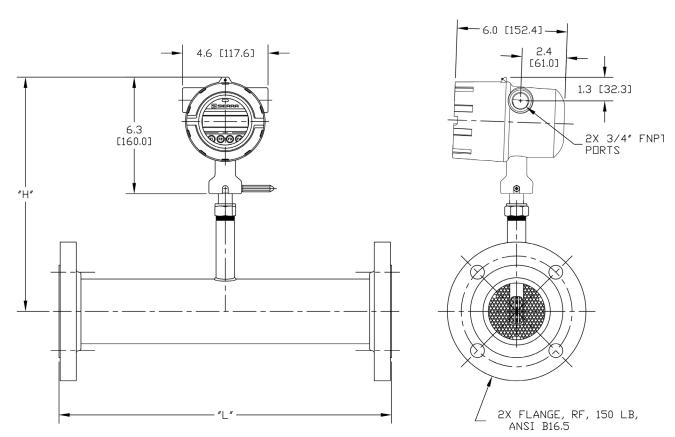


Fig. 7.4: 745S Inline Meter with Body 150 lb RF Flange End Connections Dimensions

Table 7.4: 745S Inline Meter with Flow Body and 150 lb RF Flange End Connections Dimensions

Body Size	Body Size	Dimension "L" +/10	Dimension "H" +/25
[model code]	[inches]	[inches]	[inches / millimeters]
075F *	0.75"	12"	10.7" (271.8mm)
10F *	1.00"	12"	10.7" (271.8mm)
125F *	1.25"	12"	10.7" (271.8mm)
15F *	1.50"	12"	12.7" (322.6mm)
20F **	2.00"	12"	12.7" (322.6mm)
25F **	2.50"	18"	12.7" (322.6mm)
30F **	3.00"	18"	12.7" (322.6mm)
40F **	4.00"	18"	12.7" (322.6mm)
60F **	6.00"	24"	12.7" (322.6mm)

<sup>\*</sup>available in 316 stainless steel only

<sup>\*\*</sup>available in 316 stainless steel or A106 Grade B Carbon steel pipe

# **Warranty Policy**

# **Limited Warranty Policy- Register Online**

All Sierra products are warranted to be free from defects in material and workmanship and will be repaired or replaced at no charge to Buyer, provided return or rejection of product is made within a reasonable period but no longer than one (1) year for calibration and non-calibration defects, from date of delivery. To assure warranty service, customers must register their products online on Sierra's website. Online registration of all of your Sierra products is required for our warranty process. Register now at www.sierrainstruments.com/register.

# **Returning Equipment to Factory**

# **Factory Calibration—All Models**

Sierra Instruments maintains a fully-equipped calibration laboratory. All measuring and test equipment used in the calibration of Sierra transducers are traceable to NIST Standards. Sierra is ISO-9001 registered and conforms to the requirements of ANSI/NCSL-Z540 and ISO/IEC Guide 25.

### **Instructions for Returning Your Instrument for Service**

The following information will help you return your instrument to Sierra Instruments' Factory Service Center and will ensure that your order is processed promptly. Prices may vary depending on the flow range, type of gas and operating pressure of your unit. To request detailed pricing, contact your local Sierra Instruments distributor or contact one of our offices directly.

# Please follow these easy steps to return your instrument for factory service:

- 1. To obtain a Return Materials Authorization (RMA) number from the Sierra Instruments to http://www.sierrainstruments.com/rma/new.php to create a Sierra Account.
- 2. Once you have created an account, click on the Submit New RMA tab and fill in the RMA form and follow the instructions. You will receive an email confirmation once you have submitted your RMA.
- 3. Print a copy of the RMA (that now includes RMA #) and send a copy of the RMA form along with your meter back to the factory.

If you require service beyond calibration, but do not know which service(s) will be required, describe the symptoms as accurately as possible on the RMA form.

**Appendix** 

Pack your instrument carefully. Use the original packaging and foam or bubble wrap (packing peanuts NOT recommended) and include a copy of the RMA form (complete with Sierra supplied RMA number) with the unit(s).

Ship the unit(s) to the following address:

Sierra Instruments, Inc.
Attention: Factory Service Center
5 Harris Court, Building L
Monterey, CA 93940 USA
RE: RMA# (your number)

Appendix

# **Glossary of Terms and Definitions**

and Technology

AWG	American Wire Gauge	NL	Normal Liter
Bara	Bar absolute	NLPH	Normal Liter per Hour
BioC	BioCal	NLPM	Normal Liter per Minute
BioS	BioSelect	NM3	Normal cubic Meter
CTC	Contact	NM3/H	Normal cubic Meter per Hour
CAL	Calibration	NM3/M	Normal cubic Meter per Minute
CHG	Change	NPT	National Pipe Thread
COM	Communication	PC	Personal Computer
CSV	Current Sense Voltage	P/U	Pulse per Unit
DC	Direct Current	PIP A^2	Pipe Area
DCS	Distributed Control System	PLC	Programmable Logic
DN	Down		Controller
DSP	Display	PRM	Parameters
ELP	Elapsed time	PRS	Pressure
Feq	Frequency	PSIA	Pounds per Square Inch
Ft^2	Square Feet		Absolute
I/O	Input/Output	Pt	Point
INP	Input	PSW	Password
LB	Pound	SIM	Simulation
LB/D	Pound per Day	SCF	Standard Cubic Feet
LB/H	Pound per Hour	SCFM	Standard Cubic Feet per
LB/M	Pound per Minute		Minute
LB/S	Pound per Second	SCFH	Standard Cubic Feet per Hour
LCD	Liquid Crystal Display	SCFD	Standard Cubic Feet per Day
KG	Kilogram	SPC	Special Control
KG/H	Kilogram per Hour	STP	Standard Temperature and
KG/M	Kilogram per Minute		Pressure
KG/S	Kilogram per Second	TMP	Temperature
M^2	Square Meter	TSI	Internal Variable
mmHG	Pressure in millimeters of mercury	TSV	Internal Variable
MMSCFD	Million Standard Cubic Feet per Day	UNT	Unit
MXFLO	Maximum Flow	U/P	Unit per Pulse
NEMA	National Electrical	420	4-20mA output
	Manufactures Association		
NIST	National Institute of Standards		

# Index

Access to Electronics, p. 35	Power Input Wiring, p. 37		
Alarm Codes, p. 95	Preventative Maintenance, p. 87		
Alarm wiring, p. 41	Product Description, p. 19		
Analog 4-20mA output, p. 49	Programming		
Breakage or Damage of Probe, p. 88	Analog 4-20mA Output, p. 49		
BioCal™, p. 96	Alarm Output, p. 52		
BioSelect™, p. 65	Changing values or strings, p. 48		
Dimension Details, p. 100	Display Setup, p. 54		
Discrete output setting, p. 52	Flow Parameters, p. 58		
Display Screens, p. 47	Flow and maximum pulse/alarm, p. 52		
Display Setup, p. 54	Pulse/alarm Output, p. 51		
Entering the programming mode, p. 48	Password, p. 55		
Filter value, p. 48	Programming Mode, p. 48		
Flow Meter Placement, p. 23	Pulse-per-unit, p. 51		
Flow Units, p. 56	Reset CRC, p. 63		
Pulse/alarm Output, p. 51	Selecting from a list, p. 48		
Fuse Replacement, p. 87	Serial Communication, p. 53		
Glossary, p. 106	Simulation, p. 63		
Installation,	Unit-per-pulse, p. 52		
Compression Fitting - Insertion, p. 35	Unit settings, p. 56		
Lateral Placement, p. 23	Using the Local Display, p. 48		
Mounting, p. 23	Replacements Fuses, p. 87		
Orientation of Meter - Insertion, p. 29	Return Procedure, p. 104		
Introduction, p. 19	Sensor Cleaning, p. 87		
Level 2 password, p. 55	Sensor Orientation, p. 29		
Local Display, p. 21	Simulation Mode, p. 63		
Local Input Wiring, p. 37	Theory of Operation, p. 19		
Mass Flow, p. 19	To program the display, p. 54		
Measurement Mode, p. 47	Troubleshooting, p. 92		
Menu Tree,	Alarm Codes, p. 95		
BioCal™ Menu, p. 16	General, p. 92		
BioSelect™, p. 17	Installation Problems, p. 94		
Digital Output, p. 12	USB Interface, p. 46		
Display Menu, p. 15	Warranty, p. 106		
Engineering Display, p. 16	Wiring		
Main Menu, p. 11	Alarms, p. 40		
Flow Menu 1, p. 13	Pulse/Alarm Outputs, p. 40		
Flow Menu 2, p. 14	Grounding, p. 36		
Mounting meter, p. 23	Input - Local, p. 37		
Orientation of meter - Insertion type, p. 29	Instructions, p. 35		
Password	Local meters, p. 37		
Level 1, p. 55	Power Input, p. 37		
Level 2, p. 55	Precautions, p. 36		
Programming, p. 55			



# Wiring



# **Definition of Terms**



# Troubleshooting Tips



# NOTE! is used for Notes and Information



WARNING! is used to indicate a hazardous situation which, if not avoided, could result in death or serious injury.



CAUTION! is used to indicate a hazardous situation which, if not avoided, could result in minor or moderate injury.



Indicates compliance with the WEEE Directive. Please dispose of the product in accordance with local regulations and conventions.



Indicates compliance with the applicable European Union Directives for Safety and EMC (Electromagnetic Compatibility Directive 2014/30/EU).

Enclosure Protection Classification per IEC 60529: Protected against the ingress of dust and Immersion.

